



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest April 27, 2015

RECALL Subject : Passenger Air Bag Inflator may Rupture , 1 INVESTIGATION(S)

Report Receipt Date: APR 17, 2015

NHTSA Campaign Number: 15V226000

Component(s): AIR BAGS

Potential Number of Units Affected: 45,000

Vehicle Make	Model	Model Year(s)
• NISSAN	SENTRA	2006

Manufacturer: Nissan North America, Inc.

SUMMARY:

Nissan North America, Inc. (Nissan) is recalling certain model year 2006 Sentra vehicles manufactured January 2, 2006, to August 26, 2006, originally sold, or currently registered, in geographic locations associated with high absolute humidity. Specifically, vehicles sold, or currently registered, in Puerto Rico, Hawaii, the U.S. Virgin Islands, Guam, Saipan, American Samoa, Florida and adjacent counties in southern Georgia, as well as the coastal areas of Alabama, Louisiana, Mississippi and Texas. Upon deployment of the passenger side frontal air bag, excessive internal pressure may cause the inflator to rupture.

CONSEQUENCE:

In the event of a crash necessitating deployment of the passenger side frontal air bag, the inflator could rupture with metal fragments striking and potentially seriously injuring the vehicle

occupants.

REMEDY:

Nissan will notify owners, and dealers will replace the passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Front Brake Hose Assemblies may Corrode and Leak

Report Receipt Date: APR 15, 2015

NHTSA Campaign Number: 15V225000

Component(s): SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected: 4,907

Vehicle Make	Model	Model Year(s)
• CADILLAC	CTS-V	2004-2007

Manufacturer: General Motors LLC

SUMMARY:

General Motors LLC (GM) is recalling certain model year 2004-2007 Cadillac CTS-V vehicles manufactured between September 6, 2003, and June 11, 2007, currently registered, or originally sold, in Connecticut, Delaware, Illinois, Indiana, Iowa, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, New Hampshire, New Jersey, New York, Ohio, Pennsylvania, Rhode Island, Vermont, West Virginia, Wisconsin and the District of Columbia. In the affected vehicles, snow or water containing road salt or other contaminants may corrode the front brake hose fitting at the caliper.

CONSEQUENCE:

Corrosion may cause the brake system to leak which could lengthen the distance needed to stop the vehicle and increase the risk of a crash.

REMEDY:

GM will notify owners, and dealers will replace both front brake hose assemblies, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Vehicle Speed may Unexpectedly Increase

Report Receipt Date: APR 07, 2015

NHTSA Campaign Number: 15V206000

Component(s): VEHICLE SPEED CONTROL

Potential Number of Units Affected: 443

Vehicle Make	Model	Model Year(s)
• KENWORTH	K300	2015-2016
• PETERBILT	220	2015-2016

Manufacturer: PACCAR Incorporated

SUMMARY:

PACCAR Incorporated (PACCAR) is recalling certain model year 2015-2016 Peterbilt 220 and Kenworth K300 trucks manufactured September 1, 2014, to March 30, 2015. Each time the cruise control speed decrease button is pressed, the vehicle speed will actually increase by one mile per hour due to a software issue.

CONSEQUENCE:

If a driver is intending to slow down a vehicle but instead it inadvertently speeds up, there is an increased risk of a crash.

REMEDY:

PACCAR will notify owners, and dealers will update the cab controller software, free of charge. The manufacturer has not yet provided a notification schedule.