



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest December 17, 2012

Report Date :**December 17, 2012 at 10:43 AM**
NHTSA CAMPAIGN ID Number:**12V563000**

Vehicle Make / Model: LAND ROVER / EVOQUE LAND ROVER / LR2	Model Year(s): 2012 2012
Manufacturer: Jaguar Land Rover North America, LLC	Report Receipt Date: DEC 06, 2012
NHTSA CAMPAIGN ID Number: 12V563000	NHTSA Action Number: N/A

Component: SERVICE BRAKES, HYDRAULIC:FOUNDATION
COMPONENTS:DISC:CALIPER

Potential Number of Units Affected: 70

Summary:

Jaguar Land Rover is recalling certain model year 2012 LR2 and Range Rover Evoque vehicles manufactured on June 11, 2012. The rear brake caliper retaining bolts may be insufficiently torqued.

Consequence:

Insufficiently torqued brake caliper bolts may result in the brake caliper detaching. A detached brake caliper may lead to a loss of brake function. Additionally, the caliper may strike a wheel resulting in the sudden deflation of a tire. Either situation may increase the risk of a vehicle crash.

Remedy:

Jaguar Land Rover will notify owners, and dealers will inspect and tighten the rear brake caliper retaining bolts, free of charge. The recall is expected to begin on, or before, January 18, 2013. Owners may contact Jaguar Land Rover at 1-800-452-4827.

Report Date :**December 17, 2012 at 10:45 AM**
NHTSA CAMPAIGN ID Number:**12V573000**

Vehicle Make / Model: ACURA / MDX HONDA / ODYSSEY HONDA / PILOT	Model Year(s): 2003-2006 2003-2004 2003-2004
Manufacturer: Honda (American Honda Motor Co.)	Report Receipt Date: DEC 11, 2012
NHTSA CAMPAIGN ID Number: 12V573000	NHTSA Action Number: PE12026

Component: ELECTRICAL SYSTEM:IGNITION:SWITCH

Potential Number of Units Affected: 807,161

Summary:

Honda is recalling certain model year 2003 and 2004 Pilot and Odyssey and 2003 through 2006 Acura MDX passenger vehicles manufactured from November 26, 2001, through August 30, 2006. The interlock lever of the ignition switch may deform, which can allow the interlock function of a vehicle with an automatic transmission to be defeated.

Consequence:

Removal of the ignition key when the gear selector of a vehicle with an automatic transmission has not been shifted to the park position can allow the vehicle to roll away, increasing the risk of a crash.

Remedy:

Honda will notify owners and instruct them to take their vehicle to a Honda or Acura dealer. The dealer will install an updated shift interlock lever and, if necessary, replace the ignition switch, free of charge. The recall is expected to begin on, or about, February 7, 2013. Owners may contact Honda at 1-800-999-1009.

Report Date :**December 17, 2012 at 10:46 AM**

NHTSA CAMPAIGN ID Number:**12V564000**

Vehicle Make / Model:

PREVOST / X3-45

Manufacturer: Prevost Cars, Inc.

NHTSA CAMPAIGN ID Number: 12V564000

Model Year(s):

2011-2012

Report Receipt Date: DEC 06, 2012

NHTSA Action Number: N/A

Component: EQUIPMENT

Potential Number of Units Affected: 87

Summary:

Prevost is recalling certain model year 2011-2012 X3-45 coach buses manufactured June 3, 2010, through August 25, 2011 and equipped with an Automatic Fire Detection and Suppression System (AFSS). As built, the affected vehicles have the AFSS storage tank in the engine compartment. High temperatures in the engine compartment area may cause the pressure relief valve to release the contents of the AFSS storage tank.

Consequence:

If the event of a fire, the AFSS may not operate as designed, increasing the risk of injury to the coach occupants.

Remedy:

Prevost will notify owners, and dealers will relocate the extinguisher storage tank, free of charge. The recall is expected to begin in late December 2012. Owners may contact Prevost at 1-418-883-2888 x 6558.

Report Date :**December 17, 2012 at 10:47 AM**

NHTSA CAMPAIGN ID Number:**12V560000**

Vehicle Make / Model:

DODGE / DURANGO

Manufacturer: Chrysler Group LLC

NHTSA CAMPAIGN ID Number: 12V560000

Model Year(s):

2013

Report Receipt Date: DEC 04, 2012

NHTSA Action Number: N/A

Component: SEATS

Potential Number of Units Affected: 734

Summary:

Chrysler is recalling certain model year 2013 Durango vehicles manufactured April 27, 2012, through September 14, 2012. The vehicles may have been built with incorrect seating capacity information labels. The label might overstate the seating capacity. Therefore, these vehicles fail to comply with the requirements of FMVSS number 110 "Tire Selection and Rims."

Consequence:

The vehicle may be filled over capacity which could increase injury during a vehicle crash.

Remedy:

Chrysler will notify owners, and provide replacement labels free of charge. At the owner's option, they may take their vehicle to a Chrysler dealer for installation of the label. The service will be performed free of charge. The recall is expected to begin in February 2013. Owners may contact Chrysler at 1-800-247-9753.