



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

December 26, 2016

Seat Mounted Air Bag Non-Deployment

If the air bag inflator initiator fails to ignite, the air bag will not deploy, increasing the risk of injury.

NHTSA Campaign Number: 16V910000

Manufacturer Chrysler (FCA US LLC)

Components AIR BAGS

Potential Number of Units Affected 23

Summary

Chrysler (FCA US LLC) is recalling certain model year 2017 RAM ProMaster vehicles manufactured October 1, 2016, to December 7, 2016. The seat mounted side air bag inflator initiator may fail to ignite during a crash.

Remedy

Chrysler will notify owners, and dealers will replace the seat mounted side air bags, free of charge. The recall is expected to begin January 28, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S96.

Vehicle

MAKE MODEL YEAR

RAM PROMASTER 2017

Air Bag Fasteners May Loosen Affecting Deployment

If the air bag was installed with incorrect fasteners, the fasteners may become loose over time, affecting the air bag deployment and increasing the risk of injury.

NHTSA Campaign Number: 16V906000

Manufacturer Toyota Motor Engineering & Manufacturing

Components AIR BAGS

Potential Number of Units Affected 12

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2016 Avalon, and 2017 Camry vehicles manufactured August 3, 2016, to September 12, 2016. The front passenger knee air bag module may have been attached to the lower instrument panel with incorrect fasteners.

Remedy

Toyota will notify owners, and dealers will inspect the fasteners, and if necessary, replace the instrument panel brace and body bracket and reattach the air bag assembly, free of charge. The recall is expected to begin in December 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is G05.

Vehicles

MAKE MODEL YEAR

TOYOTA AVALON 2016

TOYOTA CAMRY 2017

Insufficient Welds On Rear Side Air Bag Inflator

Insufficient welds could cause the inflator to separate and propel air bag debris into the cabin during a crash. Also, the inflator could fail to inflate during a crash, increasing the risk of injury.

NHTSA Campaign Number: 16V870000

Manufacturer General Motors LLC

Components AIR BAGS

Potential Number of Units Affected 113

Summary

General Motors LLC (GM) is recalling certain 2017 Malibu vehicles manufactured on November 10, 2016. The right-hand rear ARC side air bag inflator manifold may have insufficient welds.

Remedy

GM will notify owners, and dealers will replace the rear side air bag modules, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is 16146.

Vehicle

MAKE	MODEL YEAR
-------------	-------------------

CHEVROLET	MALIBU 2017
-----------	-------------