



# Automotive Safety Council

Prevent Protect Notify

## NHTSA Recalls of Interest February 24, 2014

### RECALL Subject : Seat Mounted Side Air bag Wiring

**Report Receipt Date:** FEB 04, 2014

**NHTSA Campaign Number:** 14V031000

**Component(s):**

**Potential Number of Units Affected:** 733

Vehicle	MakeModel	Model Year(s)
• MITSUBISHI	OUTLANDER SPORT	2013

**Manufacturer:** Mitsubishi Motors North America, Inc.

#### SUMMARY:

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain model year 2013 Outlander Sport vehicles manufactured July 20, 2012, through May 29, 2013 and equipped with leather seats. In the affected vehicles, the driver side seat mounted air bag wiring may have been improperly routed during the leather seat cover installation process.

#### CONSEQUENCE:

If the wiring is routed incorrectly, using the seat height adjustment may damage the wiring resulting in illumination of the air bag warning light. Subsequently, in the event of a crash necessitating air bag deployment, the driver side seat mounted air bag may not deploy, increasing the risk of injury.

#### REMEDY:

Mitsubishi will notify owners and dealers will inspect the wiring of the driver side seat mounted air bag and re-route the wire if necessary, free of charge. If the wire is damaged, the seat mounted airbag will be replaced, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Mitsubishi at 1-800-222-0037