



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

January 23, 2017

Possible Passenger Airbag Non-Deployment/FMVSS 208

NHTSA Campaign Number: 16V939000

Manufacturer Nissan North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 509

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2017 Infiniti QX30 vehicles manufactured August 11, 2016, to September 27, 2016. The affected vehicles have Autoliv passenger air bag inflators with NCS Pyrotechnic initiator that may fail to ignite during a crash, preventing the air bag from deploying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

Remedy

Nissan will notify owners, and dealers will replace the passenger air bag assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

Vehicle

MAKE MODEL YEAR

INFINITI QX30 2017

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V006000

Manufacturer Toyota Motor Engineering & Manufacturing

Components AIR BAGS

Potential Number of Units Affected 543,326

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2012 Toyota 4Runner, Corolla, Corolla Matrix, Sienna, Yaris, Scion xB, Lexus ES350, GX460, IS-F, IS250, IS350, IS250C, IS350C, and Lexus LFA vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Toyota is recalling certain 2009 Toyota Corolla, Corolla Matrix, Yaris, Yaris HB, Scion xB, Pontiac Vibe, Lexus, ES350, IS250, IS350, and IS-F vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Toyota is recalling certain 2006-2008 Lexus IS250 and IS350, 2007-2008 Lexus ES350, Toyota Yaris, Yaris HB, and 2008 Lexus IS-F and Scion xB vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Toyota will notify the Toyota, Scion and Lexus owners. General Motors will contact the Pontiac owners. Depending on the model, dealers will replace the passenger frontal air bag inflator or the air bag assembly, free of charge. Interim letters informing owners that parts are not yet available are expected to begin January 30, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Toyota customer service at 1-800-331-4331, or Pontiac customer service at 1-800-762-2737. Toyota's numbers for interim notification for this campaign are G1P (Toyota Zone A), G1R (Toyota Zone B), H1A (Toyota Zone C), G2G (Lexus Zone A), G2H (Lexus Zone B) and H2A (Lexus Zone C). Toyota's numbers for final remedy for this campaign are G0P (Toyota Zone A), G0R (Toyota Zone B), H0A (Toyota Zone C), GLG (Lexus Zone A), GLH (Lexus Zone B) and HLA (Lexus Zone C).

Vehicles

MAKE	MODEL	YEAR
LEXUS	ES350	2007-2009, 2012
LEXUS	GX460	2012
LEXUS	IS 250	2006-2009, 2012
LEXUS	IS 250C	2012
LEXUS	IS 350	2006-2009, 2012
LEXUS	IS 350C	2012
LEXUS	IS F	2008-2009, 2012
LEXUS	LFA	2012
PONTIAC	VIBE	2009
SCION	XB	2008-2009, 2012
TOYOTA	4RUNNER	2012
TOYOTA	COROLLA	2009, 2012
TOYOTA	COROLLA MATRIX	2009, 2012
TOYOTA	SIENNA	2012
TOYOTA	YARIS	2007-2009, 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V011000

Manufacturer Mazda North American Operations

Components AIR BAGS

Potential Number of Units Affected 8,018

Summary

Mazda North America Operations (Mazda) is recalling certain 2009 RX-8 vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Mazda is recalling certain 2005-2006 MPV and 2005-2008 RX-8 vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Mazda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0617A.

Vehicles

MAKE MODEL YEAR

MAZDA MPV	2005-2006
MAZDA RX-8	2005-2009

[Passenger Frontal Air Bag Inflator May Rupture](#)

NHTSA Campaign Number: 17V012000

Manufacturer Mazda North American Operations

Components AIR BAGS

Potential Number of Units Affected 85,098

Summary

Mazda North America Operations (Mazda) is recalling certain 2012 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Mazda is recalling certain 2009 CX-7, CX-9 and Mazda6 vehicles sold, or ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Mazda is recalling certain 2007-2008 CX-7 and CX-9 sold, or ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota,

Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Mazda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0717A.

Vehicles

MAKE	MODEL	YEAR
MAZDA	CX-7	2007-2009, 2012
MAZDA	CX-9	2007-2009, 2012
MAZDA	MAZDA6	2009, 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V013000

Manufacturer Mazda North American Operations

Components AIR BAGS

Potential Number of Units Affected 696

Summary

Mazda North America Operations (Mazda) is recalling certain 2009 B-Series trucks sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Mazda is recalling certain 2007-2008 B-Series trucks sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash

necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Mazda will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall is expected to begin March 7, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 0817A.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

MAZDA	B-SERIES TRUCK	2007-2009
-------	----------------	-----------

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V014000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 53,480

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Subaru Baja, 2006-2011 Impreza (including WRX and STI models), 2006-2012 Tribeca, 2009-2012 Forester, Legacy, Outback, and 2012 WRX vehicles originally sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKA-17.

Vehicles

MAKE	MODEL	YEAR
SUBARU	BAJA	2005-2006
SUBARU	FORESTER	2009-2012
SUBARU	IMPREZA	2006-2011
SUBARU	LEGACY	2009-2012
SUBARU	OUTBACK	2009-2012
SUBARU	TRIBECA	2006-2012
SUBARU	WRX	2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V015000

Manufacturer Jaguar Land Rover North America, LLC

Components AIR BAGS

Potential Number of Units Affected 8,769

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2012 Land Rover Range Rover vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan) and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Land Rover is recalling certain 2009 Land Rover Range Rover vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia and West Virginia, or "Zone B."

Additionally, Land Rover is recalling certain 2007-2008 Land Rover Range Rover vehicles originally sold, or ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Land Rover will notify owners, and dealers will replace the front passenger air bag assemblies, free of charge. Parts are not currently available. Owners will be sent an interim notification around March 3, 2017. A second notice will be mailed when remedy parts are available. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is P082.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

LAND ROVER	RANGE ROVER	2007-2009, 2012
------------	-------------	-----------------

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V016000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 62,764

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Baja, 2006-2008 Impreza (including WRX and STI models), Tribeca, and 2006 Saab 9-2X vehicles, originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru will notify their owners. General Motors will notify Saab owners. Dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Subaru owners may contact Subaru customer service at 1-800-782-2783. Saab owners may contact the Saab Customer Assistance Center at 1-800-955-9007. Subaru's number for this recall is TKC-17.

Vehicles

MAKE	MODEL	YEAR
SAAB	9-2X	2006
SUBARU	BAJA	2005-2006
SUBARU	IMPREZA	2006-2008
SUBARU	TRIBECA	2006-2008

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V017000

Manufacturer Mercedes-Benz USA, LLC.

Components AIR BAGS

Potential Number of Units Affected 103,406

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2012 C300 4Matic, C250, C250 Coupe, C350, C350 Coupe 4Matic, C350 Coupe, C63 AMG, C63 AMG Coupe, E350 Coupe 4Matic, E350 Cabrio, E350 Coupe, E550 Cabrio, E550 Coupe, GLK350 4Matic, GLK350, SLS AMG Cabrio, and SLS AMG Coupe vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above MBUSA is recalling certain 2009 C300 4Matic, C300, C350 and C63 AMG vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above MBUSA is recalling certain 2008 C300 4Matic, C300, and C350 vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

MBUSA will notify owners, and dealers will replace the front passenger air bag modules, free of charge. Parts are not currently

available. Owners will be sent an interim notification starting in February 2017. A second notice will be mailed when remedy parts are available. Owners may contact MBUSA customer service at 1-877-496-3691

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	C250	2012
MERCEDES BENZ	C300	2008-2009, 2012
MERCEDES BENZ	C350	2008-2009, 2012
MERCEDES BENZ	C63	2009, 2012
MERCEDES BENZ	E350	2012
MERCEDES BENZ	E550	2012
MERCEDES BENZ	GLK350	2012
MERCEDES BENZ	SLS	2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V018000

Manufacturer Ferrari North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 825

Summary

Ferrari North America, Inc. (Ferrari) is recalling certain 2012 California, 458 Italia, 458 Spider, and FF vehicles sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Ferrari will notify owners, and dealers will replace the front passenger air bag assembly, free of charge. Ferrari plans to send an interim owner letter to owners beginning March 13, 2017, and a second letter will be sent when parts are available. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 61.

Vehicles

MAKE	MODEL	YEAR
FERRARI	458	2012
FERRARI	CALIFORNIA	2012
FERRARI	FF	2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V020000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 48,380

Summary

BMW of North America, LLC (BMW) is recalling certain 2012 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, X5 M, X6 xDrive35i, X6 xDrive50i, and X6 M vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, BMW is recalling certain 2009 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i, and X5 M vehicles, 2008-2009 X6 xDrive 35i, X6 xDrive50i, X6 M, and 2009 X5 xDrive35d vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, BMW is recalling certain 2007-2008 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5 M vehicles, and 2008 X6 xDrive35i, X6 xDrive50i, and X6 M vehicles originally sold, or ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington,

Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to high absolute humidity and temperature cycling.

Remedy

BMW will notify owners, and dealers will replace the front passenger air bag inflator or air bag module, free of charge. Interim letters informing owners that parts are not yet available are expected to be mailed March 1, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE	MODEL	YEAR
BMW	X5	2007-2009, 2012
BMW	X6	2008-2009, 2012

[Passenger Frontal Air Bag Inflator May Rupture](#)

NHTSA Campaign Number: 17V022000

Manufacturer Mitsubishi Motors North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 1,964

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2012 and 2014 i-MiEV vehicles.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

MMNA will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-17-001.

Vehicle

MAKE MODEL YEAR

MITSUBISHI I-MIEV 2012, 2014

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V023000

Manufacturer Tesla Motors, Inc.

Components AIR BAGS

Potential Number of Units Affected 2,997

Summary

Tesla Motors, Inc. (Tesla) is recalling certain 2012 Model S vehicles sold, or ever registered in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the frontal air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Tesla will notify owners, and dealers will replace the front passenger air bag, free of charge. The recall is expected to begin in January 2017. Owners may contact Tesla customer service at 1-877-798-3752.

Vehicle

MAKE MODEL YEAR

TESLA MODEL S 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V024000

Manufacturer Ford Motor Company

Components AIR BAGS

Potential Number of Units Affected 654,695

Summary

Ford Motor Company (Ford) is recalling certain 2012 Ford Fusion and Mustang and Lincoln Zephyr and MKZ vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, unless included in "Zone A" above, Ford is recalling certain 2009 Ford Ranger, Edge, Fusion and Mustang, Lincoln MKX, MKZ and Zephyr and Mercury Milan vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia and West Virginia, or "Zone B."

Additionally, unless included in "Zone A" or "Zone B" above, Ford is recalling certain 2007-2008 Ford Ranger, Edge and Lincoln MKX, 2006-2008 Ford Fusion, Mercury Milan, Lincoln Zephyr and MKZ, 2005-2008 Ford Mustang and 2005-2006 Ford GT vehicles originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Ford will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. Interim letters informing owners of the recall and that parts are not yet available are expected to begin February 27, 2017. Owners will receive a second notice when remedy parts become available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 17S01.

Vehicles

MAKE	MODEL	YEAR
FORD	EDGE	2007-2009
FORD	FUSION	2006-2009, 2012
FORD	GT	2005-2006

MAKE	MODEL	YEAR
FORD	MUSTANG	2005-2009, 2012
FORD	RANGER	2007-2009
LINCOLN	MKX	2007-2009
LINCOLN	MKZ	2006-2009, 2012
LINCOLN	ZEPHYR	2006-2009, 2012
MERCURY	MILAN	2006-2009

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V025000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 11,279

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2012 Freightliner 2500 and 3500 Sprinter and Mercedes-Benz 2500 and 3500 Sprinter vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, DVUSA is recalling certain 2009 Dodge 2500 and 3500 Sprinter and Freightliner 2500 and 3500 Sprinter vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the front passenger air bag module, free of charge. Interim letters informing owners about the recall and telling them that parts are not yet available are expected to be mailed in February 2017. Owners will receive a second notice when remedy parts become available. Owners may contact DVUSA customer service at 1-877-762-8267.

Vehicles

MAKE	MODEL	YEAR
DODGE	SPRINTER 2500	2009
DODGE	SPRINTER 3500	2009
FREIGHTLINER	SPRINTER 2500	2009, 2012
FREIGHTLINER	SPRINTER 3500	2009, 2012
MERCEDES BENZ	SPRINTER 2500	2012
MERCEDES BENZ	SPRINTER 3500	2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V026000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 69,529

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2005-2006 Baja, 2009 Forester, Legacy and Outback and 2006-2009 Impreza (including WRX and STI models) and Tribeca vehicles originally sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru will notify owners, and dealers will replace the passenger front air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-800-782-2783. Subaru's number for this recall is TKB-17.

Vehicles

MAKE	MODEL	YEAR
SUBARU	BAJA	2005-2006
SUBARU	FORESTER	2009
SUBARU	IMPREZA	2006-2009
SUBARU	LEGACY	2009
SUBARU	OUTBACK	2009
SUBARU	TRIBECA	2006-2009

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V027000

Manufacturer Jaguar Land Rover North America, LLC

Components AIR BAGS

Potential Number of Units Affected 8,191

Summary

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2012 Jaguar XF vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Unless included in "Zone A" above, Jaguar is recalling certain 2009 Jaguar XF vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Jaguar will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. Parts are not currently available. Owners will be sent an interim notification around March 3,

2017. A second notice will be mailed when remedy parts are available. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is J070.

Vehicle

MAKE MODEL YEAR

JAGUAR XF 2009, 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V028000

Manufacturer Nissan North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 152,554

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2012 Nissan Versa hatchbacks originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan) and the U.S. Virgin Islands, or "Zone A".

Additionally, if not included in "Zone A" above, Nissan is recalling certain 2009-2010 Infiniti M35 and M45 and 2009 Nissan Versa sedans and hatchbacks originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B".

Additionally, if not included in "Zone A" or "Zone B" above, Nissan is recalling certain 2005-2008 Infiniti FX35 and FX45, 2006-2010 Infiniti M35 and M45, and 2007-2008 Nissan Versa vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Nissan will notify owners, and dealers will replace the front passenger air bag inflators, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Nissan customer service at 1-800-647-7261.

Vehicles

MAKE	MODEL	YEAR
INFINITI	FX35	2005-2008
INFINITI	FX45	2005-2008
INFINITI	M35	2006-2010
INFINITI	M45	2006-2010
NISSAN	VERSA	2007-2009, 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V029000

Manufacturer Honda (American Honda Motor Co.)

Components AIR BAGS

Potential Number of Units Affected 308,884

Summary

Honda (American Honda Motor Co.) is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2011 Honda Element vehicles, 2005-2012 Acura RL vehicles, 2006-2012 Honda Ridgeline vehicles, 2007-2008 Honda Fit vehicles and 2005-2008 Honda Pilot vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, if not included in "Zone A" above, Honda is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2009 Acura RL and Honda Element vehicles, 2007-2008 Honda Fit vehicles, 2005-2008 Honda Pilot vehicles and 2006-2009 Honda Ridgeline vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, if not included in "Zone A" or "Zone B" above, Honda is recalling certain 2005-2006 Acura MDX and Honda CR-V vehicles, 2005-2008 Acura RL, Honda Element and Honda Pilot vehicles, 2007-2008 Honda Fit vehicles and 2006-2008 Honda Ridgeline vehicles originally sold, or

ever registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Honda will notify owners, and dealers will replace the front passenger air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are KD9 and KE0.

Vehicles

MAKE	MODEL	YEAR
ACURA	MDX	2005-2006
ACURA	RL	2005-2012
HONDA	CR-V	2005-2006
HONDA	ELEMENT	2005-2011
HONDA	FIT	2007-2008
HONDA	PILOT	2005-2008
HONDA	RIDGELINE	2006-2012

[Passenger Frontal Air Bag Inflator May Rupture](#)

NHTSA Campaign Number: 17V030000

Manufacturer Honda (American Honda Motor Co.)

Components AIR BAGS

Potential Number of Units Affected 977,708

Summary

Honda (American Honda Motor Co.) is recalling certain 2009-2012 Acura TSX, 2011-2012 Acura TSX Wagon, 2010-2012 Acura ZDX, 2008-2012 Honda Accord, 2010-2012 Honda Accord Crosstour and Honda Insight, 2009-2012 Honda Fit, 2009-2012 Pilot, 2007-2011 Honda CR-V, 2012 Honda

FCX Clarity and 2006-2011 Honda Civic, Civic Hybrid, Civic NGV vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, if not included in "Zone A" above, Honda is recalling certain 2009 Acura TSX, Honda Fit and Pilot, 2008-2009 Honda Accord, 2006-2009 Civic, Civic Hybrid and Civic NGV, and 2007-2009 Honda CR-V vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, if not included in "Zone B" above, Honda is recalling certain 2008 Honda Accord, 2006-2008 Honda Civic, Civic Hybrid and Civic NGV and 2007-2008 Honda CR-V vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Honda will notify owners, and dealers will replace the front passenger side air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are KE1 and KE2.

Vehicles

MAKE	MODEL	YEAR
ACURA	TSX	2009-2012
ACURA	TSX SPORTSWAGON	2011-2012
ACURA	ZDX	2010-2012
HONDA	ACCORD	2008-2012
HONDA	ACCORD CROSSTOUR	2010-2012
HONDA	CIVIC	2006-2011
HONDA	CIVIC HYBRID	2006-2011
HONDA	CR-V	2007-2011
HONDA	FCX CLARITY	2012
HONDA	FIT	2009-2012
HONDA	INSIGHT	2010-2012
HONDA	PILOT	2009-2012

Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V031000

Manufacturer Honda (American Honda Motor Co.)

Components AIR BAGS

Potential Number of Units Affected 882

Summary

Honda (American Honda Motor Co.) is recalling certain 2006-2009 and 2012 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A."

Additionally, if not included in "Zone A," Honda is recalling certain 2006-2009 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, if not included in Zone A or Zone B above, Honda is recalling certain 2006-2008 Honda GL1800 (Goldwing) motorcycles originally sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Honda will notify owners, and dealers will replace the air bag module, free of charge. The recall is expected to begin January 24, 2017. Owners may contact Honda Motorcycle Customer Support at 1-866-784-1870. Honda's number for this recall is KE5.

Vehicles

MAKE	MODEL	YEAR
HONDA	GL1800	2006-2009, 2012
HONDA	GOLDWING	2006-2009, 2012

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V032000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 33,421

Summary

Volkswagen Group of America, Inc. (Volkswagen) is calling certain 2009 Audi A4 Cabriolet, S4 Cabriolet, A6 Avant, A6 Sedan and S6 Sedan vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B."

Additionally, unless included in "Zone B" above, Volkswagen is recalling certain 2005-2008 Audi A4 Avant, A4 Sedan, A6 Sedan, S4 Avant and S4 Sedan vehicles, 2007-2008 A4 Cabriolet, RS4 Sedan, S4 Cabriolet and S6 Sedan vehicles, and 2006-2008 A6 Avant and 2008 RS4 Cabriolet vehicles originally sold, or ever registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Audi will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin in February 2017. Owners may contact Audi customer service at 1-800-253-2834.

Vehicles

MAKE MODEL YEAR

AUDI	A4	2005-2009
AUDI	A6	2005-2009
AUDI	RS4	2007-2008
AUDI	S4	2005-2009
AUDI	S6	2007-2009