



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

July 23, 2012

Report Date :**July 23, 2012 at 11:15 AM**
NHTSA CAMPAIGN ID Number:**12V338000**

Vehicle Make / Model:

ACURA / ILX
HONDA / CR-V

Manufacturer: HONDA (AMERICAN HONDA MOTOR CO.)
NHTSA CAMPAIGN ID Number: 12V338000

Model Year(s):

2013
2012

Mfr's Report Date: JUL 18, 2012
NHTSA Action Number: N/A

Component: LATCHES/LOCKS/LINKAGES:DOORS:LATCH

Potential Number of Units Affected: 172,837

Summary:

Honda is recalling certain model year 2012 Honda CR-V and model year 2013 Acura ILX vehicles. If the manual or power door lock is activated while an interior front door handle is being operated by an occupant, the cable connecting the interior door handle to the door latch mechanism may become loose and move out of position. There is a possibility that the cable can move far enough out of position to prevent the door from properly latching.

Consequence:

If the door is not fully latched, the door may open while driving or in a crash, increasing the risk of personal injury to the vehicle occupants.

Remedy:

Honda will notify owners, and dealers will replace the front door latch assemblies in the affected vehicles, free of charge. Additionally, the interior front door handles in certain Honda CR-Vs will also be replaced, free of charge. The safety recall is expected to begin on, or about, August 16, 2012. Owners may contact Honda customer service at 1-800-999-1009.

Report Date :**July 23, 2012 at 11:18 AM**
NHTSA CAMPAIGN ID Number:**12V328000**

Vehicle Make / Model:

NISSAN / JUKE

Model Year(s):

2012

Manufacturer: NISSAN NORTH AMERICA, INC.
NHTSA CAMPAIGN ID Number: 12V328000

Mfr's Report Date: JUL 12, 2012
NHTSA Action Number: N/A

Component: SEATS

Potential Number of Units Affected: 11,076

Summary:

NISSAN IS RECALLING CERTAIN MODEL YEAR 2012 JUKE VEHICLES MANUFACTURED FROM FEBRUARY 3, 2012, THROUGH MAY 26, 2012. DUE TO AN INCOMPLETE WELD PENETRATION, THE REAR SEAT BACK STRIKER MAY PARTIALLY SEPARATE IN A CRASH.

Consequence:

IN THE EVENT OF A CRASH, THE REAR SEAT BACK MAY NOT BE SECURED, INCREASING THE RISK OF INJURY TO THE REAR SEAT OCCUPANTS.

Remedy:

NISSAN WILL NOTIFY OWNERS, AND DEALERS WILL REPLACE THE AFFECTED SEAT BACK STRIKERS, FREE OF CHARGE. THE RECALL IS SCHEDULED TO BEGIN AT THE END OF JULY 2012. OWNERS MAY CONTACT NISSAN CUSTOMER SERVICE AT 1-800-647-7261.

Report Date : July 23, 2012 at 11:19 AM NHTSA CAMPAIGN ID Number: 12V323000
--

Vehicle Make / Model:

VAN HOOL / TD925

Manufacturer: VAN HOOL N.V.

NHTSA CAMPAIGN ID Number: 12V323000

Model Year(s):

2011-2012

Mfr's Report Date: JUL 09, 2012

NHTSA Action Number: N/A

Component: SEATS

Potential Number of Units Affected: 152

Summary:

Van Hool is recalling certain model year 2011-2012 TD925 motorcoaches. For the driver's seat, an incorrect riser and floor adapter plate was installed in vehicles during production. Thus, these vehicles fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 207, "Seating Systems."

Consequence:

In the event of a crash, there is an increased risk of injury to the seat occupant.

Remedy:

Van Hool will notify owners via its dealer ABC Bus Inc. and replace the riser and floor adapter plates free of charge. The recall is expected to begin on, or about, September 15, 2012. Owners may contact the warranty administrator for ABC Bus, Inc. toll free at 1-877-427-7278.