



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest March 2, 2015

RECALL Subject : Electric Power Steering Assist may be Disabled

Report Receipt Date: FEB 23, 2015

NHTSA Campaign Number: 15V100000

Component(s): STEERING

Potential Number of Units Affected: 204,768

Vehicle Make	Model	Model Year(s)
• HYUNDAI	ELANTRA	2008-2010
• HYUNDAI	ELANTRA TOURING	2009-2010

Manufacturer: Hyundai Motor America

SUMMARY:

Hyundai Motor America (Hyundai) is recalling certain model year 2008-2010 Elantra vehicles manufactured June 1, 2008, to April 30, 2010, and 2009-2010 Elantra Touring vehicles manufactured November 1, 2008, to April 30, 2010. The electronic power steering (EPS) electronic control unit (ECU) may sense a discrepancy in the steering input signals and, as a result, disable the steering power assist.

CONSEQUENCE:

If power steering assist is lost, greater driver effort would be required to steer the vehicle at low speeds, increasing the risk of a crash.

REMEDY:

Hyundai will notify owners, and dealers will verify the proper operation of the Electronic Power Steering and update the EPS control unit, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Fuel Starvation may cause Vehicle Stall

Report Receipt Date: FEB 18, 2015
NHTSA Campaign Number: 15V091000
Component(s): FUEL SYSTEM, GASOLINE
Potential Number of Units Affected: 355

Vehicle Make	Model	Model Year(s)
• JAGUAR	XF	2013

Manufacturer: Jaguar Land Rover North America, LLC

SUMMARY:

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain model year 2013 XF vehicles manufactured September 11, 2012, to October 8, 2012. The electronic modules which control the fuel pump may shut down causing the fuel pump to stop pumping fuel.

CONSEQUENCE:

The fuel pump shutdown will result in the vehicle stalling. The vehicle would also lose power-assisted braking and power-assisted steering. Any of these conditions may increase the risk of a vehicle crash.

REMEDY:

Jaguar will notify owners, and dealers will inspect, and install if necessary, an additional wiring harness to the in-tank fuel pump, free of charge. The recall is expected to begin April 17, 2015

RECALL Subject : Electronic Parking Brake may Drag

Report Receipt Date: FEB 11, 2015
NHTSA Campaign Number: 15V085000
Component(s): PARKING BRAKE
Potential Number of Units Affected: 1,177

Vehicle Make	Model	Model Year(s)
• CHEVROLET	IMPALA	2014

Manufacturer: General Motors LLC

SUMMARY:

General Motors LLC (GM) is recalling certain model year 2014 Chevrolet Impala vehicles manufactured November 15, 2012, to May 27, 2014. In the affected vehicles, the electronic parking brake piston actuation arm may not fully retract causing the brake pads to stay partially engaged. Thus, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Systems (FMVSS) No. 135 "Light Vehicle Brake Systems."

CONSEQUENCE:

Brake pads that remain partially engaged with the rotors may cause excessive brake heat that may result in a fire.

REMEDY:

GM will notify owners, and dealers will reprogram the electronic parking brake control module with new software, free of charge. The manufacturer has not yet provided a notification schedule. Owners

may contact Chevrolet customer service at 1-800-222-1020 FREE (Chevrolet). GM's number for this recall is 15100. Note: This recall covers a limited population of vehicles that were remedied incorrectly under recall 14V-541.

RECALL Subject : Passenger Air Bag May Be Disabled

Report Receipt Date: FEB 18, 2015

NHTSA Campaign Number: 15V093000

Component(s): AIR BAGS

Potential Number of Units Affected: 61,793

Vehicle Make	Model	Model Year(s)
• LAND ROVER	RANGE ROVER	2013-2015
• LAND ROVER	RANGE ROVER SPORT	2014-2015

Manufacturer: Jaguar Land Rover North America, LLC

SUMMARY:

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain model year 2013-2015 Land Rover Range Rover vehicles manufactured August 23, 2012, to February 5, 2015, and 2014-2015 Range Rover Sport vehicles manufactured June 16, 2013, to February 5, 2015. In the affected vehicles, a light weight adult front seat passenger may be improperly classified by the occupant classification system (OCS) and, as a result, the front seat passenger air bag may be disabled.

CONSEQUENCE:

If the front passenger air bag is disabled during a vehicle crash, there is an increased risk of injury.

REMEDY:

Land Rover will notify owners, and dealers will update the OCS software, free of charge. The recall is expected to begin April 17, 2015.