



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest March 21, 2016

RECALL Subject : Absence of Front Seat Belt Audible Warning

Report Receipt Date: MAR 10, 2016

NHTSA Campaign Number: 16V145000

Component(s): SEAT BELTS

Potential Number of Units Affected: 34,200

Vehicle Make	Model	Model Year(s)
• HYUNDAI	SANTA FE	2016-2017

Manufacturer: Hyundai Motor America

SUMMARY:

Hyundai Motor America (Hyundai) is recalling certain model year 2016-2017 Santa Fe vehicles manufactured September 1, 2015 to February 12, 2016. In the affected vehicles, the wires in the front seat belt buckle harnesses may be damaged by the Johnson Controls seat height adjuster mechanism, resulting in a failure to provide an audible warning when front seat occupants do not fasten their seat belts. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

CONSEQUENCE:

Without a warning to remind the front seat occupants that their seat belts are not buckled, they may forget to buckle their seat belt, increasing their risk of injury in the event of a crash.

REMEDY:

Hyundai will notify owners, and dealers will inspect and reroute the wires in the front seat belt buckle harnesses to their proper locations, as necessary, free of charge. The recall is expected to begin May 6, 2016.

RECALL Subject : Improper Plating on Fuel Pump may Result in Stall

Report Receipt Date: MAR 11, 2016

NHTSA Campaign Number: 16V149000

Component(s): FUEL SYSTEM, GASOLINE

Potential Number of Units Affected: 46,671

Vehicle Make	Model	Model Year(s)
• NISSAN	ROGUE	2014

Manufacturer: Nissan North America, Inc.

SUMMARY:

Nissan North America, Inc. (Nissan) is recalling certain model year 2014 Nissan Rogue vehicles manufactured July 25, 2013, to December 21, 2013, and February 1, 2014, to June 7, 2014. Improper nickel plating of components within the Bosch fuel pump may result in the fuel pump failing.

CONSEQUENCE:

If the fuel pump fails, the vehicle may stall without warning, increasing the risk of a crash.

REMEDY:

Nissan will notify owners, and dealers will replace the fuel pump, free of charge. The manufacturer has not yet provided a notification schedule.