



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

May 30, 2016

RECALL Subject : Air Bag Second Stage may not Inflate Properly

Report Receipt Date: APR 26, 2016

NHTSA Campaign Number: 16V247000

Component(s): AIR BAGS

Potential Number of Units Affected: 695

Vehicle Make	Model	Model Year(s)
• FORD	FLEX	2009-2012
• FORD	TAURUS	2008
		2010-2012
• FORD	TAURUS X	2008-2009
• LINCOLN	MKS	2009,2011
• MERCURY	SABLE	2008

Manufacturer: Ford Motor Company

SUMMARY:

Ford Motor Company (Ford) is recalling certain model year 2009-2012 Ford Flex, 2008 and 2010-2012 Ford Taurus, 2008-2009 Ford Taurus X, 2008 Mercury Sable, 2009 and 2011 Lincoln MKS vehicles. The Key Safety Systems driver frontal air bag may improperly inflate during second-stage deployment in the event of a high speed crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

CONSEQUENCE:

An improperly inflated air bag increases the risk of injury in the event of a crash.

REMEDY:

Ford will notify owners, and dealers will inspect and replace the driver's frontal air bag module, as necessary, free of charge. The recall is expected to begin on June 13, 2016.

RECALL Subject : Electronic Stability Control Systems/FMVSS 126

Report Receipt Date: MAY 05, 2016
NHTSA Campaign Number: 16V272000
Component(s): ELECTRONIC STABILITY CONTROL
Potential Number of Units Affected: 66

Vehicle Make	Model	Model Year(s)
• CHEVROLET	MALIBU	2016

Manufacturer: General Motors LLC

SUMMARY:

General Motors LLC (GM) is recalling certain model year 2016 Chevrolet Malibu vehicles manufactured March 7, 2016, through March 12, 2016. The memory chip in the ZF TRW electronic brake control module (EBCM) may fail and cause the loss of electronically controlled brake systems including anti-lock brakes (ABS) and electronic stability control (ESC). As such, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems."

CONSEQUENCE:

If the EBCM fails the primary braking system will still function, however, the loss of ABS and ESC increase the risk of a crash.

REMEDY:

GM will notify owners, and dealers will install a replacement EBCM, free of charge. The recall is expected to begin on June 10, 2016.

RECALL Subject : Clockspring Assembly May Become Contaminated , 1 INVESTIGATION(S)

Report Receipt Date: MAY 11, 2016
NHTSA Campaign Number: 16V288000
Component(s): AIR BAGS
Potential Number of Units Affected: 7,180

Vehicle Make	Model	Model Year(s)
• JEEP	WRANGLER	2011-2016

Manufacturer: Chrysler (FCA US LLC)

SUMMARY:

Chrysler (FCA US LLC) is recalling certain model year 2011-2016 Right Hand Drive Jeep Wrangler vehicles manufactured February 16, 2010, to May 2, 2016. The clockspring assembly may become contaminated with dust and cause the air bag circuit to fail.

CONSEQUENCE:

Failure of the air bag circuit may prevent the driver's frontal air bag from deploying in the event of a crash, increasing the risk of injury.

REMEDY:

Chrysler will notify owners, and dealers will replace the clockspring, wheel back cover, and column shroud, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Clockspring Assembly May Become Contaminated , 1 INVESTIGATION(S)

Report Receipt Date: MAY 11, 2016

NHTSA Campaign Number: 16V290000

Component(s): AIR BAGS

Potential Number of Units Affected: 394,258

Vehicle Make	Model	Model Year(s)
• JEEP	WRANGLER	2007-2010

Manufacturer: Chrysler (FCA US LLC)

SUMMARY:

Chrysler (FCA US LLC) is recalling certain model year 2007-2010 Jeep Wrangler JK vehicles manufactured March 2, 2006, to August 13, 2010. The clockspring assembly may become contaminated with dust and cause the air bag circuit to fail.

CONSEQUENCE:

Failure of the air bag circuit may prevent the driver's frontal air bag from deploying in the event of a crash, increasing the risk of injury.

REMEDY:

Chrysler will notify owners, and dealers will replace the clockspring, wheel back cover, and column shroud, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Propulsion System May Shut Down

Report Receipt Date: MAY 16, 2016
NHTSA Campaign Number: 16V303000
Component(s): ELECTRICAL SYSTEM
Potential Number of Units Affected: 16,549

Vehicle Make	Model	Model Year(s)
• FIAT	500E	2013-2016

Manufacturer: Chrysler (FCA US LLC)

SUMMARY:

Chrysler (FCA US LLC) is recalling certain model year 2013-2016 Fiat 500e vehicles manufactured March 22, 2012, to January 29, 2016. The Robert Bosch power inverter module (PIM) may experience voltage spikes which can cause the propulsion system to shut down and loss of motive power.

CONSEQUENCE:

Loss of motive power can increase the risk of a crash.

REMEDY:

Chrysler will notify owners, and dealers will update the PIM software, free of charge. Interim notices will be sent to owners in June 2016. Owners will receive a second notice when remedy software become available.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 23, 2016
NHTSA Campaign Number: 16V334000
Component(s): AIR BAGS
Potential Number of Units Affected: 38,628

Vehicle Make	Model	Model Year(s)
• MITSUBISHI	LANCER	2006-2007
• MITSUBISHI	LANCER EVOLUTION	2006-2007

Manufacturer: Mitsubishi Motors North America, Inc.

SUMMARY:

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain model year 2006-2007 Lancer and Lancer Evolution vehicles manufactured June 29, 2005, to June 19, 2007, equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating air bag deployment, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

MMNA will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 23, 2016

NHTSA Campaign Number: 16V340000

Component(s): AIR BAGS

Potential Number of Units Affected: 1,654,713

Vehicle Make	Model	Model Year(s)
• LEXUS	ES350	2007-2011
• LEXUS	GX460	2010-2011
• LEXUS	IS 250	2006-2011
• LEXUS	IS 250C	2010-2011
• LEXUS	IS 350	2006-2011
• LEXUS	IS 350C	2010-2011
• LEXUS	IS F	2008-2011
• PONTIAC	VIBE	2009-2010
• SCION	XB	2008-2011
• TOYOTA	4RUNNER	2010-2011
• TOYOTA	COROLLA	2009-2011
• TOYOTA	MATRIX	2009-2011
• TOYOTA	SIENNA	2011
• TOYOTA	YARIS	2006-2011

Manufacturer: Toyota Motor Engineering & Manufacturing

SUMMARY:

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain model year 2008-2011 Scion xB and Lexus IS F, 2009-2011 Toyota Corolla and Corolla Matrix, 2006-2011 Toyota Yaris, Lexus IS250 and Lexus IS350, 2010-2011 Toyota 4Runner, Lexus IS250C, Lexus IS350C and Lexus GX460, 2011 Sienna, 2007-2011 Lexus ES350, and 2009-2010 Pontiac Vibe vehicles,

originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Toyota is recalling certain model year 2008 Scion xB and Lexus IS F, 2007-2008 Toyota Yaris, 2006-2008 Lexus IS250 and Lexus IS350 and 2007-2008 Lexus ES350 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Vehicles of these model years and models that were not originally sold or ever registered in either Zones A or B are not subject to this safety recall. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Toyota will notify the Toyota and Lexus owners. General Motors will contact the Pontiac owners. Depending on the model, dealers will replace the passenger frontal air bag inflator or the air bag assembly, free of charge. An interim notification to owners will be mailed by July 22, 2016. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for interim notification for this campaign are G1P (Toyota Zone A), G1R (Toyota Zone B), G2G (Lexus Zone A), and G2H (Lexus Zone B). Toyota's numbers for final remedy for this campaign are G0P (Toyota Zone A), G0R (Toyota Zone B), GLG (Lexus Zone A), and GLH (Lexus Zone B).

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 23, 2016

NHTSA Campaign Number: 16V341000

Component(s): AIR BAGS

Potential Number of Units Affected: 2,820

Vehicle Make	Model	Model Year(s)
• FERRARI	458 ITALIA	2010-2011
• FERRARI	CALIFORNIA	2009-2011

Manufacturer: Ferrari North America, Inc.

SUMMARY:

Ferrari North America, Inc. (Ferrari) is recalling certain model year 2009-2011 Ferrari California vehicles manufactured February 16, 2009, to July 8, 2011, and model year 2010-2011 458 Italia vehicles manufactured March 5, 2010, to July 29, 2011. These vehicles are equipped with Takata air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment. In the event of a crash necessitating air bag deployment, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. The manufacturer has not yet provided a notification schedule.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 24, 2016

NHTSA Campaign Number: 16V344000

Component(s): AIR BAGS

Potential Number of Units Affected: 1,786,115

Vehicle Make	Model	Model Year(s)
• ACURA	MDX	2003-2006
• ACURA	RL	2005-2011
• HONDA	CR-V	2005-2006
• HONDA	ELEMENT	2003-2011
• HONDA	FIT	2007-2008
• HONDA	ODYSSEY	2002-2004
• HONDA	PILOT	2003-2008
• HONDA	RIDGELINE	2006-2011

Manufacturer: Honda (American Honda Motor Co.)

SUMMARY:

Honda (American Honda Motor Co.) is recalling certain model year 2003-2006 Acura MDX, 2005-2011 Acura RL, 2005-2006 Honda CR-V, 2003-2011 Element, 2007-2008 Fit, 2003-2008 Pilot, 2002-2004 Odyssey, and 2006-2011 Ridgeline vehicles originally sold, or that have ever been registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Honda is recalling certain model year 2003-2006 Acura MDX, 2005-2008 Acura RL, 2005-2006

Honda CR-V, 2003-2008 Element, 2007-2008 Fit, 2003-2008 Pilot, 2002-2004 Odyssey, and 2006-2008 Ridgeline vehicles originally sold, or that have ever been registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Lastly, unless included in "Zone A" or "Zone B" above, Honda is recalling model year 2002-2004 Odyssey and model year 2003-2004 Acura MDX, Honda Element, and Honda Pilot vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming. These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Honda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin June 27, 2016. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are KA0, KA1, KA2, and KA3.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

-RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 24, 2016

NHTSA Campaign Number: 16V346000

Component(s): AIR BAGS

Potential Number of Units Affected: 2,720,390

Vehicle Make	Model	Model Year(s)
• ACURA	TSX	2009-2011
• ACURA	TSX SPORTSWAGON	2011
• ACURA	ZDX	2010-2011
• HONDA	ACCORD	2008-2011
• HONDA	ACCORD CROSSTOUR	2010-2011
• HONDA	CIVIC	2006-2011

• HONDA	CIVIC GX	2006-2011
• HONDA	CIVIC HYBRID	2006-2011
• HONDA	CR-V	2007-2011
• HONDA	FCX CLARITY	2010-2011
• HONDA	FIT	2009-2011
• HONDA	INSIGHT	2010-2011
• HONDA	PILOT	2009-2011

Manufacturer: Honda (American Honda Motor Co.)

SUMMARY:

Honda (American Honda Motor Co.) is recalling certain model year 2009-2011 Acura TSX, 2011 TSX Wagon, 2010-2011 Acura ZDX, 2008-2011 Honda Accord, 2010-2011 Accord Crosstour, 2006-2011 Civic, Civic Hybrid, and Civic GX, 2007-2011 CR-V, 2010-2011 FCX Clarity and Insight, and 2009-2011 Fit, and Pilot vehicles originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless already included in "Zone A" above, Honda is recalling certain model year 2008 Honda Accord, 2006-2008 Civic, Civic Hybrid and Civic GX, and 2007-2008 CR-V vehicles originally sold, or ever registered, in Arizona, Arkansas, Delaware, the District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Vehicles not originally sold or ever registered in either Zones A or B are not subject to this safety recall. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Honda will notify owners, and dealers will replace the inflator, free of charge. Remedy parts are expected to be available in late Summer/Fall 2016. Interim notices will be mailed to owners beginning June 27, 2016. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall is KA4, KA5, KA6, and KA7.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 24, 2016
NHTSA Campaign Number: 16V347000
Component(s): AIR BAGS
Potential Number of Units Affected: 2,701

Vehicle Make	Model	Model Year(s)
• HONDA	GL1800	2006-2010

Manufacturer: Honda (American Honda Motor Co.)

SUMMARY:

Honda (American Honda Motor, Inc.) is recalling certain model year 2006-2010 Honda GL1800 (Gold Wing) motorcycles manufactured February 8, 2006, to May 14, 2009 originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Honda is recalling certain model year 2006-2008 Honda GL 1800 (Gold Wing) motorcycles manufactured May 10, 2007, to May 14, 2009 originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Motorcycles not originally sold or ever registered in either Zones A or B are not subject to this safety recall. These motorcycles are equipped with an air bag inflator assembled as part of the air bag module, used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the rider resulting in serious injury or death.

REMEDY:

Honda will notify owners, and dealers will replace the air bag module containing the inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-866-784-1870. Honda's number for this recall is KA8.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 24, 2016
NHTSA Campaign Number: 16V349000
Component(s): AIR BAGS
Potential Number of Units Affected: 402,450

Vehicle Make	Model	Model Year(s)
• INFINITI	FX35	2005-2008
• INFINITI	FX45	2005-2008
• INFINITI	I30	2003-2004
• INFINITI	I35	2003-2004
• INFINITI	M35	2006-2010
• INFINITI	M45	2006-2010
• NISSAN	VERSA	2007-2011

Manufacturer: Nissan North America, Inc.

SUMMARY:

Nissan North America, Inc. (Nissan) is recalling certain model year 2005-2008 Infiniti FX35 and FX45, 2003-2004 Infiniti I30 and I35, 2006-2010 Infiniti M35 and M45, and 2007-2011 Nissan Versa vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Nissan is recalling certain model year 2005-2008 Infiniti FX35 and FX45, 2003-2004 Infiniti I30 and I35, 2006-2008 Infiniti M35 and M45, and 2007-2008 Nissan Versa vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Lastly, unless included in "Zone A" or "Zone B" above, Nissan is recalling certain model year 2003-2004 Infiniti I30 and I35 vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming. These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. These inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Nissan will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. Parts are not currently available. Owners will be sent an interim notification by the end of July 2016. A second notice will be mailed when remedy parts are available. Owners may contact Nissan customer service at 1-800-647-7261.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 24, 2016

NHTSA Campaign Number: 16V352000

Component(s): AIR BAGS

Potential Number of Units Affected: 4,322,870

Vehicle Make	Model	Model Year(s)
• CHRYSLER	300	2005-2012
• CHRYSLER	ASPEN	2007-2009
• DODGE	CHALLENGER	2008-2012
• DODGE	CHARGER	2006-2012
• DODGE	DAKOTA	2005-2011
• DODGE	DURANGO	2004-2009
• DODGE	MAGNUM	2005-2008
• DODGE	RAM 1500	2004-2008
• DODGE	RAM 2500	2005-2009
• DODGE	RAM 3500	2006-2010
• DODGE	RAM 4500	2008-2009
• DODGE	RAM 5500	2008-2009
• JEEP	WRANGLER	2007-2012
• MITSUBISHI	RAIDER	2006-2009
• RAM	4500	2010
• RAM	5500	2010
• STERLING	BULLET 4500	2008-2009
• STERLING	BULLET 5500	2008-2009

Manufacturer: Chrysler (FCA US LLC)

SUMMARY:

Chrysler (FCA US LLC) is recalling certain model year 2004-2008 RAM 1500, 2005-2009 RAM 2500, 2006-2009 RAM 3500, 2007-2010 RAM 3500 Cab Chassis, 2008-2010 RAM 4500 and 5500 Cab Chassis, 2008-2009 Sterling 4500 and 5500 Cab Chassis, 2004-2009 Dodge Durango, 2007-2009 Chrysler Aspen, 2007-2012 Jeep Wrangler, 2008-2012 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2012 Chrysler 300, 2006-2012 Dodge Charger, 2005-2011 Dodge Dakota, and 2006-2009 Mitsubishi Raider vehicles originally sold, or ever registered, in AL, CA, FL, GA, HI, LA, MS, SC, TX, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Chrysler is also recalling 2004-2008 RAM 1500, 2005-2009 RAM 2500, 2006-2009 RAM 3500, 2007-2009 RAM 3500 Cab Chassis, 2008-2009 RAM 4500 and 5500 Cab Chassis, 2008-2009 Sterling 4500 and 5500 Cab Chassis, 2004-2009 Dodge Durango,

2007-2009 Chrysler Aspen, 2007-2009 Jeep Wrangler, 2008-2009 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2009 Chrysler 300, 2006-2009 Dodge Charger, 2005-2009 Dodge Dakota and 2006-2009 Mitsubishi Raider vehicles originally sold, or ever registered, in AZ, AR, DE, Washington D.C., IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV, or "Zone B." Lastly, unless included in "Zone A" or "Zone B" above, Chrysler is recalling certain 2005-2008 RAM 2500, 2006-2008 RAM 3500, 2007-2008 RAM 3500 Cab Chassis, 2008 RAM 4500 and 5500 Cab Chassis, 2008 Sterling 4500 and 5500 Cab Chassis, 2004-2008 Dodge Durango, 2007-2008 Chrysler Aspen, 2007-2008 Jeep Wrangler, 2008 Dodge Challenger, 2005-2008 Dodge Magnum, 2005-2008 Chrysler 300, 2006-2008 Dodge Charger, 2005-2008 Dodge Dakota, and 2006-2008 Mitsubishi Raider vehicles originally sold, or registered, in AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY.

CONSEQUENCE:

These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. These inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling. An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Chrysler will notify the Chrysler, Dodge, Jeep and RAM owners. Sterling and Mitsubishi owners will be notified by their respective companies. Dealers will replace the passenger frontal air bag inflator, free of charge. A notification schedule has not yet been provided. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is S43.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 25, 2016

NHTSA Campaign Number: 16V354000

Component(s): AIR BAGS

Potential Number of Units Affected: 495,348

Vehicle Make	Model	Model Year(s)
• MAZDA	MAZDA6	2003-2008
• MAZDA	MAZDASPEED6	2006-2007
• MAZDA	MPV	2004-2006

Manufacturer: Mazda North American Operations

SUMMARY:

Mazda North American Operations (Mazda) is recalling certain model year 2004-2011 RX-8, 2004-2006 MPV, 2003-2008 Mazda6, and 2006-2007 Mazdaspeed6 vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Mazda is recalling certain model year 2004-2008 RX-8, 2004-2006 MPV, 2003-2008 Mazda6 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Lastly, unless included in "Zone A" or "Zone B" above, Mazda is recalling certain model year 2004 Mazda RX-8 and MPV, 2003-2004 Mazda6 vehicles originally sold, or registered, in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming. These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Mazda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin July 15, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9416E.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 25, 2016

NHTSA Campaign Number: 16V356000

Component(s): AIR BAGS

Potential Number of Units Affected: 236,280

Vehicle Make	Model	Model Year(s)
• MAZDA	CX-7	2007-2011
• MAZDA	CX-9	2007-2011
• MAZDA	MAZDA6	2009-2011

Manufacturer: Mazda North American Operations

SUMMARY:

Mazda North America Operations (Mazda) is recalling certain model year 2009-2011 Mazda6, 2007-2011 CX-7 and CX-9 vehicles, originally sold, or ever registered, in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." Additionally, unless included in "Zone A" above, Mazda is recalling certain model year 2007-2008 CX-7 and CX-9 vehicles, originally sold, or ever registered, in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." Vehicles of these model years and models that were not originally sold or ever registered in either Zones A or B are not subject to this safety recall. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Mazda will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin July 15, 2016. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 9516E.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1

INVESTIGATION(S)

Report Receipt Date: MAY 25, 2016

NHTSA Campaign Number: 16V358000

Component(s): AIR BAGS

Potential Number of Units Affected: 159,274

Vehicle Make	Model	Model Year(s)
• SAAB	9-2X	2006
• SUBARU	BAJA	2003-2006
• SUBARU	FORESTER	2009-2011
• SUBARU	IMPREZA	2006-2011
• SUBARU	LEGACY	2003-2004
		2009-2011
• SUBARU	OUTBACK	2003-2004
		2009-2011
• SUBARU	TRIBECA	2006-2011

Manufacturer: Subaru of America, Inc.

SUMMARY:

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, 2009-2011 Legacy, Outback, Forester, 2006-2011 Impreza, Tribeca, 2003-2006 Baja, and 2006 Saab 9-2x vehicles originally sold or that have ever been registered in Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands, or "Zone A." These vehicles may be equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Subaru will notify their owners. General Motors will notify Saab owners. Dealers will replace the passenger frontal air bag inflator, free of charge. A notification schedule has not yet been provided. Owners may contact Subaru customer service at 1-856-488-8500. Saab owners may contact GM at 1-800-955-9007. Subaru's number for this recall is TKA-16.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 25, 2016

NHTSA Campaign Number: 16V359000

Component(s): AIR BAGS

Potential Number of Units Affected: 135,696

Vehicle Make	Model	Model Year(s)
• SAAB	9-2X	2006
• SUBARU	BAJA	2003-2006
• SUBARU	IMPREZA	2006-2008
• SUBARU	LEGACY	2003-2004
• SUBARU	OUTBACK	2003-2004
• SUBARU	TRIBECA	2006-2008

Manufacturer: Subaru of America, Inc.

SUMMARY:

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, 2006-2008 Impreza, Tribeca, 2006 Saab 9-2x, and 2003-2006 Baja vehicles originally sold or that have ever been registered in Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia, or "Zone B." These vehicles may be equipped certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Subaru will notify their owners. General Motors will notify Saab owners. Dealers will replace the passenger frontal air bag inflator, free of charge. A notification schedule has not yet been provided. Owners may contact Subaru customer service at 1-856-488-8500. Subaru's number for this recall is TKB-16. Note: This notice is only for vehicles that were not covered by 16V-358 for Zone A.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Passenger Frontal Air Bag Inflator May Rupture , 1 INVESTIGATION(S)

Report Receipt Date: MAY 25, 2016

NHTSA Campaign Number: 16V361000

Component(s): AIR BAGS

Potential Number of Units Affected: 88,131

Vehicle Make	Model	Model Year(s)
• SUBARU	BAJA	2003-2004
• SUBARU	LEGACY	2003-2004
• SUBARU	OUTBACK	2003-2004

Manufacturer: Subaru of America, Inc.

SUMMARY:

Subaru of America, Inc. (Subaru) is recalling certain model year 2003-2004 Legacy, Outback, and Baja vehicles originally sold or that have ever been registered in Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming, or "Zone C.". These vehicles may be equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules, and used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the front air bags, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

CONSEQUENCE:

An inflator rupture may result in metal fragments striking the vehicle occupants resulting in serious injury or death.

REMEDY:

Subaru will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Subaru customer service at 1-856-488-8500. Subaru's number for this recall is TKC-16. Note: This recall covers vehicles that were not previously covered in 16V-358 for Zone A or 16V-359 for Zone B.

NOTES:

Owners may also contact the National Highway Traffic Safety Administration Vehicle Safety Hotline at 1-888-327-4236 (TTY 1-800-424-9153), or go to www.safercar.gov.

RECALL Subject : Child Seat Tether Anchor Blocked/FMVSS225

Report Receipt Date: MAY 24, 2016
NHTSA Campaign Number: 16V343000
Component(s): CHILD SEAT
Potential Number of Units Affected: 5

Vehicle Make	Model	Model Year(s)
• LINCOLN	MKX	2016

Manufacturer: Ford Motor Company

SUMMARY:

Ford Motor Company (Ford) is recalling certain model year 2016 Lincoln MKX vehicles manufactured September 24, 2015. An incorrect Magna International seat back trim cover was installed on the affected vehicles, blocking the child seat tether anchors in the second row center seating position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 225, "Child restraint anchorage systems."

CONSEQUENCE:

An improperly anchored child seat can increase the risk of injury in a crash.

REMEDY:

Ford will notify owners, and dealers will replace the seat back trim cover and tether cover bezel on the second row, free of charge. The recall is expected to begin on June 13, 2016.

RECALL Subject : Loss of Brake Fluid

Report Receipt Date: MAY 24, 2016
NHTSA Campaign Number: 16V345000
Component(s): SERVICE BRAKES, HYDRAULIC
Potential Number of Units Affected: 225,012

Vehicle Make	Model	Model Year(s)
• FORD	F-150	2013-2014

Manufacturer: Ford Motor Company

SUMMARY:

Ford Motor Company (Ford) is recalling certain model year 2013-2014 F-150 vehicles manufactured August 1, 2013, to August 31, 2014 equipped with 3.5L engines. The Hitachi brake master cylinder reservoir may lose brake fluid into the brake booster.

CONSEQUENCE:

A loss of brake fluid may reduce or cause a complete loss of front brake function. Each of these scenarios increases the risk of a crash.

REMEDY:

Ford will notify owners, and dealers will replace the brake master cylinder and, if necessary, the brake booster, free of charge. The recall is expected to begin on July 11, 2016.