



Automotive Safety Council

Prevent Protect Notify

NHTSA Related Recalls

August 22, 2011

Report Date : **August 22, 2011 at 08:35 AM**
NHTSA Campaign ID number : **11V415000**

[New Search](#)

Vehicle Make / Model:

ISUZU / NPR
ISUZU / NQR

Manufacturer: ISUZU MANUFACTURING SERVICES OF AMERICA
NHTSA CAMPAIGN ID Number: 11V415000

Model Year(s):

2012
2012

Mfr's Report Date: AUG 15, 2011
NHTSA Action Number: N/A

Component: VEHICLE SPEED CONTROL

Potential Number of Units Affected: 614

Summary:

ISUZU IS RECALLING CERTAIN MODEL YEAR 2012 N-SERIES TRUCKS EQUIPPED WITH GASOLINE ENGINES, MANUFACTURED FROM APRIL 27, 2011, THROUGH JULY 26, 2011. DUE TO A CALIBRATION ERROR IN THE ECM SOFTWARE, IN THE EVENT OF A FAILURE OR MALFUNCTION OF THE BRAKE PEDAL SWITCH, APPLICATION OF THE BRAKE PEDAL WILL NOT CAUSE THE CRUISE CONTROL TO BE CANCELED.

Consequence:

THIS CONDITION COULD RESULT IN A VEHICLE CRASH.

Remedy:

ISUZU WILL NOTIFY OWNERS, AND DEALERS WILL REPROGRAM THE ECM SOFTWARE FREE OF CHARGE. THE SAFETY RECALL IS EXPECTED TO BEGIN LATE AUGUST OR EARLY SEPTEMBER 2011. OWNERS MAY CONTACT ISUZU AT 1-866-455-7595.

Notes:

Report Date :**August 22, 2011 at 08:36 AM**
NHTSA Campaign ID number :**11V409000**

New Search

Vehicle Make / Model:	Model Year(s):
PORSCHE / 911 CARRERA	2012
PORSCHE / 911 CARRERA 4	2012
PORSCHE / 911 CARRERA 4 GTS	2012
PORSCHE / 911 CARRERA 4S	2012
PORSCHE / 911 CARRERA GTS	2012
PORSCHE / 911 CARRERA S	2012
PORSCHE / 911 GT3 RS	2011
PORSCHE / 911 SPEEDSTER	2011
PORSCHE / 911 TARGA 4	2012
PORSCHE / 911 TARGA 4S	2012
PORSCHE / 911 TURBO	2012
PORSCHE / 911 TURBO S	2012
PORSCHE / BOXSTER	2012
PORSCHE / BOXSTER S	2012
PORSCHE / BOXSTER SPYDER	2012
PORSCHE / CAYMAN	2012
PORSCHE / CAYMAN R	2012
PORSCHE / CAYMAN S	2012

Manufacturer: PORSCHE CARS NORTH AMERICA, INC.
NHTSA CAMPAIGN ID Number: 11V409000

Mfr's Report Date: AUG 03, 2011
NHTSA Action Number: N/A

Component: SEAT BELTS

Potential Number of Units Affected: 235

Summary:

PORSCHE IS RECALLING CERTAIN MODEL YEAR 2011 911 SPEEDSTER AND 911 GTS RS 4.0; AND MODEL YEAR 2012 BOXSTER (INCLUDING S AND SPYDER); CAYMAN (INCLUDING S AND R); 911 CARRERA (INCLUDING S, GTS, 4, 4S, AND 4 GTS); 911 TARGA 4 AND TARGA 4S; AND 911 TURBO AND TURBO S MODELS MANUFACTURED FROM MAY 31, 2011, THROUGH JUNE 10, 2011. THERE IS A POSSIBILITY THAT THE MOUNTING HOLES IN THE SEAT BELT ANCHOR PLATES FITTED TO THE VEHICLE ARE TOO SMALL. IF THE HOLE DIAMETER IS TOO SMALL, THE ANCHOR PLATE MAY NOT BE ABLE TO ROTATE ABOUT THE FASTENING BOLT AS DESIGNED.

Consequence:

SHOULD THIS OCCUR, THE SEAT BELT MAY NOT BE ROUTED OPTIMALLY AROUND THE OCCUPANT, OR MAY POTENTIALLY LOOSEN AT SOME POINT IN THE FUTURE INCREASING THE RISK OF INJURY DURING A CRASH.

Remedy:

PORSCHE WILL NOTIFY OWNERS, AND DEALERS WILL INSPECT THE SEAT BELT ANCHORS AND, IF NECESSARY, REPLACE THE SEAT BELT. THE REPAIRS WILL BE PERFORMED FREE OF CHARGE. THE SAFETY RECALL IS EXPECTED TO BEGIN DURING AUGUST 2011. OWNERS MAY CONTACT PORSCHE AT 1-800-767-7243.
