



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

August 14, 2017

[Seatbelt May Not Adequately Protect Head/FMVSS 201](#)

NHTSA Campaign Number: 17V268000

Manufacturer Nissan North America, Inc.

Components SEAT BELTS

Potential Number of Units Affected 44,264

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2016-2017 Nissan Titan Crew Cab and Titan XD Crew Cab vehicles. In the event of a crash, the rear seatbelt assembly may not adequately protect the occupant's head, allowing it to contact the D-ring bolt trim cap. As such, these vehicles fail to conform to Federal Motor Vehicle Safety Standard (FMVSS) number 201, "Occupant Protection in Interior Impact."

Remedy

Nissan will notify owners, and dealers will install energy absorbing material to the C-Pillar Finishers and replace the Seatbelt Bolt and Bolt Cap, free of charge. The recall is expected to begin September 26, 2017. Owners may contact Nissan customer service at 1-800-647-7261.

Vehicle

MAKE MODEL YEAR

NISSAN TITAN 2016-2017

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V478000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 43,689

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2007-2009 Freightliner and Dodge Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain Takata air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the passenger side frontal air bag, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall fully supersedes recall 15V-354 and partially supersedes recalls 16V-379 and 17V-025.

Vehicles

MAKE	MODEL	YEAR
DODGE	SPRINTER 2500	2007-2009
DODGE	SPRINTER 3500	2007-2009
FREIGHTLINER	SPRINTER 2500	2007-2009
FREIGHTLINER	SPRINTER 3500	2007-2009

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V479000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 20,665

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2010-2011 Freightliner and Mercedes Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain Takata air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the front passenger side air bag, free of charge. The manufacturer has not yet

provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall partially supersedes recall 16V-379.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 2500	2010-2011
FREIGHTLINER	SPRINTER 3500	2010-2011
MERCEDES BENZ	SPRINTER 2500	2010-2011
MERCEDES BENZ	SPRINTER 3500	2010-2011

Passenger Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 17V480000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 17,609

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2012 Freightliner and Mercedes Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain Takata air bag inflators assembled into the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may rupture due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the front passenger side air bag, free of charge. The manufacturer has not yet

provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. Note: This recall supersedes recall 17V-025.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 2500	2012
FREIGHTLINER	SPRINTER 3500	2012
MERCEDES BENZ	SPRINTER 2500	2012
MERCEDES BENZ	SPRINTER 3500	2012

[Missing Child Anchorage Instructions/FMVSS 225](#)

NHTSA Campaign Number: 17V487000

Manufacturer General Motors LLC

Components CHILD SEAT

Potential Number of Units Affected 29,647

Summary

General Motors LLC (GM) is recalling certain 2017 Chevrolet Silverado 1500, and GMC Sierra 1500 trucks. The owner's manual for the affected vehicles may be missing instructions on how to use the tether anchorage and child restraint anchorage systems. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 225, "Child Restraint Anchorage Systems."

Remedy

GM will notify owners, and dealers will provide a corrected insert for the owner's manual, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-800-222-1020 (Chevrolet), or 1-800-462-8782 (GMC). GM's number for this recall is 17307.

Vehicles

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 1500	2017

MAKE	MODEL	YEAR
GMC	SIERRA 1500	2017

Incorrect Software Combination/FMVSS 101

NHTSA Campaign Number: 17V485000

Manufacturer Chrysler (FCA US LLC)

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 3,002

Summary

Chrysler (FCA US LLC) is recalling certain 2017 Jeep Renegade vehicles. Due to a Magneti Marelli software issue, multiple malfunction indicator lamps may illuminate on the instrument panel when no malfunction exists. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays."

Remedy

Chrysler will notify owners, and dealers will update the Instrument Panel Control software, free of charge. The recall is expected to begin September 16, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T50.

Vehicle

MAKE	MODEL	YEAR
JEEP	RENEGADE	2017