



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

September 25, 2017

[Incorrect Air Bag Installed/FMVSS 208](#)

NHTSA Campaign Number: 17V548000

Manufacturer Toyota Motor Engineering & Manufacturing

Components AIR BAGS

Potential Number of Units Affected 21

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2008-2016 Toyota Land Cruiser, 2006 Lexus LX470, and 2008-2013 Lexus LX570 vehicles. These vehicles may be equipped with an incorrect Toyota Gosei driver or front passenger air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

Remedy

Toyota will notify owners, and dealers will replace the affected air bag assemblies, free of charge. The recall is expected to begin September 25, 2017. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is H0S. Lexus' number for this recall is HLD.

Vehicles

MAKE	MODEL	YEAR
LEXUS	LX470	2006
LEXUS	LX570	2008-2013
TOYOTA	LAND CRUISER	2008-2016

Second Row Left Seat Belt may be Unlatched

NHTSA Campaign Number: 17V542000

Manufacturer Chrysler (FCA US LLC)

Components SEAT BELTS

Potential Number of Units Affected 47,927

Summary

Chrysler (FCA US LLC) is recalling certain 2017-2018 Chrysler Pacifica vehicles equipped with the 8-passenger seating option. In certain passenger seating and vehicle situations, the second-row center seating position seat belt buckle could cause the left outboard seat belt to become unlatched.

Remedy

Chrysler will notify owners, and dealers will install a shorter second-row seat belt buckle, free of charge. The recall is expected to begin October 20, 2017. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T54.

Vehicle

MAKE	MODEL	YEAR
CHRYSLER	PACIFICA	2017-2018

Weld Spatter may cause OCS fault

NHTSA Campaign Number: 17V546000

Manufacturer Mazda North American Operations

Components SEATS, STEERING, AIR BAGS

Potential Number of Units Affected 57,878

Summary

Mazda North American Operations (Mazda) is recalling certain 2015-2016 Mazda6 vehicles. Debris from the welding process during manufacturing of the front passenger seat frame may damage the occupant classification system (OCS) wiring.

Remedy

Mazda will notify owners, and dealers will attach a protective pad on the seat frame. If the OCS harness is damaged, insulating tape will be applied to the harness. These repairs will be performed free of charge. The recall is expected to begin September 29, 2017. Owners may contact Mazda customer service at 1-800-222-5500. Mazda's number for this recall is 1517H.

Vehicle

MAKE MODEL YEAR

MAZDA MAZDA6 2015-2016

Coolant may Contact EPCU and cause Stall

NHTSA Campaign Number: 17V532000

Manufacturer Hyundai Motor America

Components HYBRID PROPULSION SYSTEM

Potential Number of Units Affected 218

Summary

Hyundai Motor Company (Hyundai) is recalling certain 2017 Ioniq Electric Vehicles. Manufacturing defects within the Hyundai Mobis Electronic Power Control Unit (EPCU) may allow coolant to contact the unit's circuit board.

Remedy

Hyundai will notify owners, and dealers will inspect and replace the EPCU, as necessary, free of charge. The recall is expected to begin September 29, 2017. Owners may contact Hyundai Customer Service at 1-800-633-5151. Hyundai's number for this recall is 166.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

HYUNDAI	IONIQ ELECTRIC	2017
---------	----------------	------