



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

October 9, 2017

Passenger Side Front Air Bag Inflator may Rupture

NHTSA Campaign Number: 17V569000

Manufacturer Mitsubishi Motors North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 66,001

Summary

Mitsubishi Motors North America, Inc. (Mitsubishi) is recalling certain 2004-2006 Lancer and Lancer Evolution vehicles and 2004 Lancer Sportback vehicles. These vehicles are equipped with a Takata passenger side frontal air bag that may be susceptible to moisture intrusion which, over time, could cause the inflator to rupture.

Remedy

Mitsubishi will notify owners, and dealers will replace the front passenger air bag inflator with a different inflator, free of charge. The recall is expected to begin on October 22, 2017. Owners may contact Mitsubishi customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-17-001. Note: This recall supersedes recall 15V-321.

Vehicle

MAKE MODEL YEAR

MITSUBISHI LANCER 2004-2006

Loss of Power Steering Assist

NHTSA Campaign Number: 17V574000

Manufacturer Mercedes-Benz USA, LLC.

Components STEERING

Potential Number of Units Affected 4

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling one 2017 C43 AMG, one E300 4Matic sedan, one GLC300, and one E43 AMG 4Matic sedan. These vehicles have Bosch electrical power steering control units with improperly welded contact pins.

Remedy

MBUSA will notify owners, and dealers will replace the electric power steering rack, free of charge. The recall is expected to begin November 10, 2017. Owners may contact MBUSA customer service at 1-877-496-3691.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	C43 AMG	2017
MERCEDES BENZ	E300	2017
MERCEDES BENZ	E43 AMG	2017
MERCEDES BENZ	GLC300	2017
MERCEDES BENZ	METRIS	2015-2017

Fuel Pump Flange May Crack Causing Fuel Leak

NHTSA Campaign Number: 17V576000

Manufacturer Porsche Cars North America, Inc.

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 50,145

Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2003-2006 Cayenne S and Cayenne Turbo vehicles, 2004-2006 Cayenne vehicles, and 2006 Cayenne S "Titanium" Edition vehicles. These gasoline-powered vehicles have a Continental fuel pump flange that may crack, allowing fuel to leak.

Remedy

Porsche will notify owners, and dealers will replace the fuel filter flanges with new filter flanges that have a protective film, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AH10.

Vehicles

MAKE	MODEL	YEAR
PORSCHE	CAYENNE	2004-2006
PORSCHE	CAYENNE S	2003-2006
PORSCHE	CAYENNE TURBO	2003-2006

Front Coil Springs may Fracture and Puncture Tire

NHTSA Campaign Number: 17V577000

Manufacturer Hyundai Motor America

Components SUSPENSION

Potential Number of Units Affected 197

Summary

Hyundai Motor America (Hyundai) is recalling certain 2018 Santa Fe Sport vehicles. The Mando front coil springs may have been improperly manufactured and, as a result, may fracture under certain loads while driving.

Remedy

All of the affected vehicles are currently unsold on dealer lots. Dealers will replace both front coil springs, free of charge prior to the vehicle's sale. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 167.

Vehicle

MAKE	MODEL	YEAR
HYUNDAI	SANTA FE SPORT	2018

Fuel Filter Flange May Crack Causing Fuel Leak

NHTSA Campaign Number: 17V583000

Manufacturer Volkswagen Group of America, Inc.

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 73,941

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2004-2007 Touareg vehicles. These gasoline-powered vehicles have a Continental fuel filter flange that may crack, allowing fuel to leak.

Remedy

Volkswagen will notify owners, and dealers will inspect the fuel filter flange for cracks, replacing the flange if cracks are found. If no cracks are found, a protective cover will be installed onto the filter flange. These repairs will be performed free of charge. Parts are not currently available, but owners will be notified of the recall beginning November 19, 2017. A second notice will be sent when remedy parts become available. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 20Ai.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

VOLKSWAGEN	TOUAREG	2004-2007
------------	---------	-----------