



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

December 11, 2017

Impact Sensor Housing may Fracture

NHTSA Campaign Number: 17V712000

Manufacturer Chrysler (FCA US LLC)

Components AIR BAGS

Potential Number of Units Affected 3,514

Summary

Chrysler (FCA US LLC) is recalling certain 2018 Ram ProMaster vehicles. An incorrect rivet may have been used to attach the front door impact sensor which can cause the sensor housing to fracture.

Remedy

Chrysler will notify owners, and dealers will replace both front door impact pressure sensors, securing them with the correct rivets, free of charge. The recall is expected to begin January 3, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T64.

MAKE MODEL YEAR

RAM PROMASTER 2018

Power Steering may Malfunction and be Disabled

NHTSA Campaign Number: 17V714000

Manufacturer Mercedes-Benz USA, LLC.

Components STEERING

Potential Number of Units Affected 72

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2017 E300, S65 AMG Coupe, S550, S65 AMG Cabriolet, S550 Cabriolet, S550e, S65 AMG, and Mercedes-Maybach S600 vehicles. A transistor within the Thyssen Krupp Presta power steering control unit may overheat resulting in the power steering system being disabled.

Remedy

MBUSA will notify owners, and dealers will inspect the steering rack, replace it as necessary, free of charge. The recall is expected to begin in January 2018. Owners may contact MBUSA customer service at 1-877-496-3691.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	E300	2017
MERCEDES BENZ	S550	2017
MERCEDES BENZ	S550E	2017
MERCEDES BENZ	S65 AMG	2017
MERCEDES-MAYBACH	S600	2017

Inoperative Electronic Parking Brake/ FMVSS 135

NHTSA Campaign Number: 17V717000

Manufacturer Toyota Motor Engineering & Manufacturing

Components PARKING BRAKE

Potential Number of Units Affected 28,584

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018 Toyota CH-R vehicles. The Robert Bosch electronic parking brake (EPB) may not operate properly, possibly causing the parking brake not to disengage after it is applied or prevent it from being applied. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard FMVSS number 135, "Light Vehicle Brake Systems."

Remedy

Toyota has notified owners, and dealers will update the programming of the skid control ECU as necessary, free of charge. The recall began on November 30, 2017. Owners may contact Toyota at 1-800-331-4331. Toyota's number for this recall is H0W.

Vehicle

MAKE MODEL YEAR

TOYOTA C-HR 2018

Software Error for Instrument Panel/FMVSS 101

NHTSA Campaign Number: 17V719000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 3,188

Summary

BMW of North America, LLC (BMW) is recalling certain 2018 230i, 230i xDrive, M240i, M240i xDrive, M2, and X3 xDrive 30i SAV vehicles. These vehicles may have an error in the Continental software for the instrument panel, causing the display to not properly illuminate. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays."

Remedy

BMW will notify owners, and dealers will update the instrument cluster display software, free of charge. The recall is expected to begin January 8, 2018. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW	230I	2018
BMW	M2	2018
BMW	M240I	2018
BMW	X3	2018

Passenger Air Bag Inflator May Be Loose

NHTSA Campaign Number: 17V732000

Manufacturer Chrysler (FCA US LLC)

Components AIR BAGS

Potential Number of Units Affected 26,971

Summary

Chrysler (FCA US LLC) is recalling certain 2018 Jeep Compass vehicles. The ZF passenger side air bag assembly may have inflator mounting nuts loose within the module assembly.

Remedy

Chrysler will notify owners, and dealers will replace the passenger air bag module assembly, free of charge. The recall is expected to begin January 10, 2018. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is T73.

Vehicle

MAKE MODEL YEAR

JEEP	COMPASS	2018
------	---------	------

Brake Lights May Not Activate

NHTSA Campaign Number: 17V761000

Manufacturer Daimler Trucks North America LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 436,095

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2008-2018 Freightliner Cascadia, Western Star 4700, 4900, 5700, and 6900 trucks. After hard brake applications, the Kendrion brake light pressure switch may not activate the brake lights with a light application of the brake pedal.

Remedy

DTNA will notify owners, and dealers will repair the vehicles, free of charge. The recall is expected to begin January 25, 2018. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-756.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	CASCADIA	2008-2018
WESTERN STAR	4700	2008-2018
WESTERN STAR	4900	2008-2018
WESTERN STAR	5700	2008-2018
WESTERN STAR	6900	2008-2018