

# NHTSA Recalls of Interest February 26, 2018

# Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 18V025000

Manufacturer Toyota Motor Engineering & Manufacturing

**Components** AIR BAGS

**Potential Number of Units Affected** 116,126

#### Summary

On January 9, 2018, Toyota Motor Engineering & Manufacturing (Toyota) notified NHTSA that they are recalling 14,585 model year 2010-2012 Yaris vehicles ever registered in the states of Alaska, Arizona, Arkansas, Colorado, Connecticut, Delaware, District of Columbia, Idaho, Illinois, Indiana, Iowa, Kansas, Kentucky, Maine, Maryland, Massachusetts, Michigan, Minnesota, Missouri, Montana, Nebraska, Nevada, New Hampshire, New Jersey, New Mexico, New York, North Carolina, North Dakota, Ohio, Oklahoma, Oregon, Pennsylvania, Rhode Island, South Dakota, Tennessee, Utah, Vermont, Virginia, Washington, West Virginia, Wisconsin, and Wyoming.

As of January 30, 2018, Toyota is additionally recalling 3,347 model year 2010 Pontiac Vibe vehicles located in states listed above. Also included in this recall filing is 98,194 model year 2003-2008 Toyota Corolla Matrix vehicles, located throughout the U.S., that previously received a ?like-for-like? interim air bag inflator replacement.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

# Remedy

Toyota will notify owners, and dealers will replace the passenger frontal air bag assemblies with an alternate inflator, free of charge. The recall is expected to begin by March 10, 2018. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are GOR (Zone B), and HOA (Zone C), JOA (Matrix Zone A), JOA (Matrix Zone A), JOA (Matrix Zone A).

# Vehicles

MAKE MODEL YEAR

PONTIAC VIBE2010TOYOTACOROLLA MATRIX2003-2008TOYOTAYARIS2010-2012

# Incorrect Driver Air Bag Installed/FMVSS 208

## NHTSA Campaign Number: 18V102000

Manufacturer Volkswagen Group of America, Inc.

**Components** AIR BAGS

**Potential Number of Units Affected 3,768** 

#### Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2017-2018 Tiguan Limited vehicles. The front driver air bag installed on these vehicles may not be intended for use in vehicles sold in the United States. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

## Remedy

Volkswagen will notify owners, and dealers will replace the steering wheel and front driver air bag module, free of charge. The recall is expected to begin April 10, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 69V2.

## Vehicle

## MAKE MODEL YEAR

VOLKSWAGEN TIGUAN 2017-2018

# High Pressure Fuel Pump May Crack and Leak Fuel

# NHTSA Campaign Number: 18V107000

Manufacturer Toyota Motor Engineering & Manufacturing

**Components FUEL SYSTEM, GASOLINE** 

**Potential Number of Units Affected** 9,905

## Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2016-2018 Lexus GS F, 2018 LC500, and 2015-2018 Lexus RC F vehicles, equipped with 5.0L V8 2UR-GSE engines with two high pressure fuel pumps. Specific operating conditions may result in damage to the pulsation damper in one of the high pressure fuel pumps, possibly causing a fatigue crack in the fuel pump cover.

## Remedy

Toyota will notify owners, and dealers will replace the high pressure fuel pumps, free of charge. The recall is expected to begin April 2, 2018. Owners may contact Lexus customer service 1-800-255-3987. Toyota's numbers for this recall are J2B and JLB.

#### Vehicles

## MAKE MODEL YEAR

LEXUS GS F	2016-2018
LEXUS LC500	2018
LEXUS RC F	2015-2018

# Frontal Air Bags may not Deploy Properly

# NHTSA Campaign Number: 18V112000

Manufacturer Jaguar Land Rover North America, LLC

**Components** AIR BAGS

## **Potential Number of Units Affected 307**

## Summary

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2018 XF Sportbrake vehicles. The Supplemental Restraint System (SRS) calibration may be incorrect, possibly causing the frontal air bags to deploy improperly in a low speed crash.

# Remedy

Jaguar will notify owners, and dealers will update the software for the air bag system, free of charge. The recall is expected to begin April 6, 2018. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H090.

# Vehicle

# MAKE MODEL YEAR

JAGUAR XF 2018

# Steering Wheel May Detach from Steering Column

# NHTSA Campaign Number: 18V118000

Manufacturer Hyundai Motor America

**Components STEERING** 

**Potential Number of Units Affected** 43,941

## Summary

Hyundai Motor America (Hyundai) is recalling certain 2018 Hyundai Santa Fe and Santa Fe Sport vehicles. The steering wheel assembly may break, possibly resulting in the steering wheel separating from the steering column while driving.

## Remedy

Hyundai will notify owners, and dealers will check the production lot number of the steering wheel assembly, replacing it as necessary, free of charge. The recall is expected to begin March 16, 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 173.

## Vehicles

MAKE MODEL YEAR HYUNDAI SANTA FE 2018 HYUNDAI SANTA FE SPORT 2018

# Electronic Stability Control Deactivates/FMVSS 126

# NHTSA Campaign Number: 18V122000

Manufacturer Toyota Motor Engineering & Manufacturing

**Components ELECTRONIC STABILITY CONTROL** 

**Potential Number of Units Affected** 64,901

# Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018 Toyota Tundra and Sequoia vehicles. Electrical interference within the power supply circuit may cause the vehicle's electronic stability control system to be deactivated. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 126, "Electronic Stability Control Systems."

# Remedy

Toyota will notify owners, and dealers will update the vehicle's software, free of charge. The recall is expected to begin March 12, 2018. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is JOH.

# Vehicles

MAKE MODEL YEAR

TOYOTA SEQUOIA 2018 TOYOTA TUNDRA 2018