



# Automotive Safety Council

Prevent Protect Notify

## NHTSA Recalls of Interest

March 12, 2018

### [Air Bags/Seat Belt Pretensioners may be Disabled](#)

**NHTSA Campaign Number:** 18V137000

**Manufacturer** Hyundai Motor America

**Components** AIR BAGS, SEAT BELTS

**Potential Number of Units Affected** 154,753

#### **Summary**

Hyundai Motor America (Hyundai) is recalling certain 2011 Sonata vehicles. In the event of a crash, the ZF air bag control unit (ACU) may short circuit, preventing the frontal air bags, seat belt pretensioners, and side air bags from deploying.

#### **Remedy**

The remedy for this recall is still under development. The recall is expected to begin April 20, 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 174.

#### **Vehicle**

**MAKE MODEL YEAR**

HYUNDAI SONATA 2011

## Air Inlet Door may Detach Causing Windows to Fog

**NHTSA Campaign Number:** 18V139000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** VISIBILITY

**Potential Number of Units Affected** 7,090

### **Summary**

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2018 Range Rover Velar vehicles. The Denso air inlet door linkages for the ventilation system may detach, preventing the system from clearing fog or condensation from the windshield and windows.

### **Remedy**

Land Rover will notify owners, and dealers will update the vehicle software to control the length of movement of the ventilation actuator arm, free of charge. The recall is expected to begin April 23, 2018. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N143.

### **Vehicle**

<b>MAKE</b>	<b>MODEL</b>	<b>YEAR</b>
-------------	--------------	-------------

LAND ROVER	RANGE ROVER VELAR	2018
------------	-------------------	------

## Chafing Brake Hose may Cause Brake Fluid Leak

**NHTSA Campaign Number:** 18V140000

**Manufacturer** Jaguar Land Rover North America, LLC

**Components** SERVICE BRAKES, HYDRAULIC

**Potential Number of Units Affected** 41

### **Summary**

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2018 Jaguar E-Pace vehicles. The brackets that secure the front brake hoses may not have been installed properly, allowing the front brake hoses to contact the tires, possibly resulting in a brake fluid leak.

## **Remedy**

Jaguar will notify owners, and dealers will inspect the front brake hose brackets, replacing any that do not provide sufficient clearance, free of charge. The recall is expected to begin April 23, 2018. Owners may contact Jaguar customer service at 1-800-452-4827. Jaguar's number for this recall is H074.

## **Vehicle**

**MAKE MODEL YEAR**

JAGUAR E-PACE 2018

## **Key Can Be Removed Without Being in Park/FMVSS 114**

**NHTSA Campaign Number:** 18V141000

**Manufacturer** Ford Motor Company

**Components** POWER TRAIN, ELECTRICAL SYSTEM

**Potential Number of Units Affected** 2,100

## **Summary**

Ford Motor Company (Ford) is recalling certain 2017-2018 Ford Taurus vehicles equipped with mechanical key ignition systems. The keys for these vehicles may be able to be removed from the ignition when transmission is not in the PARK position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 114, "Theft Protection."

## **Remedy**

Ford will notify owners, and dealers will replace the shifter assembly, free of charge. The recall is expected to begin March 19, 2018. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 18C02.

## **Vehicle**

**MAKE MODEL YEAR**

FORD TAURUS 2017-2018