



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

July 23, 2018

[Side Air Bags may not Deploy Properly/FMVSS 214](#)

NHTSA Campaign Number: 18V420000

Manufacturer Bugatti

Components AIR BAGS

Potential Number of Units Affected 2

Summary

Bugatti is recalling certain 2018 Chiron vehicles. The heat shield for the gas generator for the Key Safety Systems side air bags may have been incorrectly installed during the air bag manufacturing process, potentially reducing the performance of the air bag. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 214, "Side Impact Protection."

Remedy

Bugatti will notify owners, and dealers will remove the affected seats to repair or replace them, free of charge. The recall is expected to begin June 20, 2018. Owners may contact Bugatti customer service at 1-805-557-1050.

Vehicle

MAKE MODEL YEAR

BUGATTI CHIRON 2018

Curtain Air Bags may not Deploy Properly/FMVSS 226

NHTSA Campaign Number: 18V426000

Manufacturer Mazda North American Operations

Components AIR BAGS

Potential Number of Units Affected 682

Summary

Mazda North American Operations (Mazda) is recalling certain 2018 Mazda CX-5 vehicles. In the event of a side impact or rollover crash, the Ashimori side curtain air bags may not properly unfold during deployment. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 226, "Ejection Mitigation."

Remedy

Mazda will notify owners, and dealers will replace the curtain air bags, free of charge. The recall is expected to begin in July 2018. Owners may contact Mazda customer service at 1-800-222-5500, Option 4. Mazda's number for this recall is 2718F.

Vehicle

MAKE MODEL YEAR

MAZDA CX-5 2018

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 18V427000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 237,947

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2005-2008 Audi A4 Sedan, A4 Avant, S4 Avant and S4 Sedan, 2007-2008 RS4 Sedan, 2004 RS4 Cabriolet, 2007-2009 A4 Cabriolet and S4 Cabriolet, 2005-2011 A6 Sedan, 2006-2011 A6 Avant, and 2007-2011 S6 Sedan vehicles. These vehicles are equipped with certain Takata air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these

inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Audi has notified owners, and dealers will replace the passenger frontal air bag with an alternate remedy part, free of charge. The recall began June 29, 2018. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 69R7. Note: This recall supersedes recalls 16V382, 17V032 and 18V004 and includes vehicles that may have had their air bag previously replaced under one of those campaigns.

Vehicles

| MAKE | MODEL | YEAR |
|-------------|--------------|-----------------|
| AUDI | A4 | 2005-2008 |
| AUDI | A4 CABRIOLET | 2007-2009 |
| AUDI | A6 | 2005-2011 |
| AUDI | RS4 | 2004, 2007-2008 |
| AUDI | S4 | 2005-2009 |
| AUDI | S6 | 2007-2011 |

Fuel Diaphragm Cracks may cause Fuel Leak

NHTSA Campaign Number: 18V432000

Manufacturer Toyota Motor Engineering & Manufacturing

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 114,998

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2007-2011 Lexus GS350 and GS450h, 2006-2013 Lexus IS350 and 2010-2014 Lexus IS350C vehicles, equipped with 3.5L V6 2GR-FSE gasoline engines. The Maruyasu diaphragms in the fuel pulsation dampers may harden over time and develop cracks, possibly causing a fuel leak.

Remedy

Toyota will notify owners, and dealers will replace the fuel delivery pipe with a new pipe that has improved pulsation dampers, free of charge. The recall is expected to begin August 9, 2018. Owners may contact Lexus customer service at 1-800-255-3987. Toyota's number for this recall is JLF.

Vehicles

MAKE MODEL YEAR

LEXUS GS 350 2007-2011

LEXUS GS 450H 2007-2011

LEXUS IS 350 2006-2013

LEXUS IS 350C 2010-2014