



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

August 13, 2018

[Passenger Air Bag May Deploy with a Child in Seat](#)

NHTSA Campaign Number: 18V496000

Manufacturer Hyundai Motor America

Components AIR BAGS

Potential Number of Units Affected 3,305

Summary

Hyundai Motor America (Hyundai) is recalling certain 2018 Genesis G80 vehicles. The IEE Occupant Classification System (OCS) may incorrectly detect that an adult is in the passenger seat, even if the seat is unoccupied. In the event of a crash, if a child or infant is in the seat, the front passenger air bag may deploy instead of being deactivated.

Remedy

Hyundai will notify owners, and dealers will reprogram the OCS, free of charge. The recall is expected to begin August 24, 2018. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 002G.

Vehicle**MAKE MODEL YEAR**

GENESIS G80 2018

Sunroof Light Bar May Short Circuit**NHTSA Campaign Number:** 18V467000**Manufacturer** Volkswagen Group of America, Inc.**Components** VISIBILITY**Potential Number of Units Affected** 45,457**Summary**

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Volkswagen Tiguan vehicles. The LED module for the Grupo Antolin Bamberg panoramic sunroof ambient light bar may short circuit.

Remedy

Volkswagen will notify owners, and dealers will disconnect the power supply for the panoramic sunroof LED module, free of charge, until a future service action can safely reactivate the feature. The recall began July 24, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall 60D1.

Vehicle**MAKE MODEL YEAR**

VOLKSWAGEN TIGUAN 2018

Rear Brake Pad Friction Material May Detach**NHTSA Campaign Number:** 18V480000**Manufacturer** Ducati North America**Components** SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 72

Summary

Ducati North America (Ducati) is recalling certain 2018 Ducati Panigale V4, Panigale 959, Panigale 1299 FE, and Hypermotard motorcycles. The Brembo friction material on the rear brake pads may detach from the backing plate.

Remedy

Ducati will notify owners, and dealers will inspect the rear brake pads. Brake pads from the affected batch will be replaced, free of charge. The recall is expected to begin September 15, 2018. Owners may contact Ducati customer service at 1-888-391-5446.

Vehicles

MAKE	MODEL	YEAR
DUCATI	HYPERMOTARD	2018
DUCATI	PANIGALE 1299 FE	2018
DUCATI	PANIGALE 959	2018
DUCATI	PANIGALE V4	2018

Incorrect TPMS Calibration/FMVSS 138

NHTSA Campaign Number: 18V509000

Manufacturer General Motors LLC

Components TIRES

Potential Number of Units Affected 94

Summary

General Motors LLC (GM) is recalling certain 2018 Chevrolet Express and GMC Savana vehicles with certain combinations of front-tire and gross-vehicle-weight option codes. The Tire Pressure Monitoring System (TPMS) may be incorrectly calibrated, causing the TPMS warning lamp to illuminate when tire pressure reaches 37 PSI, not 41 PSI. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems."

Remedy

GM will notify owners, and dealers will check the PSI information on the remote control door lock receiver (RCDLR) and tire placard match, and if the information is different the RCDLR will be reprogrammed. This repair will be done free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020, or GMC customer service at 1-800-462-8782. GM's number for this recall is 18255.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

CHEVROLET	EXPRESS	2018
-----------	---------	------

GMC	SAVANA	2018
-----	--------	------