



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

October 22, 2018

Rear Seatbelt Retractor May Not Lock/FMVSS 208

NHTSA Campaign Number: 18V673000

Manufacturer General Motors LLC

Components SEAT BELTS

Potential Number of Units Affected 15,800

Summary

General Motors LLC (GM) is recalling certain 2018-2019 Cadillac CT6, Escalade ESV, Chevrolet Suburban, Volt, and GMC Yukon XL vehicles. Certain second-row or third-row rear ZF seatbelts retractor assemblies may not automatically lock when the seatbelt is fully pulled out of the retractor, possibly preventing a child seat from being properly secured. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 208, "Occupant Crash Protection."

Remedy

GM will notify owners, and dealers will inspect the rear seatbelt retractors and replace them if necessary, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Cadillac customer service at 1-800-458-8006, Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 18315.

Vehicles

MAKE	MODEL	YEAR
CADILLAC	CT6	2018-2019
CADILLAC	ESCALADE ESV	2018-2019
CHEVROLET	SUBURBAN	2018-2019
CHEVROLET	VOLT	2018-2019
GMC	YUKON XL	2018-2019

SRS May Become Disabled Due to Manufacturing Error

NHTSA Campaign Number: 18V664000

Manufacturer Honda (American Honda Motor Co.)

Components AIR BAGS, SEAT BELTS

Potential Number of Units Affected 118

Summary

Honda (American Honda Motor Co.) is recalling certain 2019 Honda Insight, Odyssey, and Ridgeline vehicles. The Supplemental Restraint System (SRS) control unit may have a manufacturing error, possibly resulting in the air bags or seatbelt pretensioners not deploying in the event of a crash.

Remedy

Honda will notify owners, and dealers will replace the SRS unit, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are B2R, C2P, and Z2Q.

Vehicles

MAKE	MODEL	YEAR
HONDA	INSIGHT	2019
HONDA	ODYSSEY	2019
HONDA	RIDGELINE	2019

Magnet Becomes Dislodged Reducing Steering Ability

NHTSA Campaign Number: 18V663000

Manufacturer Honda (American Honda Motor Co.)

Components STEERING

Potential Number of Units Affected 54

Summary

Honda (American Honda Motor Co.) is recalling certain 2017-2018 Honda Civic and CR-V vehicles. The magnet that controls the torque sensor output signal for the Showa electronic power steering system may not be properly secured, allowing the magnet to become dislodged. During a full lock turn, the dislodged magnet may cause steering assist to be applied in the opposite direction.

Remedy

Honda will notify owners, and dealers will replace the steering gearbox assembly, free of charge. The recall is expected to begin November 5, 2018. Owners may contact Honda customer service at 1-888-234-2138. Honda's numbers for this recall are C2N, P2O.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

HONDA	CIVIC	2017-2018
-------	-------	-----------

HONDA	CR-V	2017-2018
-------	------	-----------

Incorrectly Positioned Headlight/FMVSS 108

NHTSA Campaign Number: 18V671000

Manufacturer Volkswagen Group of America, Inc.

Components EXTERIOR LIGHTING

Potential Number of Units Affected 28

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2019 Volkswagen Jetta vehicles equipped with LED headlights. The Valeo passenger side headlight may be incorrectly positioned, reducing the driver's visibility when it is dark. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Volkswagen will notify owners, and dealers will replace the passenger side headlight, free of charge. The recall is expected to begin November 25, 2018. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 94L1.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

VOLKSWAGEN	JETTA	2019
------------	-------	------

Climate Control Module Wiring Short Causing Fire

NHTSA Campaign Number: 18V655000

Manufacturer General Motors LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 30,289

Summary

General Motors LLC (GM) is recalling certain 2016-2018 Chevrolet Express and GMC Sierra vehicles equipped with a single, manual, rear climate control module (CCM). If the temperature is set to maximum heat or the mode knob is set to maximum floor vent and an electrical short occurs, components within the CCM may overheat.

Remedy

GM will notify owners, and dealers will remove the electrical insulation from a wiring connector within the CCM to remove the fire risk, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-800-462-8782. GM's number for this recall is 18299.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

CHEVROLET	EXPRESS	2016-2018
GMC	SAVANA	2016-2018

Incorrect ECU Programming Causing Stall

NHTSA Campaign Number: 18V674000

Manufacturer BMW of North America, LLC

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 3

Summary

BMW of North America, LLC (BMW) is recalling certain 2013-2015 BMW 760Li vehicles. The Engine Control Unit (ECU) may have been programmed with incompatible software during a service visit, possibly causing the engine to stall.

Remedy

All affected vehicles have been repaired by programming the ECU with the correct software. Therefore, owner letters will not be sent. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

BMW	760LI	2013-2015
-----	-------	-----------