



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

February 11, 2019

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V018000

Manufacturer Chrysler (FCA US LLC)

Components AIR BAGS

Potential Number of Units Affected 1,413,222

Summary

Chrysler (FCA US LLC) is recalling certain 2010 Dodge Ram 3500, Ram 4500/5500, 2010-2011 Dodge Dakota, 2010-2014 Dodge Challenger, 2010-2015 Dodge Challenger, Chrysler 300, and 2010-2016 Jeep Wrangler vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode.

Remedy

Chrysler will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall began February 4, 2019. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is V01.

Vehicles

MAKE	MODEL	YEAR
CHRYSLER	300	2010-2015
DODGE	CHALLENGER	2010-2014
DODGE	CHARGER	2010-2015
DODGE	DAKOTA	2010-2011
DODGE	RAM 3500	2010
JEEP	WRANGLER	2010-2016
RAM	4500	2010
RAM	5500	2010

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V017000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 83,016

Summary

BMW of North America, LLC (BMW) is recalling certain 2007-2013 X5 xDrive30i, X5 xDrive35i, X5 xDrive48i, X5 xDrive50i and X5 M vehicles, 2008-2014 X6 xDrive35i, X6 xDrive50i and X6 M vehicles, 2009-2013 X5 xDrive35d vehicles and 2010-2011 X6 ActiveHybrid vehicles. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

BMW will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. The recall is expected to begin March 4, 2019. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE	MODEL	YEAR
BMW	X5	2007-2013
BMW	X6	2008-2014

Driver's Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 19V016000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 12,880

Summary

BMW of North America, LLC (BMW) is recalling certain 2015 X1 sDrive28i, X1 xDrive28i, and X1 xDrive35i vehicles. These vehicles are equipped with air bag inflators assembled as part of the driver frontal air bag modules, used as original equipment or replacement equipment, that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling.

Remedy

BMW will notify owners, and dealers will replace the driver's frontal air bag module, free of charge. The recall is expected to begin March 4, 2019. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW X1 SAV 2015

Inflators in Sports Steering Wheels May Explode

NHTSA Campaign Number: 19V015000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 170,148

Summary

BMW of North America, LLC (BMW) is recalling certain model year 2000-2003 525i Sedan, 530i Sedan, 540i Sedan, 525i Sports Wagon and 540i Sports Wagon vehicles, and 2000-2004 X5 SAV 3.0i, X5 SAV 4.4i, and X5 SAV 4.6is vehicles. This recall affects certain vehicles where the original steering wheel has been replaced with the optional sports steering wheel. The sports steering wheel has a frontal air bag inflator that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling.

Remedy

BMW will notify owners, and dealers will inspect the vehicle for an optional sports steering wheel with an affected inflator. Dealers will replace the air bag module as necessary, free of charge. The recall is expected to begin March 4, 2019. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW 525I 2000-2003

BMW 530I 2000-2003

BMW 540I 2000-2003

BMW X5 SAV 2000-2004

Driver's Frontal Air Bag Inflator May Rupture

NHTSA Campaign Number: 19V014000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 119,394

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2015 Passat, 2015-2016 Eos, 2015-2017 CC, 2016-2017 TT Roadster, TT Coupe, 2017 Audi R8 Coupe, and R8 Spyder vehicles. Upon deployment of the driver's frontal air bag, excessive internal pressure may cause the inflator to explode.

Remedy

Volkswagen will notify owners, and dealers will replace the driver's frontal air bag inflator with an alternative inflator, free of charge. The recall is expected to begin in March 2019. Volkswagen owners may contact Volkswagen customer service at 1-800-893-5298; Audi owners may contact Audi at 1-800-253-2834. Volkswagen's number for this recall is 69S8 (Audi) and 69Y5 (Volkswagen).

Vehicles

MAKE	MODEL	YEAR
AUDI	R8	2017
AUDI	TT	2016-2017
VOLKSWAGEN	CC	2015-2017
VOLKSWAGEN	EOS	2015-2016
VOLKSWAGEN	PASSAT	2015

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V010000

Manufacturer Mercedes-Benz USA, LLC.

Components AIR BAGS

Potential Number of Units Affected 288,779

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2014 C250, C300 4Matic, C350, C63 AMG, E350 4Matic Coupe, E350 Cabrio, E350 Coupe, SLS AMG Cabrio, SLS AMG Coupe, 2014-2015 C250 Coupe, C350 4Matic Coupe, C350 Coupe, C63 AMG Coupe, GLK 350, GLK250 BlueTec 4Matic, GLK350 RWD, 2015-2017 E400 4Matic Coupe, E400 Cabrio, E400 Coupe, 2014-2017 E550 Cabrio, and 2014-2016 E550 Coupe vehicles sold, or ever registered, in the states of AL, CA, FL, GA, HI, LA, MS, SC, TX, PR, AS, GU, the MP, and VI or "Zone A."

Additionally, MBUSA is recalling certain 2012-2014 C250, E350 4Matic Coupe, SLS AMG Cabrio, 2012-2015 C250 Coupe, C350 4Matic Coupe, C350 Coupe, C63 AMG Coupe, 2011 C300, 2011-2014 C300 4Matic, C350, C63 AMG, E350 Cabrio, E350 Coupe, SLS AMG Coupe, 2015-2016 E400 4Matic Coupe, E400 Cabrio, E400 Coupe, 2011-2016 E550 Cabrio, E550 Coupe, 2011-2015 GLK350 4Matic, GLK350 RWD, and 2013-2015 GLK250 BlueTec 4Matic vehicles ever registered in the states of AZ, AR, DE, DC, IL, IN, KS, KY, MD, MO, NE, NV, NJ, NM, NC, OH, OK, PA, TN, VA, and WV or "Zone B."

MBUSA is also recalling certain 2012-2014 C250, E350 4Matic Coupe, SLS AMG Cabrio 2012-2015 C250 Coupe, C350 4Matic Coupe, C350 Coupe, C63 AMG Coupe, 2010-2011 C300, 2010-2014 C300 4Matic, C350, C63 AMG, E350 Coupe, 2011-2014 E350 Cabrio, SLS AMG Coupe, 2015-2016 E400 4Matic Coupe, E400 Cabrio, E400 Coupe, 2016-2017 E550 Cabrio, 2010-2016 E550 Coupe, 2010-2015 GLK350 4Matic, GLK350 RWD, and 2013-2015 GLK250 BlueTec 4Matic vehicles ever registered in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MO, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI and WY or "Zone C."

These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling.

Remedy

MBUSA will notify owners, and dealers will replace the passenger frontal air bag module, free of charge. An interim letter is being mailed from February 1, 2019 through March 8, 2019. A second letter will be sent when parts are available. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	C250	2012-2015
MERCEDES BENZ	C300	2010-2014
MERCEDES BENZ	C350	2010-2015
MERCEDES BENZ	C63 AMG	2010-2015
MERCEDES BENZ	E350	2010, 2013
MERCEDES BENZ	E400	2015-2017
MERCEDES BENZ	E550	2010-2017
MERCEDES BENZ	GLK250	2013-2015
MERCEDES BENZ	GLK350	2010-2015
MERCEDES BENZ	SLS	2011-2014
MERCEDES-BENZ	E350	2011-2012, 2014

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V009000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 452,630

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2010-2014 Tribeca, WRX, Legacy and Outback vehicles, 2010-2011 Impreza vehicles and 2010-2013 Forester vehicles sold, or ever registered, in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment

of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru is notifying owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall began on January 25, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is TKC-19.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

SUBARU	FORESTER	2010-2013
SUBARU	IMPREZA	2010-2011
SUBARU	LEGACY	2010-2014
SUBARU	OUTBACK	2010-2014
SUBARU	TRIBECA	2010-2014
SUBARU	WRX	2010-2014

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V008000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 330,120

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2010-2014 Tribeca, WRX, Outback, and Legacy vehicles, 2010-2011 Impreza vehicles and 2010-2013 Forester vehicles sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru is notifying owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall began January 25, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is TKB-19.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

SUBARU	FORESTER	2010-2013
SUBARU	IMPREZA	2010-2011
SUBARU	LEGACY	2010-2014
SUBARU	OUTBACK	2010-2014
SUBARU	TRIBECA	2010-2014
SUBARU	WRX	2010-2014

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V007000

Manufacturer Subaru of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 43,394

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2010-2013 Forester, 2010-2014 Tribeca, WRX, Outback, Legacy, and 2010-2011 Impreza vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Subaru has notified owners, and dealers will replace the front passenger air bag inflator, free of charge. The recall began January 25, 2019. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is TKA-19.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

SUBARU	FORESTER	2010-2013
SUBARU	IMPREZA	2010-2011
SUBARU	LEGACY	2010-2014
SUBARU	OUTBACK	2010-2014
SUBARU	TRIBECA	2010-2014
SUBARU	WRX	2010-2014

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V006000

Manufacturer Ferrari North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 11,176

Summary

Ferrari North America (Ferrari) is recalling certain 2014 Ferrari California, 2014-2015 Ferrari 458 Italia, 458 Spider, 2014-2016 Ferrari FF, 2014-2017 Ferrari F12, 2015-2018 Ferrari California T, 2015 Ferrari 458 Speciale A, 2016 Ferrari F60 America, 2016-2017 Ferrari F12 tdf, 2016-2018 Ferrari 488 GTB, 488 Spider, and 2017-2018 Ferrari GTC4Lusso vehicles nationwide.

These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Ferrari will notify owners, and dealers will replace the passenger frontal air bag assembly, free of charge. The recall is expected to begin March 9, 2019. Owners may contact Ferrari customer service at 1-866-551-2828. Ferrari's number for this recall is 65.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

FERRARI	458	2014-2015
FERRARI	458 ITALIA	2014-2015

MAKE	MODEL	YEAR
FERRARI	458 SPECIALE	2014-2015
FERRARI	458 SPIDER	2014-2015
FERRARI	488 GTB	2016-2018
FERRARI	488 SPIDER	2016-2018
FERRARI	CALIFORNIA	2014
FERRARI	CALIFORNIA T	2015-2018
FERRARI	F12 BERLINETTA	2014-2017
FERRARI	F12 TDF	2016-2017
FERRARI	F60 AMERICA	2016
FERRARI	FF	2014-2016
FERRARI	GTC4LUSSO	2017-2018
FERRARI	SPECIALE A	2015

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V005000

Manufacturer Toyota Motor Engineering & Manufacturing

Components AIR BAGS

Potential Number of Units Affected 1,299,448

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2014-2016 Toyota 4Runner, 2014-2015 Scion xB, Lexus IS350C, IS250C, 2014 Toyota Sienna, Lexus IS-F, and 2014-2017 Lexus GX460 vehicles sold, or ever registered in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Toyota is also recalling certain 2011-2013 Toyota Corolla, Corolla Matrix, Lexus IS250, IS350, 2011-2016 4Runner, 2011-2015 Scion xB, Lexus IS350C, IS250C, 2011-2014 Toyota Sienna, Lexus IS-F, 2011-2017 Lexus GX460, and 2011-2012 Lexus ES350 vehicles ever registered in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Toyota is also recalling certain 2010-2013 Toyota Corolla, Corolla Matrix, Lexus IS350, 2010-2016 4Runner, 2010-2013 Lexus IS250, 2010-2015 Scion xB, Lexus IS350C, IS250C, 2010-2017 Lexus GX460, 2010-2014 Lexus IS-F, and 2010-2012 Lexus ES350 vehicles ever registered in the states of Alaska, Colorado, Connecticut, Idaho, Iowa, Maine, Massachusetts, Michigan, Minnesota, Montana, New Hampshire, New York, North Dakota, Oregon, Rhode Island, South Dakota, Utah, Vermont, Washington, Wisconsin, and Wyoming or

"Zone C."

These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling.

Remedy

Toyota will notify owners. Depending on the vehicle model, dealers will replace the front passenger air bag inflator, or replace the air bag assembly. The recall is expected to begin February 11, 2019. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are "Zone A" Toyota: GOP, Lexus: GLG; "Zone B" Toyota: GOR, Lexus GLH; "Zone C" Toyota: HOA, and Lexus: HLA.

Vehicles

MAKE	MODEL	YEAR
LEXUS	ES350	2010-2012
LEXUS	GX460	2010-2017
LEXUS	IS 250	2010-2013
LEXUS	IS 250C	2010-2015
LEXUS	IS 350	2010-2013
LEXUS	IS 350C	2010-2015
LEXUS	IS F	2010-2014
SCION	XB	2010-2015
TOYOTA	4RUNNER	2010-2016
TOYOTA	COROLLA	2010-2013
TOYOTA	COROLLA MATRIX	2010-2013
TOYOTA	SIENNA	2011-2014

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V004000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 88,388

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2014-2017 Freightliner Sprinter 2500 and 3500 and Mercedes-Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the front passenger air bag module, free of charge. The recall is expected to begin March 29, 2019. Owners may contact DVUSA customer service at 1-877-762-8267.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 2500	2014-2017
FREIGHTLINER	SPRINTER 3500	2014-2017
MERCEDES BENZ	SPRINTER 2500	2014-2017
MERCEDES BENZ	SPRINTER 3500	2014-2017

Driver Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V003000

Manufacturer Daimler Vans USA, LLC

Components AIR BAGS

Potential Number of Units Affected 71,301

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2015-2017 Freightliner Sprinter 2500 and 3500 and Mercedes-Benz Sprinter 2500 and 3500 vehicles. These vehicles are equipped with certain air bag inflators assembled as part of the driver frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the driver frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

DVUSA will notify owners, and dealers will replace the front driver air bag module, free of charge. The recall is expected to begin March 29, 2019. Owners may contact DVUSA customer service at 1-877-762-8267.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 2500	2015-2017
FREIGHTLINER	SPRINTER 3500	2015-2017
MERCEDES BENZ	SPRINTER 2500	2015-2017
MERCEDES BENZ	SPRINTER 3500	2015-2017

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V002000

Manufacturer Tesla, Inc.

Components AIR BAGS

Potential Number of Units Affected 68,673

Summary

Tesla, Inc. (Tesla) is recalling all 2014-2016 Model S vehicles equipped with certain air bag inflators assembled as part of the passenger frontal air bag modules used as original equipment or replacement equipment. In the event of a crash necessitating deployment of the passenger frontal air bag, these inflators may explode due to propellant degradation occurring after long-term exposure to absolute humidity and temperature cycling.

Remedy

Tesla will notify owners, and Tesla Service Centers will replace the passenger frontal air bag modules, free of charge. The recall is expected to begin in March 2019. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-19-20-001.

Vehicle

MAKE	MODEL	YEAR
TESLA	MODEL S	2014-2016

Passenger Frontal Air Bag Inflator May Explode

NHTSA Campaign Number: 19V001000

Manufacturer Ford Motor Company

Components AIR BAGS

Potential Number of Units Affected 782,384

Summary

Ford Motor Company (Ford) is recalling certain 2014 Ford Mustang vehicles sold, or ever registered, in the states of Alabama, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, South Carolina, Texas, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands or "Zone A."

Additionally, Ford is recalling certain 2011 Ford Ranger and Mercury Milan vehicles, 2011-2012 Ford Fusion and Lincoln Zephyr/MKZ vehicles and 2011-2014 Ford Mustang vehicles sold, or ever registered, in the states of Arizona, Arkansas, Delaware, District of Columbia, Illinois, Indiana, Kansas, Kentucky, Maryland, Missouri, Nebraska, Nevada, New Jersey, New Mexico, North Carolina, Ohio, Oklahoma, Pennsylvania, Tennessee, Virginia, and West Virginia or "Zone B."

Ford is also recalling certain 2010 Ford Edge and Lincoln MKX vehicles, 2010-2011 Ford Ranger and Mercury Milan vehicles, 2010-2012 Ford Fusion and Lincoln Zephyr/MKZ vehicles, and 2010-2014 Ford Mustang vehicles sold, or ever registered, in the states of AK, CO, CT, ID, IA, ME, MA, MI, MN, MT, NH, NY, ND, OR, RI, SD, UT, VT, WA, WI, and WY or "Zone C."

These vehicles are equipped with air bag inflators assembled as part of the passenger frontal air bag modules, used as original equipment or replacement equipment (such as after a vehicle crash necessitating replacement of the original air bags), that may explode due to propellant degradation occurring after long-term exposure to high absolute humidity, temperature and temperature cycling.

Remedy

Ford will notify owners, and dealers will replace the passenger frontal air bag inflator, free of charge. The recall is expected to begin February 18, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall 19S01.

Vehicles

MAKE	MODEL	YEAR
FORD	EDGE	2010
FORD	FUSION	2010-2012
FORD	MUSTANG	2010-2014
FORD	RANGER	2010-2011
LINCOLN	MKX	2010
LINCOLN	MKZ	2010-2012
LINCOLN	ZEPHYR	2010-2012
MERCURY	MILAN	2010-2011

Missing Rivet on Seat Belt Buckle Assembly

NHTSA Campaign Number: 18V899000

Manufacturer General Motors LLC

Components SEAT BELTS

Potential Number of Units Affected 175

Summary

General Motors LLC (GM) is recalling certain 2019 Cadillac XTS vehicles. The front seat belt buckles may be missing a rivet that secures the buckle head to the cable mounting strap.

Remedy

GM will notify owners, and dealers will inspect the front seat buckle assemblies, replacing them if the rivets are missing, free of charge. The recall is expected to begin on February 8, 2019. Owners may contact Cadillac customer service at 1-800-458-8006. GM's number for this recall is N18-2204040.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

CADILLAC	XTS	2019
----------	-----	------

Intermittent Loss of Power Steering Assist

NHTSA Campaign Number: 18V898000

Manufacturer Porsche Cars North America, Inc.

Components STEERING

Potential Number of Units Affected 17,667

Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017-2018 Porsche Panamera, Panamera 4, Panamera 4S, Panamera Turbo, Panamera 4S Executive, Panamera Turbo Executive, 2018 Panamera 4 Executive, Panamera 4 E-Hybrid, Panamera Turbo S E-Hybrid, Panamera 4 E-Hybrid Executive, Panamera S E-Hybrid Executive, Panamera 4 Sport Turismo, Panamera 4S Sport Turismo, Panamera 4 E-Hybrid Sport Turismo, Panamera Turbo Sport Turismo, and Panamera Turbo S Sport Turismo vehicles. A Bosch software failure may result in an intermittent loss of electric power steering assist.

Remedy

Porsche will notify owners, and dealers will reprogram the power steering control unit, free of charge. The recall is expected to begin February 17, 2019. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AJ13.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

PORSCHE	PANAMERA	2017-2018
---------	----------	-----------

Seat Belt may not Adequately Restrain Occupant

NHTSA Campaign Number: 18V870000

Manufacturer PACCAR Incorporated

Components SEAT BELTS

Potential Number of Units Affected 6,857

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2018 Kenworth T680 and T880, and Peterbilt 567 and 579 trucks. The seat belt buckle assemblies on these vehicles may have been glued and not sewn during manufacturing, possibly causing the assembly to come apart under load, such as in the event of a crash.

Remedy

PACCAR will notify owners, and dealers will replace the seat belt buckle assemblies that were not sewn, free of charge. The recall is expected to begin February 3, 2019. Owners may contact PACCAR customer service at 1-918-259-3258. PACCAR's numbers for this recall is 18KWG, and 18PBD.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

KENWORTH	T680	2018
----------	------	------

KENWORTH	T880	2018
----------	------	------

PETERBILT	567	2018
-----------	-----	------

PETERBILT	579	2018
-----------	-----	------