



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

June 17, 2019

[Seat Belt May Not Lock/FMVSS 209](#)

NHTSA Campaign Number: 19V350000

Manufacturer Jaguar Land Rover North America, LLC

Components SEAT BELTS

Potential Number of Units Affected 16,186

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016-2017 Range Rover and Range Rover Sport vehicles. The driver's seat belt Emergency Locking Retractor (ELR) may not lock as designed. As such, these vehicles fail to comply with the requirements of the Federal Motor Vehicle Safety Standard (FMVSS) number 209, "Seat Belt Assemblies."

Remedy

Land Rover will notify owners, and dealers will replace the driver's seat belt assembly, free of charge. Interim notices informing owners of the safety risk will be mailed July 1, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N333.

Vehicles

MAKE	MODEL	YEAR
LAND ROVER	RANGE ROVER	2016-2017
LAND ROVER	RANGE ROVER SPORT	2016-2017

Knee Air Bags May Not Deploy Properly

NHTSA Campaign Number: 19V352000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 5,079

Summary

BMW of North America, LLC (BMW) is recalling certain 2019-2020 230i, 230i xDrive, M240i, M240i xDrive, M2 Competition Coupe, 430i, 430i xDrive, 440i, 440i xDrive, M4, and 2019 330i xDrive Sportswagon vehicles. The driver and passenger knee air bag assemblies may have been improperly folded and assembled.

Remedy

BMW will notify owners, and dealers will replace the knee air bag modules, free of charge. The recall is expected to begin July 2, 2019. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW	230I	2019-2020
BMW	330I	2019
BMW	430I	2019-2020
BMW	440I	2019-2020
BMW	M2	2019-2020
BMW	M240I	2019-2020
BMW	M4	2019-2020

Improperly Installed Head Air Bags

NHTSA Campaign Number: 19V386000

Manufacturer BMW of North America, LLC

Components AIR BAGS

Potential Number of Units Affected 1,822

Summary

BMW of North America, LLC (BMW) is recalling certain 2019 X7 xDrive40i and X7 xDrive50i vehicles. The driver and passenger head air bags may not have been properly aligned with the trim during installation.

Remedy

BMW will notify owners, and dealers will inspect and, as necessary, reinstall the head air bags, free of charge. The recall is expected to begin July 15, 2019. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW X7 2019

Unexpected Transmission Downshift

NHTSA Campaign Number: 19V433000

Manufacturer Ford Motor Company

Components POWER TRAIN

Potential Number of Units Affected 107,857

Summary

Ford Motor Company (Ford) is recalling certain 2013 F-150 vehicles equipped with 5.0L or 6.2L gasoline engines, that previously had the powertrain control module (PCM) software reprogrammed under recall 19V-075. The software used to reprogram the PCM did not have the necessary updates to prevent the transmission from unexpectedly downshifting into first gear, regardless of vehicle speed.

Remedy

Ford will notify owners, and dealers will reprogram the powertrain control module, free of charge. The recall is expected to begin June 24, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S19.

Vehicle

MAKE MODEL YEAR

FORD F-150 2013

High-Voltage Battery May Short-Circuit

NHTSA Campaign Number: 19V434000

Manufacturer Volkswagen Group of America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 1,646

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 2019 Audi e-tron vehicles. Moisture can enter the high-voltage battery system through a faulty seal on the charging socket.

Remedy

Audi will notify owners, and dealers will install a new seal and, as necessary, replace the affected system components, free of charge. Notices informing owners of the safety risk are expected to be mailed in June 2019. Remedy parts are expected to become available in August 2019. Owners may contact Audi's customer service at 1-800-253-2834. Audi's number for this recall is 93E8.

Vehicle

MAKE MODEL YEAR

AUDI E-TRON 2019

Rear Suspension Toe Links May Fracture

NHTSA Campaign Number: 19V435000

Manufacturer Ford Motor Company

Components SUSPENSION

Potential Number of Units Affected 1,194,173

Summary

Ford Motor Company (Ford) is recalling certain 2011-2017 Explorer vehicles. The rear suspension toe links may fracture due to stress on the rear suspension.

Remedy

Ford will notify owners, and dealers will replace the rear suspension toe links, free of charge. The recall is expected to begin June 24, 2019. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S17.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

FORD	EXPLORER	2011-2017
------	----------	-----------