

NHTSA Recalls of Interest June 3, 2019

Air Bags May Not Deploy In A Crash

NHTSA Campaign Number: 19V330000

Manufacturer Mitsubishi Motors North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 26,016

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2017-2018 Mirage G4 vehicles. The internal acceleration sensor in the Supplemental Restraint System (SRS) Electronic Control Unit (ECU) can misinterpret vibrations, such as from poor road conditions or a flat tire, as a malfunction and disable all the vehicle's air bags.

Remedy

MMNA notified owners, and dealers will reprogram the SRS-ECU software, free of charge. The recall began May 24, 2019. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-19-001.

Vehicle

MAKE MODEL YEAR

MITSUBISHI MIRAGE G4 2017-2018

High Beams May Not Deactivate by Switch

NHTSA Campaign Number: 19V309000

Manufacturer Daimler Vans USA, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 1,517

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz Sprinter (Platform 907) vehicles equipped with high-beam assist. A software error in the control unit may prevent the driver from being able to switch off the high beams when intended.

Remedy

DVUSA will notify owners, and Mercedes-Benz or Freightliner Sprinter dealers will update the control unit software, free of charge. The recall is expected to begin June 7, 2019. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3FERNLI.

Vehicles

MAKE MODEL YEAR

FREIGHTLINER SPRINTER 2500 2019 FREIGHTLINER SPRINTER 3500 2019 MERCEDES BENZ SPRINTER 2500 2019 MERCEDES BENZ SPRINTER 3500 2019

Fuel Tank May Leak/FMVSS 301

NHTSA Campaign Number: 19V316000

Manufacturer Nissan North America, Inc.

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 374

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2019 Altima vehicles equipped with front wheel drive (FWD) and 2.5 liter engines. The fuel pump lock ring may not be fully engaged, possibly causing fuel to leak. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 301, "Fuel System Integrity."

Remedy

Nissan will notify owners, and dealers will inspect the fuel tank assembly. If the lock ring is disengaged, dealers will tighten the ring to specification. If the lock ring is detached, dealers will replace the fuel pump. Both remedies will be completed free of charge. The recall is expected to begin June 2019. Owners may contact Nissan customer service at 1-800-867-7669.

Vehicle

MAKE MODEL YEAR

NISSAN ALTIMA 2019