



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

September 30, 2019

Incorrectly Mounted Spring Pins in Head Restraint

NHTSA Campaign Number: 19V666000

Manufacturer Daimler Vans USA, LLC

Components SEATS

Potential Number of Units Affected 594

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Metris vehicles. The head restraint of the seat or seat back may have been fitted without a spring pin or a spring pin that was improperly mounted.

Remedy

DVUSA will notify owners, and Mercedes-Benz dealers will replace the head restraints, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact DVUSA customer service at 1-877-762-8267. D VUSA's number for this recall is VS2KOPFSTU.

Vehicle

MAKE

MODEL YEAR

MERCEDES BENZ METRIS 2019

No Back-Up Camera Display Image/FMVSS 111

NHTSA Campaign Number: 19V654000

Manufacturer Nissan North America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 1,228,830

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2018-2019 Nissan Altima, Armada, Frontier, Kicks, Leaf, Maxima, Murano, NV, NV200, Pathfinder, Rogue, Rogue Sport, Sentra, Titan, Titan Diesel, Versa Note and Versa Sedan vehicles, as well as Infiniti Q50, Q60, QX30 and QX80 vehicles. Additionally included are 2019 Nissan GT-R and Taxi and Infiniti QX50, QX60, Q70, Q70L vehicles. The back-up camera and display settings can be adjusted such that the rear view image is no longer visible and the system will retain that setting the next time the vehicle is placed in reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rear Visibility."

Remedy

Nissan will notify owners in phases, having dealers update the back-up camera settings software, free of charge. The recall is expected to begin October 21, 2019 and all affected VINs should be activated by November 11, 2019. Owners may contact Nissan customer service at 1-800-867-7669 or INFINITI customer service at 1-800-662-6200.

Vehicles

MAKE	MODEL	YEAR
INFINITI	Q50	2018-2019
INFINITI	Q60	2018-2019
INFINITI	Q70	2019
INFINITI	Q70L	2019
INFINITI	QX30	2018-2019
INFINITI	QX50	2019
INFINITI	QX60	2019
INFINITI	QX80	2018-2019
NISSAN	ALTIMA	2018-2019
NISSAN	ARMADA	2018-2019
NISSAN	FRONTIER	2018-2019
NISSAN	GT-R	2019
NISSAN	KICKS	2018-2019
NISSAN	LEAF	2018-2019
NISSAN	MAXIMA	2018-2019

MAKE	MODEL	YEAR
NISSAN	MURANO	2018-2019
NISSAN	NV	2018-2019
NISSAN	NV200	2018-2019
NISSAN	NV200 TAXI	2019
NISSAN	PATHFINDER	2018-2019
NISSAN	ROGUE	2018-2019
NISSAN	ROGUE SPORT	2018-2019
NISSAN	SENTRA	2018-2019
NISSAN	TITAN	2018-2019
NISSAN	VERSA	2018-2019
NISSAN	VERSA NOTE	2018-2019

Loss of Electrical Power at Relay

NHTSA Campaign Number: 19V647000

Manufacturer Isuzu Technical Center of America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 16,766

Summary

Isuzu Technical Center of America, Inc. (Isuzu) is recalling certain 2017-2019 N-GAS HD and Chevrolet Low Cab Forward 3500 and 4500 vehicles and 2018-2019 Isuzu FTR and Chevrolet Low Cab Forward 6500XD vehicles. The power supply bolt in the relay box may not have been properly tightened during harness production at the supplier. This may lead to melting of the power wire and/or a loss of electrical power to the vehicle, which can lead to a stall.

Remedy

Isuzu will notify owners, and dealers will inspect the relay box power supply bolt, tightening it as necessary. If the harness or relay box is found to be damaged, it will be replaced or repaired, free of charge. The recall is expected to begin October 25, 2019. Owners may contact Isuzu customer service at 1-866-441-9638. Isuzu's number for this recall is V1905.

Vehicles

MAKE	MODEL	YEAR
CHEVROLET	LOW CAB FORWARD 3500	2017-2019

MAKE	MODEL	YEAR
CHEVROLET	LOW CAB FORWARD 4500	2017-2019
CHEVROLET	LOW CAB FORWARD 6500	2018-2019
ISUZU	FTR	2018-2019
ISUZU	N-SERIES	2017-2019

Improperly Welded Seat Belt Guide Loop Mount

NHTSA Campaign Number: 19V653000

Manufacturer BMW of North America, LLC

Components SEAT BELTS

Potential Number of Units Affected 7

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 Toyota Supra vehicles. The driver's seat belt guide loop mount may have been improperly welded.

Remedy

Owners have been notified, and Toyota dealers will inspect the seat belt guide loop mount. If the mount is defective, the vehicle will be replaced, free of charge. The recall began September 13, 2019. Owners may contact the Toyota Customer Experience

Center at 1-888-270-9371. Toyota's number for this recall is K0R.

Vehicle

MAKE	MODEL	YEAR
TOYOTA	SUPRA	2020