



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

November 18, 2019

Brake Fluid Can Leak Into ABS Pump and Ignite

NHTSA Campaign Number: 19V807000

Manufacturer Nissan North America, Inc.

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 394,025

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2015-2018 Nissan Murano, 2016-2018 Nissan Maxima, and 2017-2019 Nissan Pathfinder and Infiniti QX60 vehicles. These vehicles were previously recalled and unrepaired, or inspected and determined to not need a repair, under recall number 18V-601. In addition, this recall expands the previous population. The Anti-lock Brake System (ABS) actuator pumps may allow brake fluid to leak onto an internal circuit board.

Remedy

Nissan will notify owners, and dealers will replace the ABS actuator, free of charge. Interim notices informing owners of the safety risk are expected to be mailed beginning December 2, 2019. Owners will receive a second notice when remedy parts become available, currently expected to be during summer 2020. Owners may contact Nissan customer service at 1-800-867-7669. Note: If the ABS warning light remains illuminated for more than 10 seconds after engine start up, owners are advised to park the vehicle outdoors away from other vehicles or structures and to not drive the vehicle.

Vehicles

MAKE	MODEL	YEAR
INFINITI	QX60	2017-2019
NISSAN	MAXIMA	2016-2018
NISSAN	MURANO	2015-2018
NISSAN	PATHFINDER	2017-2019

Seat Strikers May Fail In Crash

If the seat strikers fail, the seat or seat belt may not adequately restrain the occupant, increasing the risk of injury.

NHTSA Campaign Number: 19V759000

Manufacturer Chrysler (FCA US LLC)

Components SEATS

Potential Number of Units Affected 30,354

Summary

Chrysler (FCA US LLC) is recalling certain 2019 Dodge Grand Caravan vehicles. The welds on the outboard rear seat strikers for the second row bench and second row bucket seats may fail during a front impact crash. The front outboard seat strikers for the third row bench seats may fail in the event of a rear impact crash. In addition, the second row bench and second row bucket seats may not withstand the required loads.

Remedy

Chrysler will notify owners, and dealers will weld in a striker reinforcement bracket on the second and third row outboard seat strikers, free of charge. The recall is expected to begin December 13, 2019. Owners may contact FCA US customer service at 1-800-853-1403. FCA's number for this recall is V91.

Vehicle

MAKE	MODEL	YEAR
DODGE	GRAND CARAVAN	2019

Insufficient Welds On Front Seat Structure

[Seats with improper welds may not provide adequate protection in the event of a crash, increasing the risk of an injury.](#)

NHTSA Campaign Number: 19V762000

Manufacturer General Motors LLC

Components SEATS

Potential Number of Units Affected 341

Summary

General Motors LLC (GM) is recalling certain 2019-2020 Buick Regal vehicles. The driver or passenger front seat frames may have a lower crossbar that was improperly welded.

Remedy

GM will notify owners, and dealers will inspect the crossbar welds on the front seats. If the crossbar is improperly welded, the seat back frame will be replaced, free of charge. Interim notices informing owners of the safety risk are scheduled to be mailed starting November 26, 2019. Owners will receive a second notice when the remedy becomes available. Owners may contact Buick customer service at 1-800-521-7300. GM's number for this recall is N192278300.

Vehicle

MAKE MODEL YEAR

BUICK REGAL 2019-2020

Improperly Installed Steering Shaft Assembly

NHTSA Campaign Number: 19V769000

Manufacturer Daimler Trucks North America LLC

Components STEERING

Potential Number of Units Affected 1,331

Summary

Daimler Trucks North America LLC (DTNA) is recalling certain 2020 Western Star 4700 vehicles. The steering shaft may have been improperly installed, potentially causing a loss of connection between the steering wheel and front axle wheels.

Remedy

DTNA will notify owners and dealers will inspect the vehicles, correcting the steering shaft installation, as necessary, free of charge. The recall is expected to begin December 23, 2019. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-835.

Vehicle

MAKE	MODEL	YEAR
WESTERN STAR	4700	2020