



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

November 4, 2019

Seat Belts May Not Restrain Occupants

NHTSA Campaign Number: 19V724000

Manufacturer Volvo Bus Corporation

Components SEAT BELTS

Potential Number of Units Affected 34

Summary

Volvo Bus Corporation (Volvo Bus) is recalling certain 2018-2020 Volvo 9700 vehicles. The passenger seat belt attachments may not be sufficient to anchor the seat belts and restrain the seat occupants in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages."

Remedy

Volvo Bus will notify owners, and dealers will add reinforcement to the passenger seats, free of charge. The recall is expected to begin November 25, 2019. Owners may contact Volvo Bus customer service at 1-866-870-2046.

Vehicle

MAKE MODEL YEAR

VOLVO BUS 9700 2018-2020

Software Error May Cause Unintended Braking

NHTSA Campaign Number: 19V761000

Manufacturer General Motors LLC

Components ELECTRONIC STABILITY CONTROL, SERVICE BRAKES, HYDRAULIC, SERVICE BRAKES

Potential Number of Units Affected 638,068

Summary

General Motors LLC (GM) is recalling certain 2015-2020 Chevrolet Suburban, Tahoe, and GMC Yukon, and 2014-2018 Chevrolet Silverado 1500 and GMC Sierra 1500 vehicles equipped with a 5.3-liter engine, a 3.08-ratio rear axle and four-wheel drive. If a wheel-speed sensor fails, while the vehicle is traveling between 41 and 60 mph in four-wheel or automatic mode, the Electronic-Brake Control Module (EBCM) software may activate the driveline-protection system.

Remedy

GM will notify owners, and dealers will reprogram the EBCM, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Chevrolet customer service at 1-800-630-2438 or GMC customer service at 1-800-462-8782. GM's number for this recall is N192261050.

Vehicles

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 1500	2014-2018
CHEVROLET	SUBURBAN	2015-2020
CHEVROLET	TAHOE	2015-2020
GMC	SIERRA 1500	2014-2018
GMC	YUKON	2015-2020

Incorrect TPMS Sensors Installed/FMVSS 138

NHTSA Campaign Number: 19V731000

Manufacturer General Motors LLC

Components TIRES

Potential Number of Units Affected 81

Summary

General Motors LLC (GM) is recalling certain 2020 Cadillac CT6 vehicles equipped with dealer-installed accessory 20" x 8.50" wheels (RPO 5JO or SHH). The tire pressure monitoring system (TPMS) sensors use the incorrect wireless radio frequency and cannot illuminate the low pressure warning light when the tire pressure drops below the recommended level. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 138, "Tire Pressure Monitoring Systems."

Remedy

GM will notify owners, and dealers will replace all four TPMS sensors with the correct sensors, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact GM customer service at 1-586-596-1733. GM's number for this recall is N192279200.

Vehicle

MAKE MODEL YEAR

CADILLAC CT6 2020

No Visual Warning of Brake Pad Wear/FMVSS 135

NHTSA Campaign Number: 19V735000

Manufacturer Porsche Cars North America, Inc.

Components ELECTRICAL SYSTEM, SERVICE BRAKES

Potential Number of Units Affected 44,128

Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017 Panamera 4, Panamera Turbo, Panamera Turbo Executive, 2017-2018 Panamera, Panamera 4S Executive, Panamera 4S, 2018 Panamera Turbo S Hybrid, Panamera 4 Hybrid Sport Turismo, Panamera 4 Sport Turismo, Panamera Turbo S Hybrid Sport Turismo, Panamera 4 Hybrid, Panamera 4 Executive, 2019 Cayenne Hybrid, 2019-2020 Cayenne, Cayenne S, Cayenne Turbo, 2020 Cayenne Coupe, Cayenne Turbo Coupe, and Cayenne S Coupe vehicles. The instrument cluster may not provide a visual warning when the brake pads are worn out. As a result, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) number 135, "Light vehicle brake systems."

Remedy

Porsche will notify owners, and dealers will reprogram the instrument cluster, free of charge. The recall is expected to begin December 15, 2019. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AKB8. Note: This recall supersedes recall 19V115 and includes vehicles that were previously remedied under that campaign.

Vehicles

MAKE	MODEL	YEAR
PORSCHE	CAYENNE	2019-2020
PORSCHE	PANAMERA	2017-2018

Steering Rack May Fail

NHTSA Campaign Number: 19V738000

Manufacturer BMW of North America, LLC

Components STEERING

Potential Number of Units Affected 20

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 BMW X3 M40i and X4 M40i vehicles. The steering rack pinion teeth may break under load, resulting in a loss of steering control.

Remedy

BMW has notified owners, and dealers will replace the steering gear, free of charge. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

BMW	X3	2020
BMW	X4	2020