



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest December 16, 2019

Doors may Unexpectedly Open

NHTSA Campaign Number: 19V849000

Manufacturer Volvo Car USA LLC

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 144,937

Summary

Volvo Car of USA LLC (Volvo) is recalling certain 2011-2017 S60, S60I, V60, S60CC and V60CC vehicles. A component within the door latches may break, making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not.

Remedy

Volvo will notify owners, and dealers will replace all four door latches, free of charge. The recall is expected to begin January 4, 2020. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R89978.

MAKE MODEL YEAR

VOLVO S60 2011-2017

MAKE MODEL YEAR

VOLVO S60CC 2011-2017
VOLVO S60I 2011-2017
VOLVO V60 2011-2017
VOLVO V60CC 2011-2017

Tailgate May Open Unexpectedly

NHTSA Campaign Number: 19V864000

Manufacturer Ford Motor Company

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 231,664

Summary

Ford Motor Company (Ford) is recalling certain 2017-2019 Super Duty F-250, F-350, and F-450 trucks equipped with an electric tailgate latch release switch mounted in the tailgate handle. Water may enter the electrical wiring system and cause a short circuit, activating the switch and releasing the tailgate latches.

Remedy

Ford will notify owners, and dealers will modify the tailgate/frame wiring harnesses by adding jumper pigtails to isolate the tailgate release control circuits and will install a new tailgate handle release switch, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 19S48.

Vehicles**MAKE MODEL YEAR**

FORD F-250 SD 2017-2019
FORD F-350 SD 2017-2019
FORD F-450 SD 2017-2019

Headliner Adhesive Bond Can Fail

NHTSA Campaign Number: 19V840000

Manufacturer Jaguar Land Rover North America, LLC

Components STRUCTURE

Potential Number of Units Affected 3,444

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles. The adhesive bond attaching a metal plate to the headliner can fail after exposure to very cold temperatures.

Remedy

Land Rover will notify owners, and dealers will apply self-adhesive fleece tape to the metal plate and the driver and passenger sides of the headliner, free of charge. The recall is expected to begin January 17, 2020. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N412.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

LAND ROVER	RANGE ROVER EVOQUE	2020
------------	--------------------	------

Unintended Vehicle Movement

NHTSA Campaign Number: 19V841000

Manufacturer Navistar, Inc.

Components ENGINE

Potential Number of Units Affected 12,539

Summary

Navistar, Inc. (Navistar) is recalling certain 2019-2020 International MV and HV, 2018-2020 Workstar, and 2018-2019 Durastar vehicles equipped with feature codes 12VXT and 12VXU. With the parking brake applied and the automatic transmission in the 'Drive' or 'Reverse' position, when the stationary PTO switch is engaged by the operator, the engine RPM will ramp up and may overcome the parking brake's ability to hold the vehicle.

Remedy

Navistar will notify owners, and dealers will update the Engine Control Module to enable the PTO neutral interlock, free of charge. The recall is expected to begin January 20, 2020. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 19518.

Vehicles

MAKE	MODEL	YEAR
INTERNATIONAL DURASTAR		2018-2019
INTERNATIONAL HV		2019-2020
INTERNATIONAL MV		2019-2020
INTERNATIONAL WORKSTAR		2018-2020

Loss of Headlight Function

NHTSA Campaign Number: 19V850000

Manufacturer BMW of North America, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 245

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 Z4 M40i, Z4 sDrive30i, 330i and 330i xDrive vehicles as well as 2020 Toyota Supra vehicles. The headlight control units may fail causing a loss of one or both of the headlights.

Remedy

BMW will notify owners, and dealers will replace the headlight control units, free of charge. The recall is expected to begin January 17, 2020. Owners may contact BMW customer service at 1-800-525-7417 or Toyota customer service at 1-888-270-9371.

Vehicles

MAKE	MODEL	YEAR
BMW	330I	2020
BMW	Z4	2020
TOYOTA SUPRA		2020