



# Automotive Safety Council

Prevent Protect Notify

## NHTSA Recalls of Interest

March 30, 2020

### ECU Error May Cause Vehicle Stall

**NHTSA Campaign Number:** 20V162000

**Manufacturer** Toyota Motor Engineering & Manufacturing

**Components** FUEL SYSTEM, GASOLINE, ENGINE

**Potential Number of Units Affected** 38,810

#### **Summary**

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2020 Highlander vehicles equipped with a 3.5 L, V6 (2GR-FKS) gasoline engine. Due to an Engine Control Unit (ECU) programming error, fuel may not be correctly supplied to the engine while using the stop and restart feature.

#### **Remedy**

Toyota will notify owners, and dealers will reprogram the ECU, free of charge. The recall is expected to begin April 24, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is 20TA06.

#### **Vehicle**

| MAKE | MODEL | YEAR |
|------|-------|------|
|------|-------|------|

|        |            |      |
|--------|------------|------|
| TOYOTA | HIGHLANDER | 2020 |
|--------|------------|------|

## Seat Belt Sensors May Not Detect Belted Condition

**NHTSA Campaign Number:** 20V164000

**Manufacturer** BMW of North America, LLC

**Components** AIR BAGS, SEAT BELTS

**Potential Number of Units Affected** 3,316

### **Summary**

BMW of North America, LLC (BMW) is recalling certain 2020 X3 xDrive30e, X4 xDrive30i, X4 M40i, X4M, 330i, 330i xDrive, M340i, 840i Gran Coupe, 840i xDrive Gran Coupe, M850i xDrive Gran Coupe, M8 Gran Coupe, X3 sDrive30i, X3 xDrive30i, X3 M40i, X3M, and 840i xDrive Convertible vehicles. The sensors in the front seat belt buckles may inaccurately detect a belted occupant as unbelted, possibly causing the air bag and seat belt pretensioners to deploy improperly in the event of a crash.

### **Remedy**

BMW will notify owners, and dealers will inspect and replace the front seat belt buckles, as necessary, free of charge. The recall is expected to begin May 11, 2020. Owners may contact BMW customer service at 1-800-525-7417.

### **Vehicles**

| <b>MAKE</b> | <b>MODEL</b>  | <b>YEAR</b> |
|-------------|---------------|-------------|
| BMW         | 330I          | 2020        |
| BMW         | 840I          | 2020        |
| BMW         | M340I         | 2020        |
| BMW         | M8 GRAN COUPE | 2020        |
| BMW         | M850I         | 2020        |
| BMW         | X3            | 2020        |
| BMW         | X4            | 2020        |

## Seat Belt May Not Secure Occupant/FMVSS 210

**NHTSA Campaign Number:** 20V154000

**Manufacturer** Bentley Motors, Inc.

**Components** SEAT BELTS

## Potential Number of Units Affected 281

### Summary

Bentley Motors, Inc. (Bentley) is recalling certain 2018-2020 Bentayga vehicles equipped with third-row seats. The third-row upper seat belt attachment may not stay connected to the vehicle in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 210, "Seat Belt Assembly Anchorages."

### Remedy

Bentley will notify owners, and dealers will replace the upper seat belt attachment bolt, free of charge. The recall is expected to begin April 27, 2020. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE20/06.

### Vehicle

| MAKE | MODEL | YEAR |
|------|-------|------|
|------|-------|------|

|         |          |           |
|---------|----------|-----------|
| BENTLEY | BENTAYGA | 2018-2020 |
|---------|----------|-----------|

## Doors May Open While Driving

**NHTSA Campaign Number:** 20V177000

**Manufacturer** Ford Motor Company

**Components** LATCHES/LOCKS/LINKAGES

**Potential Number of Units Affected** 248,912

### Summary

Ford Motor Company (Ford) is recalling certain 2014-2015 Fiesta, 2014-2016 Fusion and Lincoln MKZ vehicles sold, or ever registered in Alabama, Arkansas, Arizona, California, Florida, Georgia, Hawaii, Louisiana, Mississippi, New Mexico, Nevada, Oklahoma, Oregon, South Carolina, Texas, Utah, Washington, Puerto Rico, American Samoa, Guam, the Northern Mariana Islands (Saipan), and the U.S. Virgin Islands. A component within the door latches may break making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not.

### Remedy

Ford will notify owners, and Ford or Lincoln dealers will replace the side door latches, free of charge. The recall is expected to begin May 4, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S15.

## Vehicles

### MAKE MODEL YEAR

FORD FIESTA 2014-2015  
FORD FUSION 2014-2016  
LINCOLN MKZ 2014-2016

## Doors May Not Open From The Inside

**NHTSA Campaign Number:** 20V151000

**Manufacturer** Lamborghini (Automobili Lamborghini)

**Components** STRUCTURE

**Potential Number of Units Affected** 26

### Summary

Lamborghini (Automobili Lamborghini) is recalling certain 2020 Aventador SVJ Coupe and Aventador SVJ Roadster vehicles. The interior door handle mechanism may fail, resulting in the vehicle's door being unable to be opened by using the inside door handle.

### Remedy

Lamborghini will notify owners, and dealers will replace the interior door handle, free of charge. The recall is expected to begin May 1, 2020. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L73X-R.02.20.

## Vehicles

### MAKE MODEL YEAR

LAMBORGHINI AVENTADOR SVJ COUPE 2020  
LAMBORGHINI AVENTADOR SVJ ROADSTER 2020

## Brake Lights may not Work or may Stay on

**NHTSA Campaign Number:** 20V160000

**Manufacturer** Navistar, Inc.

## **Components EXTERIOR LIGHTING**

**Potential Number of Units Affected 13,570**

### **Summary**

Navistar, Inc. (Navistar) is recalling certain 2019-2020 International LT and 2018-2021 International HX vehicles. The brake light switch may have a weak solder joint, possibly resulting in a poor electrical contact and inoperative brake lights or brake lights that stay on.

### **Remedy**

Navistar will notify owners, and dealers will replace the brake light switch, free of charge. The recall is expected to begin May 18, 2020. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 20501.

### **Vehicles**

| <b>MAKE</b>      | <b>MODEL</b> | <b>YEAR</b> |
|------------------|--------------|-------------|
| INTERNATIONAL HX |              | 2018-2021   |
| INTERNATIONAL LT |              | 2019-2020   |

## **Improperly Tightened Instrument Panel Casing**

**NHTSA Campaign Number: 20V152000**

**Manufacturer** BMW of North America, LLC

**Components** ELECTRICAL SYSTEM, AIR BAGS

**Potential Number of Units Affected 15**

### **Summary**

BMW of North America, LLC (BMW) is recalling certain 2019-2020 X4 xDrive30i and X4 M40i, and 2018-2020 X3 sDrive30i, X3 xDrive30i, X3 M40i, and X3M vehicles. The instrument panel casing may not have been tightened properly to the passenger air bag.

### **Remedy**

BMW will notify owners, and dealers will replace the instrument panel casing, free of charge. The recall is expected to begin May 11, 2020. Owners may contact BMW customer service at 1-800-525-7417.

### **Vehicles**

**MAKE MODEL YEAR**

BMW X3 2018-2020

BMW X4 2019-2020