



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

Loss of Stability Control and Anti-Lock Brakes

NHTSA Campaign Number: 20V090000

Manufacturer Mercedes-Benz USA, LLC.

Components SERVICE BRAKES, HYDRAULIC, POWER TRAIN, ELECTRONIC STABILITY CONTROL

Potential Number of Units Affected 6,517

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019-2020 G550 4MATIC and G63 AMG 4MATIC vehicles. An electrical resistor within the differential locking module may malfunction, interrupting communication between the control unit and the differential locking actuator, possibly resulting in the deactivation of the Electronic Stability Program (ESP) and Anti-lock Brake System (ABS) while driving.

Remedy

MBUSA will notify owners, and dealers will inspect the differential locking modules and replace them as necessary, free of charge. The recall is expected to begin April 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	AMG G63	2019-2020
MERCEDES BENZ	G550	2019-2020

High-Voltage Battery May Fail

NHTSA Campaign Number: 20V107000

Manufacturer Mercedes-Benz USA, LLC.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 1

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling one 2019 Smart Fortwo Electric Drive vehicle. A welded joint within the high-voltage battery main cell conductors may detach and interrupt electrical contact, resulting in sudden battery failure. The detached weld may also cause an electrical arc which can ignite inside the battery cells.

Remedy

MBUSA will notify the owner, and a dealer will replace the high-voltage battery, free of charge. The recall is expected to begin April 24, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicle

MAKE MODEL YEAR

SMART FORTWO 2019

Fuel Pump May Fail

NHTSA Campaign Number: 20V012000

Manufacturer Toyota Motor Engineering & Manufacturing

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 1,817,969

Summary

Toyota Motor Engineering & Manufacturing (Toyota) recalled certain 2018-2019 4Runner, Highlander, Camry, Land Cruiser, Sequoia, Sienna, Tacoma and Tundra, and Lexus RC 300, RC 350, GS 350, GX 460, IS 300, LC 500, LS 500, LX 570, RX 350L, and 2019 Toyota Avalon and Corolla, and certain Lexus NX 300, and ES 350 vehicles on January 13, 2020.

On March 4, 2020, Toyota expanded the recall to include certain 2014-2015 Toyota 4Runner and Land Cruiser,

2018 Avalon, Corolla, 2014 FJ Cruiser, 2017 Sienna and Lexus 2018 ES 350, 2018-2019 GS 300, 2013-2014 GS350, 2014-2015 GX 460, IS 350 and LX 570, 2014 IS F, 2018-2019 IS 350, LC 500H and LS 500H, 2013-2015 LS 460, 2015 NX 200T and RC350, 2017 RC 200T and RX 350. Toyota also removed the 2018-2019 Toyota 4Runner and Land Cruiser and 2018-2019 Lexus GX 460 and LX 570 and 2019 NX300 from inclusion in this recall. The low-pressure fuel pump inside the fuel tank may fail.

Remedy

Toyota issued owners an interim notification on February 17, 2020 to the original population of potentially affected vehicles. Owners of the vehicles in the expanded population will be mailed letters by March 13, 2020. Toyota will send a second notice to owners around May 3, 2020 to have the fuel pump replaced. Owners may contact Toyota customer service at 1-888-270-9371 or Lexus customer service at 1-800-255-3987. Toyota's numbers for this recall are 20TB02 and 20TA02 for Toyota vehicles and 20LB01 and 20LA01 for Lexus vehicles.

Vehicles

MAKE	MODEL	YEAR
LEXUS	ES350	2018-2019
LEXUS	GS 350	2013-2014, 2018-2019
LEXUS	GS300	2018-2019
LEXUS	GX460	2014-2015
LEXUS	IS 300	2018-2019
LEXUS	IS200T	2017
LEXUS	LC500	2018-2019
LEXUS	LC500H	2018-2019
LEXUS	LS460	2013-2015
LEXUS	LS500	2018-2019
LEXUS	LS500 H	2018-2019
LEXUS	LX570	2014-2015
LEXUS	NX200T	2015
LEXUS	RC 200T	2017
LEXUS	RC 300	2018-2019
LEXUS	RC 350	2015, 2018-2019
LEXUS	RX350	2017-2019
TOYOTA	4RUNNER	2014-2015
TOYOTA	AVALON	2018-2019
TOYOTA	CAMRY	2018-2019
TOYOTA	COROLLA	2018-2019
TOYOTA	FJ CRUISER	2014
TOYOTA	HIGHLANDER	2018-2019
TOYOTA	LAND CRUISER	2014-2015
TOYOTA	SEQUOIA	2018-2019
TOYOTA	SIENNA	2017-2019

MAKE	MODEL	YEAR
TOYOTA	TACOMA	2018-2019
TOYOTA	TUNDRA	2018-2019

Interior Switches May Not Illuminate/FMVSS 101

NHTSA Campaign Number: 20V089000

Manufacturer Mercedes-Benz USA, LLC.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 2,101

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 CLA250, CLA250 4MATIC and CLA35 AMG 4MATIC, 2020-2021 GLE350, GLE350 4MATIC, GLE450 4MATIC, GLS450 4MATIC and GLS580 4MATIC and 2021 GLE53 AMG Coupe, GLE63S AMG 4MATIC, GLS63 AMG 4MATIC and Maybach GLS600 4MATIC vehicles. The instrument cluster software may deactivate the illumination of certain interior switches (switch bar, overhead control unit, steering wheel) if the hazard lights are turned on and the ignition switch is in the 'off' position. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 101, "Control and Displays."

Remedy

MBUSA will notify owners, and dealers will update the instrument cluster software, free of charge. The recall is expected to begin April 14, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG CLA35	2020
MERCEDES-BENZ	AMG GLE53	2021
MERCEDES-BENZ	AMG GLE63S	2021
MERCEDES-BENZ	AMG GLS63	2021
MERCEDES-BENZ	CLA250	2020
MERCEDES-BENZ	GLE350	2020-2021
MERCEDES-BENZ	GLE450	2020-2021
MERCEDES-BENZ	GLS450	2020-2021
MERCEDES-BENZ	GLS580	2020-2021
MERCEDES-BENZ	MAYBACH GLS600	2021

Rear Spoiler May Detach

NHTSA Campaign Number: 20V095000

Manufacturer BMW of North America, LLC

Components STRUCTURE

Potential Number of Units Affected 550

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 X6 sDrive40i, X6 xDrive40i, and X6 xDrive50i vehicles. The rear spoiler may detach.

Remedy

BMW will notify owners, and dealers will inspect and replace the rear spoiler, as necessary, free of charge. The recall is expected to begin April 13, 2020. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW X6 2020