



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

April 13, 2020

Rear Doors May Open While Driving

NHTSA Campaign Number: 20V184000

Manufacturer General Motors LLC

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 897

Summary

General Motors LLC (GM) is recalling certain 2019-2020 Chevrolet Bolt EV vehicles. The door-handle cable inside the rear doors may be too long, allowing contact with the window when it is opened, possibly damaging the cable. A damaged cable may cause the rear door to open unintentionally when the rear window is opened. Additionally, it may cause the rear inside door handle to not work.

Remedy

GM will notify owners, and dealers will replace the rear inside door-handle cables, free of charge. The recall is expected to begin May 11, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is A202298320.

Vehicle

MAKE MODEL YEAR

CHEVROLET BOLT EV 2019-2020

Rearview Image Can Remain on Display/FMVSS 111

NHTSA Campaign Number: 20V191000

Manufacturer Chrysler (FCA US LLC)

Components BACK OVER PREVENTION

Potential Number of Units Affected 318,537

Summary

Chrysler (FCA US LLC) is recalling certain 2020 Jeep Gladiator and Jeep Cherokee, 2019-2020 Ram 1500 Pickup, Ram 2500 Pickup, Ram 3500 Pickup, Chrysler Pacifica, Dodge Durango, Jeep Grand Cherokee, Jeep Wrangler, and Jeep Renegade and 2019 Dodge Challenger vehicles equipped with 8.4" or 12" radio displays. A software error can cause the rearview camera image to remain displayed after the vehicle has been shifted out of reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors."

Remedy

Chrysler will notify owners, and dealers will update the radio display software, free of charge. The recall is expected to begin May 22, 2020. Owners may contact Chrysler customer service at 1-800-853-1403. Chrysler's number for this recall is W30-W37.

Vehicles

MAKE	MODEL	YEAR
CHRYSLER	PACIFICA	2019-2020
DODGE	CHALLENGER	2019
DODGE	DURANGO	2019-2020
JEEP	CHEROKEE	2020
JEEP	GLADIATOR	2020
JEEP	GRAND CHEROKEE	2019-2020
JEEP	RENEGADE	2019-2020
JEEP	WRANGLER	2019-2020
RAM	1500	2019-2020
RAM	2500	2019-2020
RAM	3500	2019-2020

Gear Position Display May Be Inaccurate

NHTSA Campaign Number: 20V197000

Manufacturer Ford Motor Company

Components POWER TRAIN

Potential Number of Units Affected 55,158

Summary

Ford Motor Company (Ford) is recalling certain 2020 Ranger and F-150 vehicles equipped with 10-speed automatic transmissions and certain 2020 Expedition vehicles equipped with a "police" package. The transmission shift cable lock clip may not be fully seated, allowing the transmission to actually be in a different gear than the gear shift position selected by the driver.

Remedy

Ford will notify owners, and dealers will inspect and correct the shift cable locking clip installation, as necessary, free of charge. The recall is expected to begin April 27, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S18.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

FORD	EXPEDITION	2020
------	------------	------

FORD	F-150	2020
------	-------	------

FORD	RANGER	2020
------	--------	------

Driver not Warned when ABS Offline/FMVSS 121, 136

NHTSA Campaign Number: 20V199000

Manufacturer PACCAR Incorporated

Components SERVICE BRAKES, AIR, ELECTRONIC STABILITY CONTROL

Potential Number of Units Affected 455,458

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2008-2019 Peterbilt 330, 335, 337, 340, 348, 365, 367, 384, 386, 387, 388, 389, 567, 579 and 587 vehicles and 2008-2020 Kenworth T170, T270, T370, T660, T680, T800, T880, and W900 vehicles equipped with NAMUX Software. In the event that the Anti-lock Brake System (ABS) loses battery and/or ignition power to the controller, the dash warning light for the ABS may not illuminate to warn the driver of the loss of ABS. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 121, "Air Brake Systems," and 136, "Electronic Stability Control System on Heavy Vehicles."

Remedy

PACCAR will notify owners, and dealers will update the NAMUX software within the cab control module, free of charge. The recall is expected to begin June 15, 2020. Owners may contact Kenworth customer service at 1-425-828-5888 or Peterbilt customer service at 1-940-591-4220. PACCAR's number for this recall is 20pbc AND 20KWB.

Vehicles

MAKE	MODEL	YEAR
KENWORTH	T170	2008-2020
KENWORTH	T270	2008-2020
KENWORTH	T370	2008-2020
KENWORTH	T660	2008-2019
KENWORTH	T680	2011-2020
KENWORTH	T800	2008-2020
KENWORTH	T880	2011-2020
KENWORTH	W900	2008-2020
PETERBILT	330	2008-2019
PETERBILT	335	2008-2011
PETERBILT	337	2008-2019
PETERBILT	340	2008-2011
PETERBILT	348	2008-2019
PETERBILT	365	2008-2019
PETERBILT	367	2008-2019
PETERBILT	384	2008-2019
PETERBILT	386	2008-2019
PETERBILT	387	2008-2016
PETERBILT	388	2008-2019
PETERBILT	389	2008-2019
PETERBILT	567	2008-2019
PETERBILT	579	2008-2019
PETERBILT	587	2008-2019