



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

May 4, 2020

Front Left Seatbelt Improperly Installed

NHTSA Campaign Number: 20V228000

Manufacturer Mercedes-Benz USA, LLC.

Components SEAT BELTS

Potential Number of Units Affected 6

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 E450 Coupe vehicles. The front left seatbelt may be improperly installed, potentially allowing the seatbelt to contact sharp metal components and damage the seatbelt webbing.

Remedy

MBUSA will notify owners, and dealers will inspect and reroute the front left seatbelt as necessary, or replace it if the webbing is damaged, free of charge. The recall is expected to begin June 20, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicle

MAKE	MODEL YEAR
-------------	-------------------

MERCEDES BENZ E450	2020
--------------------	------

Rear Seat Wiring Harness May Be Routed Incorrectly

Damaged wires may cause the rear side air bags to not deploy as intended. Additionally, the driver may not be warned if the second row right seat is not locked into place correctly after using the "Easy Entry" function. Either of these scenarios can increase the risk of injury in the event of a crash.

NHTSA Campaign Number: 20V226000

Manufacturer Mercedes-Benz USA, LLC.

Components ELECTRICAL SYSTEM, AIR BAGS

Potential Number of Units Affected 120

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 GLE 350 and GLE 450 vehicles equipped with an electrically adjustable second-row seat. The wiring harness under the seat may become pinched during seat adjustment, possibly causing damage to the wires.

Remedy

MBUSA will notify owners, and dealers will inspect and reroute the wiring harness as necessary, and repair any wire damage, free of charge. The recall is expected to begin June 20, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	GLE350	2020
MERCEDES-BENZ	GLE450	2020

Foam Pad May Retain Moisture and Corrode Fuel Tank

NHTSA Campaign Number: 20V231000

Manufacturer McLaren Automotive Incorporated

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 2,763

Summary

McLaren Automotive Incorporated (McLaren) is recalling certain 2016-2020 720S, 2019 Senna, 2020 GT, and 2017-2019 570GT vehicles. The Noise, Vibration, and Harshness (NVH) foam pad underneath the fuel tank may retain moisture and corrode the fuel tank, potentially causing a fuel leak.

Remedy

McLaren will notify owners, and dealers will remove the NVH foam pad from the vehicle and inspect the fuel tank. If the fuel tank is found to have corrosion, it will be replaced. Repairs will be performed free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact McLaren's Client Services department at 855-202-8815, Monday to Friday between 9am and 6pm EST or customerservice.na@mclaren.com.

Vehicles

MAKE MODEL YEAR

MCLAREN 570 GT	2017-2019
MCLAREN 720S	2016-2020
MCLAREN GT	2020
MCLAREN SENNA	2019