



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

June 15, 2020

Hood May Open Unexpectedly

NHTSA Campaign Number: 20V324000

Manufacturer General Motors LLC

Components STRUCTURE, LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 574

Summary

General Motors LLC (GM) is recalling certain 2020 Chevrolet Silverado 2500 and 3500 and GMC Sierra 2500 and 3500 vehicles previously recalled under 20V-142. The hood-latch striker wires on replacement hoods installed for Safety Recall 20V-142 may not have been heat-treated properly, possibly causing them to fracture.

Remedy

GM will notify owners, and dealers will replace the hood assembly, free of charge. For hoods sold over the counter, dealers will contact customers with instructions for hood replacement. The recall is expected to begin July 20, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020 or GMC customer service at 1-888-988-7267. GM's number for this recall is N202306490.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

CHEVROLET	SILVERADO 2500	2020
-----------	----------------	------

CHEVROLET	SILVERADO 3500	2020
-----------	----------------	------

MAKE	MODEL	YEAR
GMC	SIERRA 2500	2020
GMC	SIERRA 3500	2020

Left Side Door May Remain Unlatched and Open

NHTSA Campaign Number: 20V325000

Manufacturer Jaguar Land Rover North America, LLC

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 785

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2016 Land Rover Range Rover and Range Rover Sport vehicles. These vehicles were previously recalled and repaired under Recall 19V-390, however the repair may not have been completed properly. A spring in the Keyless Vehicle Latching System (KV Latch) may get stuck, causing the left hand door to remain unlatched when the door is closed.

Remedy

Land Rover will notify owners, and dealers will update the software, and inspect the KV latches, replacing them if necessary, free of charge. This recall is expected to begin July 24, 2020. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N459.

Vehicles

MAKE	MODEL	YEAR
LAND ROVER	RANGE ROVER	2016
LAND ROVER	RANGE ROVER SPORT	2016

Doors May Open While Driving

NHTSA Campaign Number: 20V331000

Manufacturer Ford Motor Company

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 2,147,323

Summary

Ford Motor Company (Ford) is recalling certain 2011-2014 Fiesta, 2013-2014 Fusion, 2015 Mustang, 2013-2015 Escape and C-Max, 2012-2015 Focus, 2014-2016 Transit Connect, 2013-2014 Lincoln MKZ, and 2015 MKC vehicles. These vehicles were previously recalled and repaired under recalls 15V-246, 16V-643 or 17V-210, however the repair may not have been completed properly. A component within the door latches may break making the doors difficult to latch and/or leading the driver or a passenger to believe a door is securely closed when, in fact, it is not.

Remedy

Ford will notify owners, and dealers will inspect the latch date codes to confirm if the repair was done correctly, and replace the side door latches if necessary, free of charge. Owners will also have the option to inspect their own vehicle's door latches and enter the date codes into a website to determine if the latches are correct. This recall is expected to begin July 20, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S30.

Vehicles

MAKE	MODEL	YEAR
FORD	C-MAX	2013-2015
FORD	ESCAPE	2013-2015
FORD	FIESTA	2011-2014
FORD	FOCUS	2012-2015
FORD	FUSION	2013-2014
FORD	MUSTANG	2015
FORD	TRANSIT CONNECT	2014-2016
LINCOLN	MKC	2015
LINCOLN	MKZ	2013-2014

Left Rear Seat Back Electric Latch May Fail

NHTSA Campaign Number: 20V328000

Manufacturer Mercedes-Benz USA, LLC.

Components SEATS

Potential Number of Units Affected 1,352

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2020 E450, AMG E63S, GLC300, AMG GLC43, AMG GLC63, AMG GT53, and AMG GT63 vehicles equipped with rear seatbacks that can be electrically unlatched. The left-rear seatback latch may not be strong enough to withstand certain loads. If cargo were to strike the left-rear seatback, the latch may fail.

Remedy

MBUSA will notify owners, and dealers will replace the left-rear seatback latch, free of charge. The recall is expected to begin August 4, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	E450	2020
MERCEDES BENZ	E63S AMG	2020
MERCEDES BENZ	GLC300	2020
MERCEDES BENZ	GLC43 AMG	2020
MERCEDES-BENZ	AMG GLC63	2020
MERCEDES-BENZ	AMG GT 53	2020
MERCEDES-BENZ	AMG GT63	2020

Rear Seat Belt Assemblies May Not Lock as Intended

NHTSA Campaign Number: 20V326000

Manufacturer Honda (American Honda Motor Co.)

Components SEAT BELTS

Potential Number of Units Affected 128

Summary

Honda (American Honda Motor Co.) is recalling certain 2019 Clarity Fuel Cell, Clarity Electric, and Clarity Plug-in Hybrid vehicles with rear seat belt assemblies with a dual-mode locking mechanism. The seat belt webbing sensor locking mechanism may not lock as intended.

Remedy

Honda will notify owners, and dealers will inspect the rear seat belt assembly production dates, and replace the assemblies, as necessary, free of charge. The recall is expected to begin July 13, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is Z7L.

Vehicles

MAKE	MODEL	YEAR
HONDA	CLARITY ELECTRIC	2019
HONDA	CLARITY FUEL CELL	2019
HONDA	CLARITY PLUG-IN HYBRID	2019

Front Seat Wiring Harnesses Routed Incorrectly

NHTSA Campaign Number: 20V322000

Manufacturer Daimler Vans USA, LLC

Components ELECTRICAL SYSTEM, AIR BAGS, SEATS

Potential Number of Units Affected 11,013

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes-Benz and Freightliner Spinter vans (platform 970 (VS30)), equipped with swivel seats. The wiring harnesses for the front seats may have been routed incorrectly and could become jammed and damaged in the swivel seat frames. If the wiring harness is damaged, the side air bag within the seat may deploy inadvertently or not deploy as designed in the event of a crash, increasing the risk of injury to vehicle occupants.

Remedy

DVUSA will notify owners, and an authorized Mercedes-Benz or Freightliner Sprinter dealer will inspect the wire harness routing for both front seats and will repair the wiring and add clips or cable ties as needed, free of charge. This recall is expected to begin July 17, 2020. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3DREHSIK.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER (VS30)	2019
MERCEDES BENZ	SPRINTER (VS30)	2019

ABS Malfunction Indicator May Not Light/FMVSS 108

NHTSA Campaign Number: 20V319000

Manufacturer General Motors LLC

Components SERVICE BRAKES, HYDRAULIC, ELECTRICAL SYSTEM

Potential Number of Units Affected 12,200

Summary

General Motors is recalling certain 2019-2020 Chevrolet 4500HD, 5500HD, and 6500HD Medium Duty trucks. If the vehicle's body control module (BCM) loses communication with the vehicle's electronic brake control module (EBCM), the EBCM software programming may not illuminate the vehicle's ABS malfunction indicator light (MIL). As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) Number 105, "Hydraulic and Electric Brake Systems."

Remedy

GM will notify owners, and dealers will update the software calibration for the body control module (BCM). This recall is expected to begin July 13, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202305070.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

CHEVROLET	4500HD	2019-2020
CHEVROLET	5500HD	2019-2020
CHEVROLET	6500HD	2019-2020

Brake Master Cylinder May Leak into Booster

NHTSA Campaign Number: 20V332000

Manufacturer Ford Motor Company

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 292,311

Summary

Ford Motor Company (Ford) is recalling certain 2014-2017 F-150 pickup trucks equipped with 3.5L Ecoboost engines. The brake master cylinder may leak brake fluid into the brake booster.

Remedy

Ford will notify owners, and dealers will replace the brake master cylinder and inspect the brake booster, replacing it as necessary, free of charge. This recall is expected to begin June 29, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S31.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

FORD	F-150	2014-2017
------	-------	-----------