



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

June 8, 2020

Front Seat Belt Pretensioners May Not Deploy

NHTSA Campaign Number: 20V305000

Manufacturer Ford Motor Company

Components SEAT BELTS

Potential Number of Units Affected 1,616

Summary

Ford Motor Company (Ford) is recalling certain 2016-2017 Transit Connect vehicles. The front driver and/or passenger seat belt pretensioner initiators could contain an improper generant mix ratio that may prevent the seat belt pretensioners from deploying in the event of a crash.

Remedy

Ford will notify owners, and dealers will inspect and replace seat belt assemblies as necessary, free of charge. This recall is expected to begin June 8, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S25.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

FORD	TRANSIT CONNECT	2016-2017
------	-----------------	-----------

Front Facing Camera Improperly Calibrated

NHTSA Campaign Number: 20V306000

Manufacturer Ford Motor Company

Components ELECTRICAL SYSTEM, FORWARD COLLISION AVOIDANCE

Potential Number of Units Affected 24

Summary

Ford Motor Company (Ford) is recalling certain 2020 Mustang vehicles equipped a forward-looking camera. The camera may be misaligned to the vehicle and features that are dependent on the camera such as Pre-Collision Assist, Adaptive Cruise Control, Lane Keeping System, Driver Alert, and Auto High Beam Control may not function as intended.

Remedy

Ford will notify owners, and dealers will perform the Lane Departure Warning System camera alignment procedure, free of charge. This recall is expected to begin June 15, 2020. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 20S26.

Vehicle

MAKE MODEL YEAR

FORD MUSTANG 2020

ABS Malfunction Indicator May Not Light/FMVSS 108

NHTSA Campaign Number: 20V319000

Manufacturer General Motors LLC

Components SERVICE BRAKES, HYDRAULIC, ELECTRICAL SYSTEM

Potential Number of Units Affected 12,200

Summary

General Motors is recalling certain 2019-2020 Chevrolet 4500HD, 5500HD, and 6500HD Medium Duty trucks. If the vehicle's body control module (BCM) loses communication with the vehicle's electronic brake control module (EBCM), the EBCM software programming may not illuminate the vehicle's ABS malfunction indicator light (MIL). As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard (FMVSS) Number 105, "Hydraulic and Electric Brake Systems."

Remedy

GM will notify owners, and dealers will update the software calibration for the body control module (BCM). This recall is expected to begin July 13, 2020. Owners may contact Chevrolet customer service at 1-800-222-1020. GM's number for this recall is N202305070.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

CHEVROLET	4500HD	2019-2020
-----------	--------	-----------

CHEVROLET	5500HD	2019-2020
-----------	--------	-----------

CHEVROLET	6500HD	2019-2020
-----------	--------	-----------

Unintentional Release of Primary Hood Latch

NHTSA Campaign Number: 20V315000

Manufacturer Nissan North America, Inc.

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 1,831,818

Summary

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2018 Nissan Altima vehicles. If the primary hood latch is inadvertently released, there is an increased likelihood that the secondary hood latch may corrode over time.

Remedy

The remedy for this recall is still under development. Nissan will provide an interim notice to instruct owners how to properly maintain the latch and include a reminder to fully close the hood and engage the primary hood latch each time before driving. This recall is expected to begin June 22, 2020. Owners may contact Nissan customer service at 1-800-867-7669. Note: Recall 16V-029 remains open for any unremedied 2013-2015 Altimas and this recall applies to all vehicles covered by 16V-029 even if those repairs have already been performed.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

NISSAN	ALTIMA	2013-2018
--------	--------	-----------

Secondary Hood Latch may Bind and not Latch

NHTSA Campaign Number: 16V029000

Manufacturer Nissan North America, Inc.

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 846,000

Summary

Nissan North America, Inc. (Nissan) is recalling certain model year 2013-2015 Nissan Altima vehicles manufactured March 6, 2012, to December 31, 2014. In the affected vehicles, the secondary hood latch may bind and remain in the unlatched position when the hood is closed.

Remedy

These vehicles were previously included in recalls 14V-565 and 15V-116, however the previous remedy plan may not have been performed consistently to remove the safety risk. To correct this issue, Nissan will re-notify all affected owners and dealers will replace the hood latch with a new one, free of charge. The recall began on February 17, 2016. Owners may contact Nissan customer service at 1-800-647-7261. Note: This recall supersedes recalls 14V-565 and 15V-116.

Vehicle

MAKE MODEL YEAR

NISSAN ALTIMA 2013-2015

Sunroof Glass Panel May Separate from Vehicle

NHTSA Campaign Number: 20V309000

Manufacturer Bentley Motors, Inc.

Components VISIBILITY

Potential Number of Units Affected 3

Summary

Bentley Motors, Inc. (Bentley) is recalling certain 2020 Continental GT vehicles equipped with a factory-installed sunroof. The sunroof may not be properly bonded to the vehicle body, possibly resulting in wind noise, water leaks, and in some cases, the complete separation of the sunroof from the vehicle.

Remedy

Bentley will notify owners, and dealers will remove the old sunroof glass and fit a new sunroof glass assembly to the vehicle using the approved bonding products and procedure, free of charge. This recall is expected to begin June 15, 2020. Owners may contact Bentley customer service at 1-800-777-6923. Bentley's number for this recall is RE 20/15 (RB57).

Vehicle

MAKE	MODEL	YEAR
------	-------	------

BENTLEY	CONTINENTAL GT	2020
---------	----------------	------

Fuel Pump May Fail

NHTSA Campaign Number: 20V314000

Manufacturer Honda (American Honda Motor Co.)

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 136,057

Summary

Honda (American Honda Motor Co.) is recalling certain 2018-2019 Acura NSX, 2019 Acura RDX, RLX and RLX Sport Hybrid, 2018-2019 Honda Accord, Civic Hatchback, Civic Type R and HR-V, 2019-2020 Insight and 2019 Fit vehicles. The low-pressure fuel pump inside the fuel tank may fail.

Remedy

Honda will notify owners and dealers will replace the fuel pump assembly, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Honda customer service at 1-888-234-2138.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

ACURA	NSX	2018-2019
ACURA	RDX	2019
ACURA	RLX	2019
ACURA	RLX HYBRID	2019
HONDA	ACCORD	2018-2019
HONDA	CIVIC	2018-2019
HONDA	FIT	2019

MAKE	MODEL	YEAR
-------------	--------------	-------------

HONDA	HR-V	2018-2019
-------	------	-----------

HONDA	INSIGHT	2019-2020
-------	---------	-----------