



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

July 13, 2020

Seat Belts May Not Restrain Occupant

NHTSA Campaign Number: 20V378000

Manufacturer Volvo Car USA LLC

Components SEAT BELTS

Potential Number of Units Affected 307,910

Summary

Volvo Cars of N.A., LLC (Volvo) is recalling certain 2008-2016 V70 and XC70, 2007-2016 S80, 2011-2018 S60 and V60, 2016-2018 S60 Cross Country, 2014-2020 S60L, 2009-2015 S80L, 2009-2016 XC60 and 2015-2018 V60 Cross Country vehicles. The flexible steel cable that connects the seat belt to the front outboard seating positions may fatigue over time, causing the seat belt to not secure the occupant in the event of a crash.

Remedy

Volvo will notify owners, and dealers will replace the seat belt anchor cable for both front seats. This recall is expected to begin August 25, 2020. Owners may contact Volvo customer service at 1-800-458-1552. Volvo's number for this recall is R10029.

Vehicles

MAKE MODEL YEAR

VOLVO S60	2011-2018
VOLVO S60CC	2016-2018
VOLVO S60L	2014-2020
VOLVO S80	2007-2016
VOLVO S80L	2009-2015
VOLVO V60	2011-2018
VOLVO V60CC	2015-2018
VOLVO V70	2008-2016
VOLVO XC60	2009-2016
VOLVO XC70	2008-2016

Doors May Open Unexpectedly

NHTSA Campaign Number: 20V387000

Manufacturer Jaguar Land Rover North America, LLC

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 6,211

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2013-2016 Range Rover and 2014-2016 Range Rover Sport vehicles. These vehicles were previously recalled and repaired under Recall 19V-392, however the repair may not have been completed properly. Due to a problem with the Keyless Vehicle Latching System (KV Latch), the doors may appear to be closed but may be unlatched.

Remedy

Land Rover will notify owners, and dealers will inspect for any issues with the KV system, disabling the KV mechanisms if necessary, and update the KV Latch software, free of charge. The recall is expected to begin August 28, 2020. Owners may contact Land Rover customer service at 1-800-452-4827. Land Rover's number for this recall is N476.

Vehicles

MAKE	MODEL	YEAR
LAND ROVER	RANGE ROVER	2013-2016
LAND ROVER	RANGE ROVER SPORT	2014-2016

Incorrect Software Programming for ABS/FMVSS 121

NHTSA Campaign Number: 20V383000

Manufacturer Hino Motors Sales U.S.A., Inc.

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 10

Summary

Hino Motors Sales U.S.A., Inc. (Hino) is recalling certain 2021 NJ8A low-profile heavy trucks equipped with a full air brake system. The Anti-Lock Braking System control unit (ABS ECU) may be programmed with incorrect datasets for the tone ring teeth, causing the anti-lock braking system to mistakenly detect a difference between front and rear wheel rotation speeds resulting in deactivation of the Anti-Lock Braking function. As such, these vehicles fail to comply with Federal Motor Vehicle Safety Standard number 121, "Air Brake Systems."

Remedy

Hino will notify owners, and dealers will reprogram the ABS-ECU with the corrected software. The software to remedy these vehicles is still under development. The manufacturer has not yet notified NHTSA of the recall schedule. Owners may contact Hino customer service at 1-248-699-9390. Hino's number for this recall is AAJS0.

Vehicle

MAKE MODEL YEAR

HINO NJ8A 2021

Unintended Movement Due to Damaged Park Mechanism

NHTSA Campaign Number: 20V389000

Manufacturer Kia Motors America

Components POWER TRAIN, ELECTRICAL SYSTEM

Potential Number of Units Affected 3,714

Summary

Kia Motors America (Kia) is recalling certain 2015-2016 Kia Soul Electric Vehicle (EV) vehicles. The parking mechanism may become damaged if the driver moves the gear shift lever into Park 'P' before the vehicle comes

to a complete stop. If the parking mechanism is damaged, unintended vehicle movement may occur when the gear shift lever is in the Park 'P' position and the parking brake is not applied.

Remedy

Kia will notify owners, and dealers will update the electronic control unit software, free of charge. The recall is expected to begin August 7, 2020. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC191.

Vehicle

MAKE MODEL YEAR

KIA SOUL EV 2015-2016

Corroded Modulator Valve May Cause Brake Pull

NHTSA Campaign Number: 20V390000

Manufacturer Daimler Trucks North America LLC

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 164,317

Summary

Daimler Trucks North America LLC (DTNA) is recalling certain 2017-2021 Freightliner Cascadia tractor trailers. The single brake modulator valve may be affected by chemical corrosion which can slow down the release timing and cause the brakes to pull to the affected side during automatic braking events.

Remedy

DTNA will notify owners, and dealers will perform repairs, free of charge. The manufacturer has not yet provided the repair procedures. This recall is expected to begin August 30, 2020. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-855.

Vehicle

MAKE MODEL YEAR

FREIGHTLINER CASCADIA 2017-2021