



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

July 20, 2020

ESP System Software Programmed Incorrectly

NHTSA Campaign Number: 20V395000

Manufacturer Mercedes-Benz USA, LLC.

Components ELECTRICAL SYSTEM, ELECTRONIC STABILITY CONTROL

Potential Number of Units Affected 5,039

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019-2020 C63 AMG, C63 AMG S, AMG GT 53, AMG GT 63, AMG GT 63 S, and 2020 GLC 63 AMG, GLC 63 AMG S vehicles. An incorrect Electronic Stability Program (ESP) software version may cause the ESP system to react inaccurately.

Remedy

MBUSA will notify owners, and dealers will update the ESP software, free of charge. The recall is expected to begin August 28, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG C63	2019-2020
MERCEDES-BENZ	AMG C63 S	2019-2020
MERCEDES-BENZ	AMG GLC63	2020
MERCEDES-BENZ	AMG GLC63 S	2020

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG GT 53	2019-2020
MERCEDES-BENZ	AMG GT63	2019-2020
MERCEDES-BENZ	AMG GT63S	2019-2020

Inoperative Right Rear Seat Belt Buckle

NHTSA Campaign Number: 20V403000

Manufacturer Mitsubishi Motors North America, Inc.

Components SEAT BELTS

Potential Number of Units Affected 177,000

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2014-2019 Outlander and 2018-2019 Outlander PHEV vehicles. The second-row center seat belt buckle may interfere with the right-side seat belt buckle when the seat backs are folded down. The interference may cause the right-side seat belt buckle cover to come off, making the buckle latch inoperable and unable to restrain an occupant.

Remedy

MMNA will notify owners, and dealers will modify the second-row center seat belt buckle cover, install a new warning label to the second-row seat support base, and provide a new warning label insert for the owner's manual, free of charge. This recall is expected to begin September 11, 2020. Owners may contact MMNA customer service at 1-888-648-7820. Mitsubishi's number for this recall is SR-20-004.

Vehicles

MAKE	MODEL	YEAR
MITSUBISHI	OUTLANDER	2014-2019
MITSUBISHI	OUTLANDER PHEV	2018-2019

Brand Emblem and Securing Nuts May be Projectiles

NHTSA Campaign Number: 20V396000

Manufacturer Chrysler (FCA US LLC)

Components STEERING, AIR BAGS

Potential Number of Units Affected 925,239

Summary

Chrysler (FCA US LLC) is recalling certain 2008-2010 Chrysler Town and Country and Dodge Grand Caravan and 2007-2011 Dodge Nitro vehicles. These vehicles may have a loose or missing brand emblem in the center of the steering wheel. The loose emblem or the securing nuts for the emblem within the driver air bag module may become projectiles in the event of a driver air bag deployment.

Remedy

Chrysler will notify owners, and dealers will replace the driver's air bag cover with a redesigned cover, free of charge. The recall is expected to begin August 26, 2020. Owners may contact FCA US LLC customer service at 1-800-853-1403. Chrysler's number for this recall is W09.

Vehicles

MAKE	MODEL	YEAR
CHRYSLER	TOWN AND COUNTRY	2008-2010
DODGE	GRAND CARAVAN	2008-2010
DODGE	NITRO	2007-2011

Engine Compartment Seal May Detach

NHTSA Campaign Number: 20V397000

Manufacturer Volkswagen Group of America, Inc.

Components STRUCTURE

Potential Number of Units Affected 12,964

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2013-2018 Audi S8 and A8 vehicles. The seal around the engine compartment may come loose and contact hot engine components.

Remedy

Audi will notify owners, and dealers will install a retaining plate to prevent the engine compartment seal from loosening. The recall is expected to begin September 4, 2020. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 51G6.

Vehicles

MAKE	MODEL	YEAR
AUDI	A8	2013-2018
AUDI	S8	2013-2018

