

NHTSA Recalls of Interest July 6, 2020

Side Curtain Air Bag May Not Properly Inflate

NHTSA Campaign Number: 20V374000

Manufacturer Chrysler (FCA US LLC)

Components AIR BAGS

Potential Number of Units Affected 114

Summary

Chrysler (FCA US LLC) is recalling certain 2020 Ram Promaster vans and 1500 pickups. The affected vehicles may have an improperly crimped diffuser in the side curtain airbag which may result in the diffuser detaching from the inflator in the event of an air bag deployment.

Remedy

FCA US will notify owners, and dealers will replace the side curtain air bag assemblies, free of charge. The recall is expected to begin August 14, 2020. Owners may contact FCA US customer service at 1-800-853-1403. FCA US's number for this recall is W52.

Vehicles

MAKE MODEL YEAR

RAM 1500 2020 RAM PROMASTER 2020

Loss of Electric Power Steering Assist

NHTSA Campaign Number: 20V373000

Manufacturer Toyota Motor Engineering & Manufacturing

Components STEERING

Potential Number of Units Affected 46

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2019-2020 RAV4 and 2020 RAV4 Hybrid vehicles equipped with electric power steering (EPS). Water may enter through the steering gear box cover and cause a loss of electric power steering assist.

Remedy

Toyota will notify owners, and dealers will replace the power steering gear box, free of charge. This recall is expected to begin August 10, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is 20TB11 / 20TA11.

Vehicles

MAKE MODEL YEAR

TOYOTA RAV4 2019-2020 TOYOTA RAV4 HYBRID 2020

Hybrid System may Shutdown and cause Stall

NHTSA Campaign Number: 20V369000

Manufacturer Toyota Motor Engineering & Manufacturing

Components HYBRID PROPULSION SYSTEM

Potential Number of Units Affected 266,638

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2013-2015 Prius and 2014-2017 Prius V vehicles not included in recall 18V-684. Excessive voltage in the Intelligent Power Module (IPM) within the inverter may cause the hybrid system to shut down, causing the vehicle to stall while being driven.

Remedy

Toyota will notify owners, and dealers will perform a software update for the hybrid system. If the vehicle has experienced an inverter failure with certain hybrid system faults related to this condition, the inverter assembly will

be repaired or replaced, prior to software update. All repairs will be performed free of charge. This recall is expected to begin August 10, 2020. Owners may contact Toyota customer service at 1-888-270-9371. Toyota's number for this recall is 20TB10 / 20TA10.

Vehicles

MAKE MODEL YEAR

TOYOTA PRIUS 2013-2015 TOYOTA PRIUS V 2014-2017