



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

August 10, 2020

Roof Rail Air Bag May Not Deploy

NHTSA Campaign Number: 20V446000

Manufacturer General Motors LLC

Components AIR BAGS

Potential Number of Units Affected 769

Summary

General Motors, LLC. (GM) is recalling certain 2020 Buick Enclave, Cadillac XT5 and XT6, Chevrolet Blazer, Silverado 1500, 2500 and 3500 and Traverse and GMC Acadia and Sierra 1500, 2500 and 3500 vehicles. The diffuser component of the Roof-Rail Air Bag (RRAB) inflator may not have been properly crimped to the inflator and could separate from the inflator during air bag deployment.

Remedy

GM will notify owners, and dealers will replace the suspect RRAB modules, free of charge. The recall is expected to begin September 14, 2020. Owners may contact GM customer service at 1-866-522-9559. GM's number for this recall is N202305380.

Vehicles

MAKE	MODEL	YEAR
BUICK	ENCLAVE	2020
CADILLAC	XT5	2020

MAKE	MODEL	YEAR
CADILLAC	XT6	2020
CHEVROLET	BLAZER	2020
CHEVROLET	SILVERADO 1500	2020
CHEVROLET	SILVERADO 2500	2020
CHEVROLET	SILVERADO 3500	2020
CHEVROLET	TRAVERSE	2020
GMC	ACADIA	2020
GMC	SIERRA 1500	2020
GMC	SIERRA 2500	2020
GMC	SIERRA 3500	2020

Seat Belt Warning System Not Operating Properly

NHTSA Campaign Number: 20V449000

Manufacturer Mercedes-Benz USA, LLC.

Components SEAT BELTS, ELECTRICAL SYSTEM

Potential Number of Units Affected 56

Summary

Mercedes-Benz USA, LLC. (MBUSA) is recalling certain 2019 C300, C300 Coupe, CLS450, E450 Coupe and S450, 2017-2019 E300, 2018 E400 Coupe, E400 Stationwagon, and 2018-2019 S560 vehicles that have previously had the instrument cluster replaced. The software in the replaced instrument cluster may cause the seat belt warning system to not operate properly, only displaying a solid warning light if either the driver or passenger seat belt is unfastened, instead of a blinking light with an audible tone.

Remedy

MBUSA will notify owners, and dealers will update the instrument cluster software, free of charge. The recall is expected to begin September 29, 2020. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	C300	2019
MERCEDES BENZ	CLS450	2019
MERCEDES BENZ	E300	2017-2019
MERCEDES BENZ	E400	2018
MERCEDES BENZ	E450	2019
MERCEDES BENZ	S450	2019

MAKE MODEL YEAR

MERCEDES BENZ S560 2018-2019

Power Sliding Doors May Open While Moving

NHTSA Campaign Number: 20V437000

Manufacturer Honda (American Honda Motor Co.)

Components LATCHES/LOCKS/LINKAGES

Potential Number of Units Affected 324,194

Summary

Honda (America Honda Motor Co.) is recalling certain 2018-2020 Odyssey vehicles. Water may enter the outer door handle cables for the sliding doors. If this occurs, the outer door handle cables may freeze in cold temperatures, preventing the front and rear sliding door latches from securely latching.

Remedy

Honda will notify owners, and dealers will replace the power sliding door outer handle cables, free of charge. The recall is expected to begin September 23, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is A88.

Vehicle

MAKE MODEL YEAR

HONDA ODYSSEY 2018-2020

Rearview Camera Software Not Installed/FMVSS 111

NHTSA Campaign Number: 20V443000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM, BACK OVER PREVENTION

Potential Number of Units Affected 5

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 X3 sDrive40i, X3 xDrive40i and X3M40i vehicles. These vehicles were not programmed with rearview camera software during assembly, therefore, when the

transmission is shifted to reverse, a rearview image is not displayed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rearview Mirrors."

Remedy

BMW will notify owners, and dealers will program the affected vehicles with rearview camera software, free of charge. A notification schedule has not yet been provided. Owners may contact BMW customer service at 1-800-525-7417.

Vehicle

MAKE MODEL YEAR

BMW X3 2020

Delayed or Inoperative Rearview Camera/FMVSS 111

NHTSA Campaign Number: 20V440000

Manufacturer Honda (American Honda Motor Co.)

Components ELECTRICAL SYSTEM, BACK OVER PREVENTION

Potential Number of Units Affected 499,342

Summary

Honda (American Honda Motor Co.) is recalling certain 2019-2021 Pilot, 2019-2020 Odyssey and 2019-2020 Passport vehicles. Incorrect central network software programming may cause several errors to occur that can delay or prevent the rearview camera image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 111, "Rearview Mirrors."

Remedy

Honda will notify owners that updated software is available. Owners have the option to either follow the mailed instructions to download and update the software for free, or visit a dealer to have the software update performed, free of charge. The recall is expected to begin September 23, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is Y7Y.

Vehicles

MAKE MODEL YEAR

HONDA ODYSSEY 2019-2020

HONDA PASSPORT 2019-2020

HONDA PILOT 2019-2021

Instrument Panel Software Incorrect/FMVSS 101/111

NHTSA Campaign Number: 20V439000

Manufacturer Honda (American Honda Motor Co.)

Components ELECTRICAL SYSTEM, BACK OVER PREVENTION

Potential Number of Units Affected 607,784

Summary

Honda (American Honda Motor Co.) is recalling certain 2018-2020 Odyssey, 2019-2020 Passport, and 2019-2021 Pilot vehicles. Incorrect instrument panel control module software can cause the instrument panel to not display critical information, such as engine oil pressure, speedometer, and gear selector position until the next ignition cycle. Additionally, it can prevent the rearview camera image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) numbers 101, "Control and Displays" and 111, "Rearview Mirrors."

Remedy

Honda will notify owners, and dealers will reprogram the instrument panel control module software, free of charge. This recall is expected to begin September 23, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is T89.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

HONDA	ODYSSEY	2018-2020
-------	---------	-----------

HONDA	PASSPORT	2019-2020
-------	----------	-----------

HONDA	PILOT	2019-2021
-------	-------	-----------

Distorted or Inoperative Rearview Camera/FMVSS 111

NHTSA Campaign Number: 20V438000

Manufacturer Honda (American Honda Motor Co.)

Components BACK OVER PREVENTION

Potential Number of Units Affected 212,068

Summary

American Honda Motor Co. (Honda) is recalling certain 2019-2020 Odyssey vehicles. Water may get into the rearview camera mounting holes and enter the camera lens and cause a distorted image, or no image at all. Additionally, if the rearview camera view mode is set to top-down view, or switched from that view to another mode in a bright environment, the image may not display. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rearview Mirrors."

Remedy

Honda will notify owners, and dealers will replace the rearview camera, free of charge. The recall is expected to begin September 23, 2020. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is W83.

Vehicle

MAKE MODEL YEAR

HONDA ODYSSEY 2019-2020

Loose Steering Column Shaft Bearing Plate

NHTSA Campaign Number: 20V434000

Manufacturer BMW of North America, LLC

Components STEERING

Potential Number of Units Affected 7

Summary

BMW of North America, LLC (BMW) is recalling certain 2019-2020 X5 sDrive40i, X5 xDrive40i and X5 xDrive50i vehicles and 2020 X6M vehicles. The steering column shaft bearing plate may not have been properly attached to the vehicle, allowing it to loosen.

Remedy

BMW will notify owners, and dealers will inspect the steering column shaft bearing plate and properly attach or replace it, as necessary, free of charge. A notification schedule has not yet been provided. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW X5 2019-2020

BMW X6 M 2020

Chassis Missing Additional Stabilization/FMVSS 126

NHTSA Campaign Number: 20V427000

Manufacturer Daimler Vans USA, LLC

Components SUSPENSION

Potential Number of Units Affected 4

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019 Mercedes Benz Sprinter vehicles. The chassis may be missing the additional stabilization required for its cargo capacity. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 126, "Electronic Stability Control Systems."

Remedy

DVUSA will notify owners, and dealers will upgrade the chassis by replacing the stabilizer bar on the front axle and replacing shock absorbers and installing a stabilizer bar on the rear axle, free of charge. The recall is expected to begin September 7, 2020. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3FAHRBA.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

MERCEDES BENZ	SPRINTER (VS30)	2019
---------------	-----------------	------