



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest December 21, 2020

[Second-Row Seat Belt May Malfunction/FMVSS 208-209](#)

NHTSA Campaign Number: 20V793000

Manufacturer Jaguar Land Rover North America, LLC

Components SEAT BELTS

Potential Number of Units Affected 13

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles equipped with a replacement part for the second-row seat belt assembly. These seat belt assemblies may not function properly in the event of a crash. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standards (FMVSS) numbers 208, "Occupant Crash Protection" and 209, "Seat Belt Assemblies."

Remedy

Land Rover will notify owners, and dealers will replace the second-row seat belt assemblies, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N523.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

LAND ROVER	RANGE ROVER EVOQUE	2020
------------	--------------------	------

Seat Material Burn Rate/FMVSS 302

NHTSA Campaign Number: 20V794000

Manufacturer Jaguar Land Rover North America, LLC

Components SEATS

Potential Number of Units Affected 66

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2020 Range Rover Evoque vehicles equipped with climate specification front seats trimmed with "Dinamica" cloth. In the event of a fire, the seat material may burn quicker than allowed. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 302, "Flammability of Interior Materials."

Remedy

Land Rover will notify owners, and dealers will replace the front seat covers, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N524.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

LAND ROVER	RANGE ROVER EVOQUE	2020
------------	--------------------	------

Rearview Camera may Shut Down/FMVSS 111

NHTSA Campaign Number: 20V766000

Manufacturer Subaru of America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 7,741

Summary

Subaru of America, Inc. (Subaru) is recalling certain 2020 Legacy and Outback vehicles equipped with "high" grade and "mid" grade multimedia navigation. The August 2020 over-the-air software update may have timed out without completing the installation, corrupting the data, and causing the rearview display to shutoff intermittently. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Subaru will notify owners, and dealers will reprogram the software and, if necessary, replace the Cockpit Control Module, free of charge. The recall is expected to begin January 22, 2021. Owners may contact Subaru customer service at 1-844-373-6614. Subaru's number for this recall is WRH-20.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

SUBARU	LEGACY	2020
--------	--------	------

SUBARU	OUTBACK	2020
--------	---------	------

BCM Software Malfunction/FMVSS 103/111

NHTSA Campaign Number: 20V771000

Manufacturer Honda (American Honda Motor Co.)

Components EXTERIOR LIGHTING, VISIBILITY, VISIBILITY/WIPER, BACK OVER PREVENTION, ELECTRICAL SYSTEM

Potential Number of Units Affected 737,233

Summary

Honda (American Honda Motor Co.) is recalling certain 2018-2020 Accord Sedan, Accord Hybrid, and 2019-2020 Insight vehicles. A software error may cause intermittent or continuous disruptions in communication between the Body Control Module (BCM) and other components. This may result in malfunctions of various systems such as the windshield wipers and defroster, rearview camera, exterior lights, audible warning of a stopped vehicle, and power window operation. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 103, "Windshield Defrosting and Defogging Systems" and number 111, "Rear Visibility" as well as FMVSS numbers 104, 108, 114, 118, and 305.

Remedy

Honda will notify owners, and dealers will update the BCM software, free of charge. The recall is expected to begin January 18, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is X95.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

HONDA	ACCORD	2018-2020
-------	--------	-----------

HONDA	ACCORD HYBRID	2018-2020
-------	---------------	-----------

HONDA	INSIGHT	2019-2020
-------	---------	-----------

Driver Side Power Window Switch May Fail

NHTSA Campaign Number: 20V768000

Manufacturer Honda (American Honda Motor Co.)

Components ELECTRICAL SYSTEM, VISIBILITY

Potential Number of Units Affected 268,655

Summary

Honda (American Honda Motor Co.) is recalling certain 2002-2006 CR-V vehicles. Moisture may enter the driver side power window master switch, causing the switch to fail or melt.

Remedy

Honda will notify owners, and dealers will replace the power window master switch and inspect the wiring harness for damage, replacing it if necessary, free of charge. The recall is expected to begin January 18, 2021. Owners may contact Honda customer service at 1-888-234-2138. Honda's number for this recall is P9D.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

HONDA	CR-V	2002-2006
-------	------	-----------