



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest January 11, 2021

SRS Control Unit Can Detach

NHTSA Campaign Number: 21V001000

Manufacturer Volvo Car USA, LLC

Components AIR BAGS, SEAT BELTS

Potential Number of Units Affected 2,883

Summary

Volvo Cars USA, LLC (Volvo Car) is recalling certain 2021 Volvo V60, V60 Cross Country, V90, V90 Cross Country, XC60, and XC90 vehicles. The Supplementary Restraint System (SRS) control unit may not have been properly attached to the car body and may detach during a crash.

Remedy

Volvo Car will notify owners, and dealers will inspect and, as necessary, tighten the SRS control unit mounting screws, free of charge. The recall is expected to begin February 19, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo Car's number for this recall is R10068.

Vehicles

MAKE MODEL YEAR

VOLVO V60	2021
VOLVO V60CC	2021
VOLVO V90	2021
VOLVO V90CC	2021

MAKE MODEL YEAR

VOLVO XC60 2021
VOLVO XC90 2021

Engine may Rev and Overcome Parking Brake

NHTSA Campaign Number: 20V810000

Manufacturer Navistar, Inc.

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 17,213

Summary

Navistar, Inc. (Navistar) is recalling certain 2019-2021 International MV, 2020-2021 International HV, 2014-2020 International DuraStar and 2015-2018 International WorkStar vehicles. When the parking brake is applied and the automatic transmission is still in the drive or reverse position and the stationary PTO switch is engaged by the operator, the engine may rev and overcome the parking brake's ability to keep the vehicle from moving.

Remedy

Navistar will notify owners, and dealers will update the parameters in the Cummins ECM for feature codes 12VXT or 12VXU that enables the PTO neutral interlock, free of charge. The recall is expected to begin February 19, 2021. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 20510.

Vehicles

MAKE	MODEL	YEAR
INTERNATIONAL DURASTAR		2014-2020
INTERNATIONAL HV		2020-2021
INTERNATIONAL MV		2019-2021
INTERNATIONAL WORKSTAR		2015-2018

Hydraulic Caliper Tie Bar May Be Loose

NHTSA Campaign Number: 20V807000

Manufacturer Daimler Trucks North America, LLC

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 80

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2021 Freightliner Custom Chassis MC, Business Class M2, Custom Chassis MBC Chassis, Custom Chassis S2 Chassis, Custom Chassis MT55 Chassis, and 2022 Custom Chassis Saf-T-Liner C2 vehicles. The hydraulic caliper tie bar support fasteners on the steer axles may not have been properly tightened or the tie bar may have not been installed in some cases.

Remedy

DTNA will notify owners, and dealers will inspect both steer axle wheel-ends to make sure that the four tie bar mounting fasteners are properly tightened. If the required tie bar is missing, the caliper anchor mounts and functionality (brake pad slide pins and pad movement) will be inspected before installing a tie bar. All repairs will be performed free of charge. The recall is expected to begin February 18, 2021. DTNA's number for this recall is FL-871.

Vehicles

MAKE	MODEL	YEAR
FCCC	MBC	2021
FCCC	MC	2021
FCCC	MT55	2021
FCCC	S2	2021
FREIGHTLINER	BUSINESS CLASS M2	2021
THOMAS BUILT BUSES	SAF-T-LINER C2	2022

Hydraulic Caliper Tie Bar May Be Loose

NHTSA Campaign Number: 20V806000

Manufacturer Daimler Trucks North America, LLC

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 278

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Thomas Built Saf-T-Liner C2 school buses. The hydraulic caliper tie bar support fasteners on the steer axles may not have been properly tightened or the tie bar may have not been installed in some cases.

Remedy

DTNA will notify owners, and dealers will inspect both steer axle wheel-ends to make sure that the four tie bar mounting fasteners are properly tightened. If the required tie bar is missing, the caliper anchor mounts and functionality (brake pad slide pins and pad movement) will be inspected before installing a tie bar. All repairs will be performed free of charge. The recall is expected to begin February 18, 2021. DTNA's number for this recall is FL-871.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

THOMAS BUILT BUSES SAF-T-LINER C2	2022	
-----------------------------------	------	--

Transmission C1 Hub May Fail**NHTSA Campaign Number:** 20V803000**Manufacturer** Volvo Bus Corporation**Components** POWER TRAIN**Potential Number of Units Affected** 468**Summary**

Volvo Bus Corporation (Volvo Bus) is recalling certain 2015-2020 9700 buses. The transmission C1 hub may fail which may lead to a disabled vehicle.

Remedy

Volvo Bus will notify owners, and dealers will update the Transmission Control Module (TCM) calibration software, free of charge. The recall is expected to begin February 12, 2021. Owners may contact Volvo Bus customer service at 1-866-870-2046.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

VOLVO BUS	9700	2015-2020
-----------	------	-----------