



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest March 8, 2021

Engine Control Module Malfunction

NHTSA Campaign Number: 21V111000

Manufacturer Volkswagen Group of America, Inc.

Components ENGINE, ENGINE AND ENGINE COOLING

Potential Number of Units Affected 238

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 2019-2021 Audi A8 and 2020-2021 Audi S8 vehicles. A missing sealing pin may allow moisture to enter the engine control module connector, possibly causing a control module malfunction.

Remedy

Audi will notify owners, and dealers will inspect the engine control module connector for a missing sealing pin, and install it, if necessary. The connector will also be inspected for corrosion, and replaced as necessary. Repairs will be performed free of charge. The recall is expected to begin April 23, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 97EV.

Vehicles

MAKE MODEL YEAR

AUDI	A8	2019-2021
AUDI	S8	2020-2021

Tire Failure may Cause Sudden Air Loss

NHTSA Campaign Number: 21V115000

Manufacturer General Motors, LLC

Components TIRES

Potential Number of Units Affected 33,838

Summary

General Motors LLC (GM) is recalling certain 2020 Buick Enclave, Cadillac XT4, XT5, Escalade, Escalade ESV, Chevrolet Suburban, Tahoe, Traverse, GMC Yukon, Yukon XL, 2018-2021 Chevrolet Express, GMC Savana, 2019-2020 Chevrolet Blazer, Silverado 1500, GMC Acadia, Sierra 1500, and certain Continental tires sold to the aftermarket for various model year 2018-2021 vehicles. The affected tires were cured for too long during production.

Remedy

GM will notify owners, and dealers will inspect the tires, replacing them as necessary, free of charge. The recall is expected to begin April 12, 2021. Owners may contact GMC customer service at 1-888-988-7267, Buick customer service at 1-866-608-8080, Chevrolet customer service at 1-800-222-1020 or Cadillac customer service at 1-800-458-8006. GM's number for this recall is N212329050.

Vehicles

MAKE	MODEL	YEAR
BUICK	ENCLAVE	2020
CADILLAC	ESCALADE	2020
CADILLAC	ESCALADE ESV	2020
CADILLAC	XT4	2020
CADILLAC	XT5	2020
CHEVROLET	BLAZER	2019-2020
CHEVROLET	EXPRESS	2018-2021
CHEVROLET	SILVERADO 1500	2019-2020
CHEVROLET	SUBURBAN	2020
CHEVROLET	TAHOE	2020
CHEVROLET	TRAVERSE	2020
GMC	ACADIA	2019-2020
GMC	SAVANA	2018-2021
GMC	SIERRA 1500	2019-2020
GMC	YUKON	2020
GMC	YUKON XL	2020

Tire Failure may Cause Sudden Air Loss

NHTSA Campaign Number: 21V123000

Manufacturer Mercedes-Benz USA, LLC

Components TIRES

Potential Number of Units Affected 2,529

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2018 GLE350, GLE43 AMG, and GLE400 vehicles equipped with Continental tires. The affected tires were cured for too long during production.

Remedy

MBUSA will notify owners, and dealers will inspect the tires, and replace them as necessary, free of charge. The recall is expected to begin April 27, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG GLE43	2018
MERCEDES-BENZ	GLE350	2018
MERCEDES-BENZ	GLE400	2018

Front Passenger Seat Occupancy Sensor Mat May Fail

NHTSA Campaign Number: 21V131000

Manufacturer Porsche Cars North America, Inc.

Components AIR BAGS

Potential Number of Units Affected 39,547

Summary

Porsche Cars North America, Inc. (Porsche) is recalling certain 2017-2018 Macan, Macan Turbo Kits, Macan GTS, 2015-2018 Macan S, and Macan Turbo vehicles. The front passenger seat occupancy sensor mat may degrade and fail to detect a passenger in the front seat.

Remedy

Porsche will notify owners, and dealers will replace the sensor mat and seat cushion, free of charge. The recall is expected to begin May 2, 2021. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is AMA2.

Vehicles

MAKE	MODEL	YEAR
PORSCHE	MACAN	2017-2018
PORSCHE	MACAN GTS	2017-2018
PORSCHE	MACAN S	2015-2018
PORSCHE	MACAN TURBO	2015-2018

Lithium-Ion Battery May Short Circuit

NHTSA Campaign Number: 21V127000

Manufacturer Hyundai Motor America

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 4,696

Summary

Hyundai Motor America (Hyundai) is recalling certain 2019-2020 Kona Electric and 2020 Ioniq Electric vehicles. The lithium-ion (Li-ion) battery may short-circuit.

Remedy

Hyundai will notify owners, and as an interim action, owners have the option to follow provided instructions to perform a battery update through the vehicle's infotainment system or request a Hyundai dealer to provide the update. Once parts are available, dealers will replace the Battery System Assembly (BSA). Repairs will be performed free of charge. Owners are advised to park their vehicles outside and away from structures until the interim repair is complete. The recall is expected to begin April 30, 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 200.

Vehicles

MAKE	MODEL	YEAR
HYUNDAI	IONIQ ELECTRIC	2020
HYUNDAI	KONA ELECTRIC	2019-2020

High Beam Malfunction/FMVSS 108

NHTSA Campaign Number: 21V117000

Manufacturer Jaguar Land Rover North America, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 26,805

Summary

Jaguar Land Rover North America, LLC. (Land Rover) is recalling certain 2018-2020 Range Rover, Range Rover Sport, Discovery, and Range Rover Velar vehicles. The Auto High Beam (AHB) system does not indicate through the instrument cluster when the high beams are illuminated automatically. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Land Rover will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin April 23, 2021. Owners may contact Land Rover customer service at 1-800-637-6837. Land Rover's number for this recall is N556.

Vehicles

MAKE	MODEL	YEAR
LAND ROVER	DISCOVERY	2018-2020
LAND ROVER	RANGE ROVER	2018-2020
LAND ROVER	RANGE ROVER SPORT	2018-2020
LAND ROVER	RANGE ROVER VELAR	2018-2020

High Beam Malfunction/FMVSS 108

NHTSA Campaign Number: 21V118000

Manufacturer Jaguar Land Rover North America, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 565

Summary

Jaguar Land Rover North America, LLC. (Land Rover) is recalling certain 2019-2020 Jaguar F-Pace vehicles. The Auto High Beam (AHB) system does not indicate through the instrument cluster when the high beams are illuminated automatically. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard (FMVSS) number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Jaguar will notify owners, and dealers will update the vehicle software, free of charge. The recall is expected to begin April 23, 2021. Owners may contact Jaguar customer service at 1-800-369-1000. Jaguar's number for this recall is H332.

Vehicle

MAKE MODEL YEAR

JAGUAR F-PACE 2019-2020