



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest April 19, 2021

Side Curtain Air Bags May be Unsecured

NHTSA Campaign Number: 21V246000

Manufacturer General Motors, LLC

Components AIR BAGS

Potential Number of Units Affected 108

Summary

General Motors, LLC (GM) is recalling certain 2010-2015, 2017 Buick Enclave, 2010-2019 Chevrolet Traverse, and 2011-2016 GMC Acadia vehicles. The side curtain air bags may not be properly attached.

Remedy

GM will notify owners, and dealers will inspect and, if necessary, realign or replace the weld nuts, free of charge. The recall is expected to begin May 24, 2021. Owners may contact Buick customer service at 1-800-521-7300, Chevrolet customer service at 1-800-222-1020, and GMC customer service at 1-800-462-8782. GM's number for this recall is N202321200.

Vehicles

MAKE	MODEL	YEAR
BUICK	ENCLAVE	2010-2015, 2017
CHEVROLET	TRAVERSE	2010-2019
GMC	ACADIA	2011-2016

Side Curtain Air Bags May Not Deploy

NHTSA Campaign Number: 21V257000

Manufacturer Toyota Motor Engineering & Manufacturing

Components AIR BAGS

Potential Number of Units Affected 279,040

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2009-2015 Venza vehicles. The Supplemental Restraint System (SRS) wiring may become damaged with regular use of the driver-side door.

Remedy

Toyota will notify owners, and dealers will inspect and, if necessary, replace the driver-side front door wire harness, free of charge. The recall is expected to begin May 31, 2021. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 21TB01/21TA01.

Vehicle

MAKE MODEL YEAR

TOYOTA VENZA 2009-2015

Driver's Seat Belt Tensioner Cable May Separate

NHTSA Campaign Number: 21V245000

Manufacturer General Motors, LLC

Components SEAT BELTS

Potential Number of Units Affected 2,568

Summary

General Motors, LLC (GM) is recalling certain 2014-2016 Chevrolet Silverado 1500, 2015-2016 Chevrolet Tahoe, and 2014-2015 GMC Sierra 1500 vehicles that may have received an incorrect replacement tensioner cable assembly as part of a previous recall remedy or a subsequent repair. The flexible steel cable connecting the driver's seat belt to the outboard side of the seat may be repeatedly bent over the seat side shield as the driver enters and exits the vehicle causing the cable to fatigue and separate.

Remedy

GM will notify owners, and dealers will replace the driver seat belt lap pretensioner, free of charge. The recall is expected to begin May 24, 2021. Owners may contact Chevrolet customer service at 1-800-222-1020, and GMC customer service at 1-800-462-8782. GM's number for this recall is N212330040.

Vehicles

MAKE	MODEL	YEAR
CHEVROLET	SILVERADO 1500	2014-2016
CHEVROLET	TAHOE	2015-2016
GMC	SIERRA 1500	2014-2015

Hydraulic Power Steering Hoses May Detach

NHTSA Campaign Number: 21V241000

Manufacturer Daimler Vans USA, LLC

Components STEERING

Potential Number of Units Affected 4,444

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2020 Mercedes Benz Sprinter and Freightliner Sprinter vehicles. The hydraulic power steering return line hoses may detach and cause hydraulic fluid to leak.

Remedy

DVUSA will notify owners, and dealers will install a screw-type clamp, free of charge. The recall is expected to begin May 7, 2021. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is NV3LETULPX.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER (VS30)	2019
FREIGHTLINER	SPRINTER 1500	2019-2020
FREIGHTLINER	SPRINTER 2500	2019-2020
FREIGHTLINER	SPRINTER 3500	2019-2020
FREIGHTLINER	SPRINTER 4500	2019-2020
MERCEDES-BENZ	SPRINTER (VS30)	2019

MAKE	MODEL	YEAR
MERCEDES-BENZ	SPRINTER 1500	2019-2020
MERCEDES-BENZ	SPRINTER 2500	2019-2020
MERCEDES-BENZ	SPRINTER 3500	2019-2020
MERCEDES-BENZ	SPRINTER 4500	2019-2020