



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest August 9, 2021

[Glove Box May Interfere With Knee Air Bag](#)

NHTSA Campaign Number: 21V595000

Manufacturer Volkswagen Group of America, Inc.

Components STRUCTURE, AIR BAGS

Potential Number of Units Affected 58

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 Audi E-Tron Quattro and E-Tron Sportback Quattro vehicles. The right hinge pin for the glove box cover may not be properly secured, allowing the glove box lid trim to interfere with the knee air bag during deployment.

Remedy

Dealers will inspect the glove box, and secure the hinge pin as necessary, free of charge. Owner notification letters are expected to be mailed October 1, 2021. Owners may contact Audi customer service at 1-800-253-2834. Volkswagen's number for this recall is 68H6.

Vehicle

MAKE MODEL YEAR

AUDI E-TRON 2021

Seat Belt Locking Retractor Malfunction/FMVSS 208

NHTSA Campaign Number: 21V483000

Manufacturer Mercedes-Benz USA, LLC

Components SEAT BELTS

Potential Number of Units Affected 4,917

Summary

Mercedes-Benz, LLC (MBUSA) is recalling certain 2021 G550, AMG G63, E350, E450, AMG CLS53, AMG E53, AMG GT43, AMG GT53, AMG GT63, 2021-2022 CLS450, and AMG E63 vehicles. The rear seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect, and replace as necessary, the rear seat belt assemblies, free of charge. Owner notification letters are expected to be mailed August 24, 2021. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG CLS53	2021
MERCEDES-BENZ	AMG E53	2021
MERCEDES-BENZ	AMG E63	2021-2022
MERCEDES-BENZ	AMG G63	2021
MERCEDES-BENZ	AMG GT43	2021
MERCEDES-BENZ	AMG GT53	2021
MERCEDES-BENZ	AMG GT63	2021
MERCEDES-BENZ	CLS450	2021-2022
MERCEDES-BENZ	E350	2021
MERCEDES-BENZ	E450	2021
MERCEDES-BENZ	G550	2021

Seat Belt Locking Retractor Malfunction/FMVSS 208

NHTSA Campaign Number: 21V592000

Manufacturer Ford Motor Company

Components SEAT BELTS

Potential Number of Units Affected 42,493

Summary

Ford Motor Company (Ford) is recalling certain 2021-2022 Transit and 2021 Transit Connect vehicles. The front passenger seat belt automatic locking retractor (ALR) may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect the front passenger seat belt assembly, and replace the assembly as necessary, free of charge. Owner notification letters are expected to be mailed September 13, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21C18.

Vehicles

MAKE	MODEL	YEAR
FORD	TRANSIT	2021-2022
FORD	TRANSIT CONNECT	2021

Seat Belt Locking Retractor Malfunction/FMVSS 208

NHTSA Campaign Number: 21V596000

Manufacturer Mitsubishi Motors North America, Inc.

Components SEAT BELTS

Potential Number of Units Affected 3,735

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2022 Outlander vehicles. The front and second-row passenger seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect, and replace as necessary, the right front seat belt assembly, and the right and left second-row seat belt assemblies, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-21-007.

Vehicle

MAKE MODEL YEAR

mitsubishi outlander 2022

Seat Belt Locking Retractor Malfunction/FMVSS 208

NHTSA Campaign Number: 21V603000

Manufacturer Lamborghini (Automobili Lamborghini)

Components SEAT BELTS

Potential Number of Units Affected 224

Summary

Lamborghini (Automobili Lamborghini) is recalling certain 2021 Urus vehicles. The middle-rear passenger seat belt automatic locking retractors may deactivate early, which can prevent the child restraint system from securing properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect, and replace as necessary, the affected seat belt assemblies, free of charge. Owner notification letters are expected to be mailed October 1, 2021. Owners may contact Lamborghini customer service at 1-866-681-6276. Lamborghini's number for this recall is L636-R.04.21.

Vehicle

MAKE MODEL YEAR

LAMBORGHINI URUS 2021

Loss of Braking Assist

NHTSA Campaign Number: 21V598000

Manufacturer BMW of North America, LLC

Components ENGINE

Potential Number of Units Affected 50,024

Summary

BMW of North America, LLC (BMW) is recalling certain 2020 M340i, M340i xDrive, 540i, 540i xDrive, X3 M40i, 2020-2021 X4 M40i, 745Le xDrive, 2019-2021 Z4 M40i, and 2020-2021 Toyota Supra vehicles. During engine start, the engine management software may cause loss of braking assist. Full mechanical braking (without assist) remains available.

Remedy

Dealers will update the engine management software, free of charge. Owner notification letters are expected to be mailed October 1, 2021. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW	540I	2020
BMW	745LE	2020-2021
BMW	M340I	2020
BMW	X3	2020
BMW	X4	2020-2021
BMW	Z4	2019-2021
TOYOTA	SUPRA	2020-2021

Vehicle May Pull To One Side During Braking

NHTSA Campaign Number: 21V561000

Manufacturer McLaren Automotive Incorporated

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 19

Summary

McLaren Automotive Incorporated (McLaren) is recalling certain 2020 570S, GT, 2019 600LT, and 2019-2020 720S vehicles. The brake assembly banjo bolt may be missing the holes that supply brake fluid to the caliper, which would cause the brakes to fail on one corner of the vehicle.

Remedy

Dealers will inspect and replace the banjo bolt, as necessary, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact McLaren customer service at 1-646-429-8916.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

MCLAREN 570S		2020
MCLAREN 600LT		2019
MCLAREN 720S		2019-2020
MCLAREN GT		2020

Blank LCD Display/FMVSS 101

NHTSA Campaign Number: 21V577000

Manufacturer Kia Motors America

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 5,143

Summary

Kia Motors America (Kia) is recalling certain 2022 Telluride vehicles. The LCD display screen may remain blank after startup. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays."

Remedy

Dealers will update the instrument cluster's software, free of charge. Owner notification letters are expected to be mailed in August 2021. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC215.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

KIA	TELLURIDE	2022
-----	-----------	------