



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest September 27, 2021

Roof Reinforcement May Impair Side Air Bags

NHTSA Campaign Number: 21V732000

Manufacturer Volkswagen Group of America, Inc.

Components STRUCTURE

Potential Number of Units Affected 2

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2018 Tiguan vehicles. During the repair of roof damage, an incorrect roof reinforcement assembly may have been installed.

Remedy

Dealers will be replace the roof reinforcement, free of charge. Owner notification letters are expected to be mailed November 18, 2021. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 51H5.

Vehicle

MAKE	MODEL YEAR
------	------------

VOLKSWAGEN	TIGUAN 2018
------------	-------------

Possible Loss of ABS from Brake Booster Corrosion

NHTSA Campaign Number: 21V707000

Manufacturer Volkswagen Group of America, Inc.

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 38

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 2021 Audi E-Tron Quattro and E-Tron Sportback Quattro vehicles. Corrosion in the brake booster may cause the Anti-Lock Brake System (ABS), Electronic Stability Control (ESC), speedometer display, and brake assist to stop functioning.

Remedy

Dealers will replace the brake booster, free of charge. Owner notification letters are expected to be mailed November 12, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 47R7.

Vehicle

MAKE MODEL YEAR

AUDI E-TRON 2021

Inadequate Panoramic Roof Glass Panel Bonding

NHTSA Campaign Number: 21V712000

Manufacturer Ford Motor Company

Components VISIBILITY

Potential Number of Units Affected 13,544

Summary

Ford Motor Company (Ford) is recalling certain 2021 Mustang Mach-E vehicles. The vehicle's panoramic roof glass panel may not have been properly bonded to the vehicle, which could allow it to detach.

Remedy

Dealers will apply additional urethane adhesive, free of charge. Owner notification letters are expected to be mailed October 27, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S42.

Vehicle

MAKE MODEL YEAR

FORD MUSTANG MACH E 2021

Rotor and Shaft May Separate Causing a Loss of ABS

NHTSA Campaign Number: 21V716000

Manufacturer Volvo Car USA, LLC

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 9

Summary

Volvo Car USA, LLC (Volvo Car) is recalling certain 2021 S90L, 2020-2021 XC60, and XC90 vehicles. An improperly welded rotor and shaft may separate within the integrated brake system.

Remedy

Dealers will replace the hydraulic unit, free of charge. Owner notification letters are expected to be mailed November 12, 2021. Owners may contact Volvo Car customer service at 1-800-458-1552. Volvo Car's number for this recall is R10120.

Vehicles

MAKE MODEL YEAR

VOLVO S90	2021
VOLVO XC60	2020-2021
VOLVO XC90	2020-2021

Turn Signal May Activate in Wrong Direction

NHTSA Campaign Number: 21V725000

Manufacturer Kia Motors America

Components EXTERIOR LIGHTING, ELECTRICAL SYSTEM

Potential Number of Units Affected 88,576

Summary

Kia Motors America (Kia) is recalling certain 2015-2017 Sedona vehicles. The Smart Junction Box (SJB) software logic may not properly interpret the signals received from the multifunction switch, which could cause the turn signal to activate in the opposite direction of what the driver intended.

Remedy

Dealers will update the SJB software, free of charge. Owner notification letters are expected to be mailed November 12, 2021. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC217.

Vehicle

MAKE MODEL YEAR

KIA SEDONA 2015-2017

Turn Signal Malfunction/FMVSS 108

NHTSA Campaign Number: 21V728000

Manufacturer Chrysler (FCA US, LLC)

Components EXTERIOR LIGHTING

Potential Number of Units Affected 23,853

Summary

Chrysler (FCA US, LLC) is recalling certain 2019-2021 Ram ProMaster City vehicles. If one or both turn signal lights fail, the flashing rate may not change to warn the driver of the failure. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will update the Body Controller Module (BCM) software, free of charge. Owner notification letters are expected to be mailed November 10, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y71.

Vehicle

MAKE MODEL YEAR

RAM PROMASTER CITY 2019-2021

Engine Damage May Cause Stall or Fire

NHTSA Campaign Number: 21V727000

Manufacturer Hyundai Motor America

Components ENGINE

Potential Number of Units Affected 95,515

Summary

Hyundai Motor America (Hyundai) is recalling certain 2017 Tucson and Sonata Hybrid vehicles. The connecting rod bearings inside the engine may wear prematurely, which can result in engine damage.

Remedy

Dealers will inspect the engine. If bearing damage is found, the engine will be replaced. Dealers will also install a software update containing a new Knock Sensor Detection System (KSDS). Repairs will be performed free of charge. Owner notification letters are expected to be mailed November 12, 2021. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 209.

Vehicles

MAKE	MODEL	YEAR
HYUNDAI	SONATA HYBRID	2017
HYUNDAI	TUCSON	2017

[Rearview Camera Image May Not Display/FMVSS 111](#)

NHTSA Campaign Number: 21V729000

Manufacturer Chrysler (FCA US, LLC)

Components VISIBILITY, BACK OVER PREVENTION

Potential Number of Units Affected 56,180

Summary

Chrysler (FCA US, LLC) is recalling certain 2021 Jeep Grand Cherokee L vehicles. A radio software error may prevent the rearview image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

FCA US LLC will update the radio software, free of charge. Owner notification letters are expected to be mailed November 10, 2021. Owners may contact FCA US LLC customer service at 1-800-853-1403. FCA US LLC's number for this recall is Y67.

Vehicle

MAKE	MODEL	YEAR
JEEP	GRAND CHEROKEE	2021

Ball Joint May Fail and Cause Wheel Separation

NHTSA Campaign Number: 21V718000

Manufacturer Fox Factory, Inc.

Components SUSPENSION

Potential Number of Units Affected 1,413

Summary

Fox Factory, Inc. (Fox Factory) is recalling certain 2019-2021 GMC Sierra 1500 and Chevrolet Silverado 1500 vehicles that are equipped with Tuscany Kits, model number 501T-02-00064. Excessive wear to the front-upper control arm ball joints could result in ball joint failure and wheel separation.

Remedy

Dealers will replace the original equipment front-upper control arms with new Tuscany front-upper control arms, free of charge. Owner notification letters are expected to be mailed October 1, 2021. Owners may contact Fox Factory at 1-831-274-6500.

Vehicles

MAKE	MODEL	YEAR
TUSCANY MOTOR CO	CHEVROLET SILVERADO 1500	2019-2021
TUSCANY MOTOR CO	GMC SIERRA 1500	2019-2021