



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest November 22, 2021

Disabled Air Bags

NHTSA Campaign Number: 21V873000

Manufacturer Chrysler (FCA US, LLC)

Components AIR BAGS

Potential Number of Units Affected 99,255

Summary

Chrysler (FCA US, LLC) is recalling certain 2021 Jeep Grand Cherokee L, 2022 Jeep Wagoneer, and Grand Wagoneer vehicles. The Occupant Restraint Controller (ORC) may have incorrect software which can disable the driver, passenger, and knee air bags without warning.

Remedy

Dealers will reprogram the ORC, free of charge. Owner notification letters are expected to be mailed December 30, 2021. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y79.

Vehicles

MAKE	MODEL	YEAR
JEEP	GRAND CHEROKEE	2021
JEEP	GRAND WAGONEER	2022
JEEP	WAGONEER	2022

Disabled Passenger Air Bag

NHTSA Campaign Number: 21V874000

Manufacturer Volkswagen Group of America, Inc.

Components SEATS, AIR BAGS

Potential Number of Units Affected 208,332

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 2017-2020 A4 Allroad, A4 Sedan, 2018-2019 RS5 Coupe, 2019 RS5 Sportback, 2018-2020 A5 Cabriolet, A5 Coupe, A5 Sportback, S4 Sedan, S5 Cabriolet, S5 Coupe, and Audi S5 Sportback vehicles. The cable connecting the seat heater to the Passenger Occupant Detection System (PODS) may have a contact fault, causing the software to misdiagnose a malfunction and disable the passenger air bag.

Remedy

Dealers will replace the connecting cable and either the heating mat or entire seat cover, free of charge. Owner notification letters are expected to be mailed January 7, 2022. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 74E3. This recall is an expansion of Recall 19V-547 (74D9). Vehicles previously repaired under 19V-547 will need to return for the new remedy.

Vehicles

MAKE MODEL YEAR

AUDI	A4	2017-2020
AUDI	A5	2018-2020
AUDI	RS5	2018-2019
AUDI	S4	2018-2020
AUDI	S5	2018-2020

Driver's Air Bag Cushion May Tear

NHTSA Campaign Number: 21V868000

Manufacturer Tesla, Inc.

Components AIR BAGS

Potential Number of Units Affected 7,600

Summary

Tesla, Inc. (Tesla) is recalling certain 2021 Model X and Model S vehicles. The driver's air bag cushion may tear during deployment.

Remedy

Tesla Service will replace the driver's air bag, free of charge. Owner notification letters are expected to be mailed January 7, 2022. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-21-20-007.

Vehicles

MAKE MODEL YEAR

TESLA MODEL S 2021

TESLA MODEL X 2021

Possible Sudden Loss of Braking Assist

NHTSA Campaign Number: 21V890000

Manufacturer Toyota Motor Engineering & Manufacturing

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 227,490

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2018-2019 Camry vehicles. The vane cap inside the vacuum pump may break, causing the pump to fail, which could result in a sudden loss of braking assist.

Remedy

Dealers will repair or replace the vacuum pump, as necessary, free of charge. Owner notification letters are expected to be mailed December 16, 2021. Owners may contact Toyota customer service at 1-800-331-4331.

Vehicle

MAKE MODEL YEAR

TOYOTA CAMRY 2018-2019

High Pressure Fuel Pump May Fail

NHTSA Campaign Number: 21V880000

Manufacturer Chrysler (FCA US, LLC)

Components FUEL SYSTEM, DIESEL

Potential Number of Units Affected 222,410

Summary

Chrysler (FCA US, LLC) is recalling certain 2019-2020 Ram 2500, 3500 pickup trucks, and Ram 3500, 4500, and 5500 cab chassis vehicles equipped with Cummins 6.7L Turbo Diesel engines. The High Pressure Fuel Pump (HPFP) may fail, resulting in a sudden engine stall without warning.

Remedy

Dealers will replace the HPFP, update the Powertrain Control Module (PCM) software, and inspect and replace additional fuel system components as necessary, free of charge. Owner notification letters are expected to be mailed January 1, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y78.

Vehicles

MAKE MODEL YEAR

RAM	2500	2019-2020
RAM	3500	2019-2020
RAM	4500	2019-2020
RAM	5500	2019-2020

Fuel Pump May Fail

NHTSA Campaign Number: 21V879000

Manufacturer Chrysler (FCA US, LLC)

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 1,622

Summary

Chrysler (FCA US, LLC) is recalling certain 2019 Fiat 124 Spider vehicles. The impeller inside the fuel pump may be deformed, potentially causing the fuel pump to fail.

Remedy

Dealers will replace the fuel pump, free of charge. Owner notification letters are expected to be mailed January 1, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y92.

Vehicle

MAKE MODEL YEAR

FIAT	124 SPIDER	2019
------	------------	------

Fuel Line Sensor Housing May Leak

NHTSA Campaign Number: 21V878000

Manufacturer Chrysler (FCA US, LLC)

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 11,419

Summary

Chrysler (FCA US, LLC) is recalling certain 2020-2021 Alfa Romeo Stelvio, and Alfa Romeo Giulia vehicles. The fuel line sensor housing may crack and leak fuel.

Remedy

Dealers will inspect and replace the fuel line sensor housing, as necessary, free of charge. Owner notification letters are expected to be mailed January 1, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y91.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

ALFA ROMEO	GIULIA	2020-2021
------------	--------	-----------

ALFA ROMEO	STELVIO	2020-2021
------------	---------	-----------

Fuel Pump May Fail

NHTSA Campaign Number: 21V875000

Manufacturer Mazda North American Operations

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 121,038

Summary

Mazda North American Operations (Mazda) is recalling certain 2018 Mazda3, Mazda6, 2019 CX-3, 2018-2019 MX-5, CX-5, CX-9, and 2019-2020 Mazda2 vehicles. The impeller inside the low-pressure fuel pump may crack and deform, potentially causing the fuel pump to fail.

Remedy

Dealers will replace the fuel pumps, free of charge. Owner notification letters are expected to be mailed January 11, 2022. Owners may contact Mazda customer service at 1-800-222-5500 Option 4. Mazda's number for this recall is 5321K.

Vehicles

MAKE MODEL YEAR

MAZDA CX-3 2019
MAZDA CX-5 2018-2019
MAZDA CX-9 2018-2019
MAZDA MAZDA2 2019-2020
MAZDA MAZDA3 2018
MAZDA MAZDA6 2018
MAZDA MX-5 2018-2019

Fuel Line Sensor Housing May Leak

NHTSA Campaign Number: 21V872000

Manufacturer Maserati North America, Inc.

Components FUEL SYSTEM, GASOLINE

Potential Number of Units Affected 409

Summary

Maserati North America, Inc. (Maserati) is recalling certain 2021 Quattroporte, Ghibli, 2021-2022 Levante, and 2022 MC20 vehicles. The fuel line sensor housing may crack and leak fuel.

Remedy

Dealers will replace the fuel line sensor housing, free of charge. Owner notification letters are expected to be mailed December 27, 2021. Owners may contact Maserati customer service at 1-877-696-2737. Maserati's number for this recall is 442.

Vehicles

MAKE MODEL YEAR

MASERATI GHIBLI 2021
MASERATI LEVANTE 2021-2022
MASERATI MC20 2022
MASERATI QUATTROPORTE 2021

Broken Shaft Seal May Cause Loss of Power Steering

NHTSA Campaign Number: 21V858000

Manufacturer Volvo Trucks North America

Components STEERING

Potential Number of Units Affected 3

Summary

Volvo Trucks North America (Volvo Trucks) is recalling certain 2021 VNL vehicles. A machining defect may cause pressure to build in the power steering pump, breaking the shaft seal and resulting in a loss of power steering assist.

Remedy

Dealers will replace the power steering pumps, free of charge. Owner notification letters are expected to be mailed December 22, 2021. Owners may contact Volvo Trucks customer service at 1-800-528-6586. Volvo Trucks number for this recall is RVXX2105.

Vehicle

MAKE MODEL YEAR

VOLVO VNL 2021

Loss of Steering Control

NHTSA Campaign Number: 21V864000

Manufacturer Daimler Trucks North America, LLC

Components STEERING

Potential Number of Units Affected 479

Summary

Daimler Trucks North America, LLC. (DTNA) is recalling certain 2021-2022 Western Star 49X vehicles. The steering shaft may not have been properly installed, causing it to separate from the steering gear.

Remedy

Dealers will inspect the steering shaft and repair it, as necessary, free of charge. Owners are advised to not drive their vehicles until the inspection has been performed. Owner notification letters are expected to be mailed January 3, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is 905.

Vehicle

MAKE MODEL YEAR

WESTERN STAR 49X 2021-2022

Incorrect Components in Rear Suspension Module

NHTSA Campaign Number: 21V870000

Manufacturer Ford Motor Company

Components SUSPENSION

Potential Number of Units Affected 20

Summary

Ford Motor Company (Ford) is recalling certain 2021 Explorer and Lincoln Aviator vehicles. Incorrect rear suspension module components may have been installed due to a labeling error.

Remedy

Dealers will inspect the rear suspension module, and replace any incorrect parts, as necessary, free of charge. Owner notification letters are expected to be mailed November 29, 2021. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S47.

Vehicles

MAKE	MODEL	YEAR
-------------	--------------	-------------

FORD	EXPLORER	2021
------	----------	------

LINCOLN	AVIATOR	2021
---------	---------	------