



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

Side Curtain Air Bag May Deploy Improperly

NHTSA Campaign Number: 21V925000

Manufacturer Chrysler (FCA US, LLC)

Components AIR BAGS

Potential Number of Units Affected 132

Summary

Chrysler (FCA US, LLC) is recalling certain 2021-2022 Ram 2500, Ram 3500, and 2021 Ram 1500 Classic pickup trucks. The side air bag inflatable curtain (SABIC) assemblies may have been manufactured with the incorrect amount of compressed gas, which can result in an improper air bag deployment.

Remedy

Dealers will replace the SABIC assemblies, free of charge. Owner notification letters are expected to be mailed January 13, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Y99.

Vehicles

MAKE MODEL YEAR

RAM	1500	2021
RAM	2500	2021-2022
RAM	3500	2021-2022

Infotainment System May Cause Driver Distraction

NHTSA Campaign Number: 21V931000

Manufacturer Mercedes-Benz USA, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 227

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2021 S580, 2022 EQS450, EQS580, and S500 vehicles with an active and connected Mercedes me connect account. The MBUX infotainment system might allow activation of the television and internet display while driving, causing a distraction for the driver.

Remedy

MBUSA has updated their computer server to correct the issue, free of charge. Therefore, owners will not require a visit to a dealer for this recall. Owner notification letters are expected to be mailed January 28, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	EQS450	2022
MERCEDES-BENZ	EQS580	2022
MERCEDES-BENZ	S500	2022
MERCEDES-BENZ	S580	2021

Oil Leak May Cause a Loss of Power Steering Assist

NHTSA Campaign Number: 21V920000

Manufacturer Toyota Motor Engineering & Manufacturing

Components STEERING

Potential Number of Units Affected 22,462

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2021-2022 Sequoia and 2021 Tundra vehicles. The power steering gear assembly may have been manufactured incorrectly, which can result in an oil leak.

Remedy

Dealers will inspect and replace the power steering gear assembly as necessary, free of charge. Owner notification letters are expected to be mailed January 22, 2022. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's numbers for this recall are 21TB10 and 21TA10.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

TOYOTA	SEQUOIA	2021-2022
--------	---------	-----------

TOYOTA	TUNDRA	2021
--------	--------	------

Work Brake May Unintentionally Disengage

NHTSA Campaign Number: 21V906000

Manufacturer PACCAR Incorporated

Components SERVICE BRAKES, AIR, ELECTRICAL SYSTEM

Potential Number of Units Affected 908

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2019-2022 Kenworth T880, W990, Peterbilt 567, 579, 389, and 2022 Peterbilt 536, 537 wrecker and auto hauler vehicles. The work brake (winch brake) may unintentionally disengage the service brakes during winching operations, causing the vehicle to roll.

Remedy

Dealers will update the vehicle software, free of charge. Owner notification letters are expected to be mailed January 18, 2022. Owners may contact PACCAR customer service at 1-425-828-5888 (Kenworth); or 1-940-591-4220 (Peterbilt). PACCAR's numbers for this recall are 21KWG and 21PBM.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

KENWORTH	T880	2019-2022
----------	------	-----------

KENWORTH	W990	2019-2022
----------	------	-----------

PETERBILT	389	2019-2022
-----------	-----	-----------

PETERBILT	536	2022
-----------	-----	------

PETERBILT	537	2022
-----------	-----	------

PETERBILT	567	2019-2022
-----------	-----	-----------

PETERBILT	579	2019-2022
-----------	-----	-----------

Reduced Braking Performance

NHTSA Campaign Number: 21V937000

Manufacturer Hyundai Motor America

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 76

Summary

Hyundai Motor America (Hyundai) is recalling certain 2021 Accent vehicles. The brake master cylinder may have been manufactured with sharp edges that can damage the inner oil seal, resulting in reduced braking performance.

Remedy

Dealers will replace the brake master cylinder, free of charge. Owner notification letters are expected to be mailed January 28, 2022. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 213.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

HYUNDAI	ACCENT	2021
---------	--------	------

KIA	RIO	2020-2021
-----	-----	-----------

Damaged Valve Stem May Cause Loss of Tire Pressure

NHTSA Campaign Number: 21V921000

Manufacturer Daimler Trucks North America, LLC

Components TIRES

Potential Number of Units Affected 18,808

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2017-2019 Freightliner Custom Chassis XCL, 2017-2022 XCM, XCS, 2017-2023 MC, XCR, 2018-2019 XBR, 2018-2020 XBS, 2018-2022 MBC, MT55, S2C, S2G, S2RV vehicles. The tire valve stem extension for the inner wheel may come into contact with the outer wheel rim opening and become damaged.

Remedy

Dealers will remove the inner valve stem extensions and stabilizers, free of charge. Owner notification letters are expected to be mailed January 21, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL912. Note: This recall supersedes and expands recall 20V-529 (FL-861). Vehicles previously repaired under 20V-529 will need to have the new remedy completed under this recall.

Vehicles

MAKE MODEL YEAR

FCCC	MBC	2018-2022
FCCC	MC	2017-2023
FCCC	MT55	2018-2022
FCCC	S2C	2018-2022
FCCC	S2G	2018-2022
FCCC	S2RV	2018-2022
FCCC	XBR	2018-2019
FCCC	XBS	2018-2020
FCCC	XCL	2017-2019
FCCC	XCM	2017-2022
FCCC	XCR	2017-2023
FCCC	XCS	2017-2022