



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

March 28, 2022

Initial Delay In Rearview Image Display/FMVSS 111

NHTSA Campaign Number: 22V169000

Manufacturer Tesla, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 947

Summary

Tesla, Inc. (Tesla) is recalling certain 2018-2019 Model S, Model X, and 2017-2020 Model 3 vehicles equipped with Autopilot Computer 2.5 and operating certain firmware releases. The rearview image may not immediately display when the vehicle begins to reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Tesla will perform an over-the-air (OTA) software update, free of charge. Owner notification letters are expected to be mailed May 17, 2022. Owners may contact Tesla customer service at 1-877-798-3752. Tesla's number for this recall is SB-22-00-004.

Vehicles

MAKE MODEL YEAR

TESLA MODEL 3 2017-2020

TESLA MODEL S 2018-2019

TESLA MODEL X 2018-2019

Incorrect Software May Cause System Failures

NHTSA Campaign Number: 22V168000

Manufacturer Mercedes-Benz USA, LLC

Components EXTERIOR LIGHTING, ELECTRONIC STABILITY CONTROL, ENGINE AND ENGINE COOLING

Potential Number of Units Affected 22

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2010 E350, 2014 G550, 2008-2009 C300, 2008 C350, 2009 CLK550, 2007 SL550, SLK280, and 2008 SLK350 vehicles. Various control units may have been updated with incorrect software configuration during a service repair. This can result in various system failures, such as loss of drive power, reduced exterior lighting, or loss of dynamic control functions, including stability and traction control.

Remedy

Dealers will update the software configuration on the affected control units, free of charge. Owner notification letters are expected to be mailed May 17, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES BENZ	C300	2008-2009
MERCEDES BENZ	C350	2008
MERCEDES BENZ	CLK550	2009
MERCEDES BENZ	G550	2014
MERCEDES BENZ	SL550	2007
MERCEDES BENZ	SLK280	2007
MERCEDES BENZ	SLK350	2008
MERCEDES-BENZ	E350	2010

Disabled Rear Lighting

NHTSA Campaign Number: 22V167000

Manufacturer Mercedes-Benz USA, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 9,156

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022 EQS 450, EQS 580, and 2021 S500 and S580 vehicles. A software error may disable the rear turn signals, hazard lights, and reverse lights.

Remedy

Dealers will update the rear signal software, free of charge. Owner notification letters are expected to be mailed May 13, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	EQS450	2022
MERCEDES-BENZ	EQS580	2022
MERCEDES-BENZ	S500	2021
MERCEDES-BENZ	S580	2021

Steering Assembly Bar May Bind Inside Rack

NHTSA Campaign Number: 22V154000

Manufacturer Chrysler (FCA US, LLC)

Components STEERING

Potential Number of Units Affected 931

Summary

Chrysler (FCA US, LLC) is recalling certain 2021-2022 Dodge Durango and 2022 Jeep Grand Cherokee vehicles. The steering gear rack bar may have been insufficiently hardened during manufacturing, possibly allowing it to bind within the steering rack, and resulting in difficulty steering or a loss of steering control.

Remedy

Dealers will replace the steering gear assembly, free of charge. Owner notification letters are expected to be mailed May 3, 2022. Owners may contact FCA US, LLC customer service at 1-800-852-1403. FCA US, LLC's number for this recall is Z18.

Vehicles

MAKE	MODEL	YEAR
DODGE	DURANGO	2021-2022
JEEP	GRAND CHEROKEE	2022

Brake Master Cylinder May Leak Fluid into Booster

NHTSA Campaign Number: 22V150000

Manufacturer Ford Motor Company

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 195,864

Summary

Ford Motor Company (Ford) is recalling certain 2016-2017 Ford Expedition, Lincoln Navigator, and 2016-2018 F-150 vehicles equipped with 3.5L Ecoboost engines. The brake master cylinder may allow brake fluid to leak from the front wheel circuit into the brake booster.

Remedy

Dealers will replace the brake master cylinder. If the master cylinder is leaking, the brake booster will also be replaced. Repairs will be performed free of charge. Owner notification letters are expected to be mailed April 25, 2022. This recall is an expansion of NHTSA recall number 20V-332. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S11.

Vehicles

MAKE	MODEL	YEAR
FORD	EXPEDITION	2016-2017
FORD	F-150	2016-2018
LINCOLN	NAVIGATOR	2016-2017

Headlight Reflection May Cause Glare/FMVSS 108

NHTSA Campaign Number: 22V137000

Manufacturer General Motors, LLC

Components EXTERIOR LIGHTING

Potential Number of Units Affected 740,581

Summary

General Motors, LLC (GM) is recalling certain 2010-2017 GMC Terrain vehicles. A reflection caused by the headlight housings may illuminate areas above the vehicle and outside of the driver's view with excessively bright light. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed April 23, 2022. Owners may contact GMC customer service at 1-800-462-8782. GM's number for this recall is N222363740.

Vehicle

MAKE MODEL YEAR

GMC TERRAIN 2010-2017

Battery Cable May Become Damaged and Short

NHTSA Campaign Number: 22V164000

Manufacturer Navistar, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 2,804

Summary

Navistar, Inc. (Navistar) is recalling certain 2018-2023 International LT vehicles equipped with a 1500W Purkeys inverter system. The positive battery cable may be incorrectly routed, causing it to chafe on the side skirt frame and become damaged.

Remedy

Dealers will replace any damaged battery cables and install new inverter cable brackets and saddles, free of charge. Owner notification letters are expected to be mailed May 16, 2022. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 22507.

Vehicle

MAKE MODEL YEAR

INTERNATIONAL LT 2018-2023

Unreliable HV Battery Connection May Cause Stall

NHTSA Campaign Number: 22V162000

Manufacturer Volkswagen Group of America, Inc.

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 351

Summary

Volkswagen Group of America, Inc. (Volkswagen) is recalling certain 2021 ID4 vehicles. Incorrect soldering of the flexible printed circuit assembled (FPCA), inside the high voltage (HV) battery, may cause an unreliable connection.

Remedy

The remedy is still under development. Owner notification letters are expected to be mailed by May 13, 2022. Owners may contact Volkswagen customer service at 1-800-893-5298. Volkswagen's number for this recall is 9302.

Vehicle

MAKE	MODEL YEAR
VOLKSWAGEN ID.4	2021

High Voltage Battery May Fail

NHTSA Campaign Number: 22V149000

Manufacturer Ford Motor Company

Components ELECTRICAL SYSTEM, HYBRID PROPULSION SYSTEM

Potential Number of Units Affected 3

Summary

Ford Motor Company (Ford) is recalling certain 2022 Corsair and 2021-2022 Escape vehicles equipped with a 2.5L Hybrid powertrain. The high voltage battery may fail, resulting in a sudden loss of drive power.

Remedy

Dealers will replace the high voltage battery, free of charge. Owner notification letters are expected to be mailed March 28, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 21S48.

Vehicles

MAKE	MODEL	YEAR
FORD	ESCAPE	2021-2022
LINCOLN	CORSAIR	2022

