



Automotive Safety Council

Prevent Protect Notify

NHTSA Recalls of Interest

May 23, 2022

Driver's Air Bag May Not Deploy

NHTSA Campaign Number: 22V337000

Manufacturer Ford Motor Company

Components AIR BAGS

Potential Number of Units Affected 310,203

Summary

Ford Motor Company (Ford) is recalling certain 2016 Super Duty F-250, F-350, F-450, and F-550 vehicles. Dust may accumulate in the steering wheel clock spring, causing a disconnection in the electrical connection, resulting in the driver air bag not deploying as intended.

Remedy

Dealers will replace the steering wheel clock spring, free of charge. Owner notification letters are expected to be mailed July 5, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S35.

Vehicles

MAKE MODEL YEAR

FORD F-250 SD 2016

FORD F-350 SD 2016

MAKE MODEL YEAR

FORD F-450 SD 2016

FORD F-550 SD 2016

Seat Belt Locking Retractor Malfunction/FMVSS 208

NHTSA Campaign Number: 22V335000

Manufacturer Mitsubishi Motors North America, Inc.

Components SEAT BELTS

Potential Number of Units Affected 2,865

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2022 Outlander vehicles. The Automatic Locking Retractor (ALR) in the right front, second-row right, and second-row left seat belt assemblies may deactivate before the seat belts are fully retracted, which can result in an unsecured child restraint system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 208, "Occupant Crash Protection."

Remedy

Dealers will inspect and replace the seat belt assemblies, as necessary, free of charge. Owner notification letters are expected to be mailed June 23, 2022. Owners may contact MMNA customer service at 1-88-648-7820. MMNA's number for this recall is SR-22-002.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

MITSUBISHI	OUTLANDER	2022
------------	-----------	------

Software Error May Cause Unintended Acceleration

NHTSA Campaign Number: 22V333000

Manufacturer Ford Motor Company

Components VEHICLE SPEED CONTROL, POWER TRAIN

Potential Number of Units Affected 464

Summary

Ford Motor Company (Ford) is recalling certain 2021 Mustang Mach-E vehicles equipped with all-wheel drive. The powertrain control module (PCM) functional safety software may fail to detect a software error, resulting in unintended acceleration, unintended deceleration, or a loss of drive power.

Remedy

The PCM software will be updated by a dealer, or through an over-the-air (OTA) update, free of charge. Owner notification letters are expected to be mailed May 30, 2022. Owners may contact Ford customer service at 1-800-436-7332. Ford's number for this recall is 22S29.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

FORD	MUSTANG MACH E	2021
------	----------------	------

Blank Instrument Cluster Display Screen/FMVSS 101

NHTSA Campaign Number: 22V344000

Manufacturer Kia Motors America

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 2,761

Summary

Kia Motors America (Kia) is recalling certain 2022 Telluride vehicles. Excess adhesive in a circuit board within the instrument cluster may cause the instrument cluster display screen to be blank. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays."

Remedy

Dealers will replace the instrument cluster assembly, free of charge. Owner notification letters are expected to be mailed July 15, 2022. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC237.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

KIA	TELLURIDE	2022
-----	-----------	------

Disabled ABS & Stability Control/FMVSS 121 & 136

NHTSA Campaign Number: 22V339000

Manufacturer Daimler Trucks North America, LLC

Components SERVICE BRAKES, AIR, ELECTRONIC STABILITY CONTROL

Potential Number of Units Affected 24

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Freightliner Cascadia vehicles. The antilock brakes (ABS) and electronic stability control (ESC) may be manually disabled. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 121, "Air Brake Systems," and 136, "Electronic Stability Control Systems on Heavy Vehicles."

Remedy

Dealers will correct this feature, free of charge. Owner notification letters are expected to be mailed July 14, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-932.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

FREIGHTLINER	CASCADIA	2022
--------------	----------	------

Forward-Facing Camera is Misaligned

NHTSA Campaign Number: 22V334000

Manufacturer Ford Motor Company

Components FORWARD COLLISION AVOIDANCE

Potential Number of Units Affected 32

Summary

Ford Motor Company (Ford) is recalling certain 2022 Mustang vehicles equipped with an Image Processing Module A (IPMA) or forward-facing camera. The camera is misaligned to the vehicle, resulting in the camera not functioning as intended.

Remedy

Dealers will realign the front-facing camera, free of charge. Owner notification letters are expected to be mailed May 30, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S34.

Vehicle

MAKE MODEL YEAR

FORD MUSTANG 2022

Engine Compartment Fire

NHTSA Campaign Number: 22V346000

Manufacturer Ford Motor Company

Components ENGINE

Potential Number of Units Affected 39,013

Summary

Ford Motor Company (Ford) is recalling certain 2021 Expedition and Lincoln Navigator vehicles. An engine compartment fire may occur while driving or parked, even with the ignition in the "Off" position.

Remedy

Owners are advised to park their vehicles outside and away from structures until the remedy is performed. The remedy is still under development. Letters notifying owners of the safety risk are expected to be mailed May 23, 2022. A second letter will be mailed once the remedy is available. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22S36.

Vehicles

MAKE MODEL YEAR

FORD EXPEDITION 2021

LINCOLN NAVIGATOR 2021

Vehicle Rollaway from Software Error

NHTSA Campaign Number: 22V324000

Manufacturer Hyundai Motor America

Components PARKING BRAKE

Potential Number of Units Affected 10,729

Summary

Hyundai Motor America (Hyundai) is recalling certain 2022 Ioniq 5 vehicles. A software error in the Shifter Control Unit (SCU) may disengage the parking mechanism, which can allow the vehicle to rollaway.

Remedy

Drivers are recommended to use the Electronic Parking Brake (EPB) when parking their vehicles until the remedy has been performed. Dealers will update the Shifter Control Unit software, free of charge. Owner notification letters are expected to be mailed July 10, 2022. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 228.

Vehicle

MAKE MODEL YEAR

HYUNDAI IONIQ 5 2022

Vehicle Rollaway from Software Error

NHTSA Campaign Number: 22V322000

Manufacturer Kia Motors America

Components PARKING BRAKE

Potential Number of Units Affected 9,014

Summary

Kia Motor America (Kia) is recalling certain 2022 EV6 vehicles. A software error in the Shifter Control Unit (SCU) may disengage the parking mechanism, which can allow the vehicle to rollaway.

Remedy

Drivers are recommended to park their vehicles on level ground and avoid parking on a slope/inclined surface whenever possible until the remedy has been performed. Dealers will update the Shifter Control Unit software, free of charge. Owner notification letters are expected to be mailed May 25, 2022. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC236.

Vehicle

MAKE MODEL YEAR

KIA EV6 2022

