



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

May 9, 2022

Missing Inoperative Collision Mitigation Warning

NHTSA Campaign Number: 22V282000

Manufacturer Navistar, Inc.

Components EQUIPMENT, FORWARD COLLISION AVOIDANCE

Potential Number of Units Affected 45

Summary

Navistar, Inc. (Navistar) is recalling certain 2022-2023 International MV, International HV, and 2022 IC RE commercial buses built without a forward radar unit. The warning label notifying the driver that the collision mitigation system is inoperative may be missing.

Remedy

Navistar will provide a warning label and installation instructions, free of charge. Owner notification letters are expected to be mailed June 24, 2022. Owners may contact Navistar customer service at 1-800-448-7825. Navistar's number for this recall is 22508.

Vehicles

MAKE	MODEL	YEAR
IC BUS	RE	2022
INTERNATIONAL HV		2022-2023
INTERNATIONAL MV		2022-2023

Inoperable Rearview Camera Display/FMVSS 111

NHTSA Campaign Number: 22V281000

Manufacturer Daimler Vans USA, LLC

Components BACK OVER PREVENTION

Potential Number of Units Affected 12,086

Summary

Daimler Vans USA, LLC (DVUSA) is recalling certain 2019-2021 Freightliner Sprinter and Mercedes-Benz Sprinter vehicles. The rearview camera may not display the rearview image due to a software error. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the rearview camera software, free of charge. Owner notification letters are expected to be mailed June 13, 2022. Owners may contact DVUSA customer service at 1-877-762-8267. DVUSA's number for this recall is VS3KOMRUE.

Vehicles

MAKE	MODEL	YEAR
FREIGHTLINER	SPRINTER 1500	2019-2021
FREIGHTLINER	SPRINTER 2500	2019-2021
FREIGHTLINER	SPRINTER 3500	2019-2021
FREIGHTLINER	SPRINTER 4500	2019-2021
MERCEDES-BENZ	SPRINTER 1500	2019-2021
MERCEDES-BENZ	SPRINTER 2500	2019-2021
MERCEDES-BENZ	SPRINTER 3500	2019-2021
MERCEDES-BENZ	SPRINTER 4500	2019-2021

Rearview Camera Image May Not Display/FMVSS 111

NHTSA Campaign Number: 22V285000

Manufacturer Toyota Motor Engineering & Manufacturing

Components ELECTRICAL SYSTEM, BACK OVER PREVENTION

Potential Number of Units Affected 18,101

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2022 Tundra vehicles equipped with a Panoramic View Monitor (PVM) system. The parking assist electronic control unit (ECU) software may prevent transmission of the rearview camera signal during cold weather, preventing the rearview image from displaying. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will reprogram the parking assist ECU software, free of charge. Owner notification letters are expected to be mailed May 30, 2022. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 22TA04.

Vehicle

MAKE MODEL YEAR

TOYOTA TUNDRA 2022

Driver and Passenger Seat Wire Harness Damage

NHTSA Campaign Number: 22V278000

Manufacturer Porsche Cars North America, Inc.

Components SEATS

Potential Number of Units Affected 9,570

Summary

Porsche Cars of North America, Inc. (Porsche) is recalling certain 2020-2021 Taycan vehicles. The driver and passenger seat wire harness could become damaged during horizontal seat adjustment.

Remedy

Dealers will inspect the seat wire harness for damage, and add fabric tape to secure the harness, free of charge. Owner notification letters are expected to be mailed June 24, 2022. Owners may contact Porsche customer service at 1-800-767-7243. Porsche's number for this recall is ANA5.

Vehicle

MAKE MODEL YEAR

PORSCHE TAYCAN 2020-2021

Stuck EGR Valve May Cause Loss of Drive Power

NHTSA Campaign Number: 22V284000

Manufacturer Chrysler (FCA US, LLC)

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 1,308

Summary

Chrysler (FCA US, LLC) is recalling certain 2021 Dodge Durango, Jeep Grand Cherokee WK, 2022 Jeep Grand Cherokee, and 2021-2022 Jeep Grand Cherokee L vehicles equipped with 3.6L engines. The exhaust gas recirculation (EGR) valve may stick open, resulting in an unexpected loss of drive power.

Remedy

Dealers will replace the EGR valve assembly, free of charge. Owner notification letters are expected to be mailed June 17, 2022. Owners may contact FCA US, LLC customer service at 1-800-853-1403. FCA US, LLC's number for this recall is Z31.

Vehicles

MAKE	MODEL	YEAR
DODGE	DURANGO	2021
JEEP	GRAND CHEROKEE	2021-2022

Steering Fasteners May Fail

NHTSA Campaign Number: 22V277000

Manufacturer PACCAR Incorporated

Components STEERING

Potential Number of Units Affected 17,641

Summary

PACCAR Incorporated (PACCAR) is recalling certain 2018-2020 Kenworth T270, T370, T440, T470, T660, T680, T880, T800, W900, W990; and 2018-2020 Peterbilt 330, 337, 348, 365, 367, 389, 520, 567, and 579 vehicles. The Dana D-Series axle steer arm fasteners that attach the steering arm to the steering knuckle may fail.

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed June 24, 2022. Owners may contact Kenworth customer service at 1-425-828-5888 and Peterbilt customer service at 1-940-591-4220. PACCAR's numbers for this recall are 22 PBB and 22 KWB.

Vehicles

MAKE MODEL YEAR

KENWORTH T270	2018-2020
KENWORTH T370	2018-2020
KENWORTH T440	2018-2020
KENWORTH T470	2018-2020
KENWORTH T660	2018-2019
KENWORTH T680	2018-2020
KENWORTH T800	2018-2020
KENWORTH T880	2018-2020
KENWORTH W900	2018-2020
KENWORTH W990	2018-2020
PETERBILT 330	2018-2020
PETERBILT 337	2018-2020
PETERBILT 348	2018-2020
PETERBILT 365	2018-2020
PETERBILT 367	2018-2020
PETERBILT 389	2018-2020
PETERBILT 520	2018-2020
PETERBILT 567	2018-2020
PETERBILT 579	2018-2020