



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

July 11, 2022

Inoperable Rearview Camera Display/FMVSS 111

NHTSA Campaign Number: 22V470000

Manufacturer Mitsubishi Motors North America, Inc.

Components BACK OVER PREVENTION

Potential Number of Units Affected 56,080

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2022 Outlander vehicles. The rearview camera may not display the rearview image due to a software error. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the rearview camera software, free of charge. Owner notification letters are expected to be mailed August 1, 2022. Owners may contact MMNA customer service at 1-88-648-7820. MMNA's number for this recall is SR-22-003.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

MITSUBISHI	OUTLANDER	2022
------------	-----------	------

Inflator May Explode or Underinflate Air Bag

NHTSA Campaign Number: 22V471000

Manufacturer Volkswagen Group of America, Inc.

Components AIR BAGS

Potential Number of Units Affected 28,624

Summary

Volkswagen Group of America, Inc. (Audi) is recalling certain 1998 Audi A8 and 1997-1998 Audi A4 vehicles equipped with Non-Azide Driver air bag Inflators (NADI) that do not contain phase stabilized ammonium nitrate (PSAN) propellant. Due to a manufacturing issue, the NADI inflator may absorb moisture, causing the inflator to explode or the air bag cushion to underinflate.

Remedy

Dealers will replace the driver's air bag inflator with an alternative inflator of a different design, free of charge. Owner notification letters were sent September 21, 2021. Owners may contact Audi customer service at 1-800-253-2834. Audi's number for this recall is 69BT. The vehicles in this recall were mistakenly omitted from recall 20V-056. All vehicle owners have already been notified by mail and informed that the remedy is available.

Vehicles

MAKE	MODEL	YEAR
------	-------	------

AUDI	A4	1997-1998
------	----	-----------

AUDI	A8	1998
------	----	------

Risk of Vehicle Rollaway/FMVSS 121

NHTSA Campaign Number: 22V468000

Manufacturer Daimler Trucks North America, LLC

Components PARKING BRAKE

Potential Number of Units Affected 17

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Freightliner Cascadia vehicles. The electronic parking brake may not engage when the vehicle is keyed off, which may result in a vehicle rollaway. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard numbers 121, "Air Brake Systems," and 136, "Electronic Stability Control Systems on Heavy Vehicles."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed August 29, 2022. Owners may contact DNTA customer service at 1-800-547-0712. DTNA's number for this recall is FL-945.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

FREIGHTLINER	CASCADIA	2022
--------------	----------	------

Vehicle Rollaway from Unsecured Electronic Axle

NHTSA Campaign Number: 22V460000

Manufacturer Daimler Trucks North America, LLC

Components POWER TRAIN

Potential Number of Units Affected 16

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2021-2022 FCCC MT50e walk-in vans. The electronic axle parking pawl may be broken or damaged which, when in park without the emergency brake set, can result in vehicle rollaway.

Remedy

Dealers will inspect and repair the electronic axle, as necessary, free of charge. Owner notification letters are expected to be mailed August 26, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL944.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

FCCC	MT50E	2021-2022
------	-------	-----------

Power Relay Under Rear Seat May Cause Fire

NHTSA Campaign Number: 22V459000

Manufacturer Hyundai Motor America

Components HYBRID PROPULSION SYSTEM

Potential Number of Units Affected 10,575

Summary

Hyundai Motor America (Hyundai) is recalling certain 2017-2018 Ioniq HEV and Ionic PHV vehicles previously recalled under recall number 18V-704. The Power Relay Assembly (PRA) located underneath the rear seat may overheat.

Remedy

Dealers will inspect and replace the main relay or PRA, as necessary, free of charge. Owner notification letters are expected to be mailed August 26, 2022. Owners may contact Hyundai customer service at 1-855-371-9460. Hyundai's number for this recall is 232. This recall replaces NHTSA recall number 18V-704. Vehicles already repaired under the previous recall will need to have the new remedy completed.

Vehicles

MAKE	MODEL	YEAR
HYUNDAI IONIQ HYBRID		2017-2018
HYUNDAI IONIQ PLUG-IN HYBRID		2017-2018

ABS Fault Codes Not Stored/FMVSS 121

NHTSA Campaign Number: 22V456000

Manufacturer Daimler Trucks North America, LLC

Components SERVICE BRAKES, AIR

Potential Number of Units Affected 17

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2022 Freightliner Cascadia vehicles. The Anti-lock Brake System (ABS) fault codes will not be stored when the vehicle is keyed off for more than 5 seconds, impairing its diagnostic features and warning light. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 121, "Air Brake Systems."

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed August 23, 2022. Owners may contact DTNA customer service at 1-800-547-0712. DTNA's number for this recall is FL-943.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

FREIGHTLINER CASCADIA	2022
-----------------------	------

Side Marker and Daytime Running Lights May Fail

NHTSA Campaign Number: 22V455000

Manufacturer Ford Motor Company

Components EXTERIOR LIGHTING

Potential Number of Units Affected 965

Summary

Ford Motor Company (Ford) is recalling certain 2022 Lincoln Navigator vehicles. The headlight control module software may cause the side marker and daytime running lights to fail. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 108, "Lamps, Reflective Devices, and Associated Equipment."

Remedy

Dealers will update the headlight control module software and recalibrate the headlights, free of charge. Owner notification letters are expected to be mailed July 11, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22C14.

Vehicle

MAKE	MODEL	YEAR
------	-------	------

LINCOLN NAVIGATOR	2022
-------------------	------