



Automotive Safety Council

Prevent

Protect

Notify

NHTSA Recalls of Interest

July 25, 2022

[Center Display Missing Information/FMVSS 101](#)

NHTSA Campaign Number: 22V483000

Manufacturer BMW of North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 6,930

Summary

BMW of North America, LLC (BMW) is recalling certain 2022-2023 iX xDrive40, iX xDrive50, iX M60, 2022 i4 eDrive40, and i4 M50 vehicles equipped with hybrid electric powertrains. While in Valet Parking Mode, the Central Information Display (CID) may not display critical safety information, such as warning messages and/or warning lights. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 101, "Control and Displays."

Remedy

Dealers will update the display's head unit software, free of charge. Owner notification letters are expected to be mailed August 29, 2022. Owners may contact BMW customer service at 1-800-525-7417.

Vehicles

MAKE MODEL YEAR

BMW I4 2022

BMW IX 2022-2023

Rearview Camera Malfunction/FMVSS 111

NHTSA Campaign Number: 22V501000

Manufacturer Toyota Motor Engineering & Manufacturing

Components ELECTRICAL SYSTEM, BACK OVER PREVENTION

Potential Number of Units Affected 31,428

Summary

Toyota Motor Engineering & Manufacturing (Toyota) is recalling certain 2022 Tundra and Tundra Hybrid vehicles equipped with a Panoramic View Monitor (PVM) system. Incorrect programming of the parking-assist electronic control unit (ECU) software, may cause the front camera image to appear on the multimedia display instead of the rear camera image when the shifter is placed into reverse. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will reprogram the parking assist ECU, free of charge. Owner notification letters are expected to be mailed July 27, 2022. Owners may contact Toyota customer service at 1-800-331-4331. Toyota's number for this recall is 22TA07.

Vehicles

MAKE	MODEL	YEAR
TOYOTA	TUNDRA	2022
TOYOTA	TUNDRA HYBRID	2022

Inoperative Rearview Camera Display/FMVSS 111

NHTSA Campaign Number: 22V493000

Manufacturer Mercedes-Benz USA, LLC

Components BACK OVER PREVENTION

Potential Number of Units Affected 8,530

Summary

Mercedes-Benz USA, LLC (MBUSA) is recalling certain 2022 AMG EQS53, EQS580, EQS450, 2021 S500, S580, and Maybach S580 vehicles. The rearview camera may not display the rearview image due to a software error in the MBUX multimedia system. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 111, "Rear Visibility."

Remedy

Dealers will update the MBUX multimedia system software, free of charge. Owner notification letters are expected to be mailed September 9, 2022. Owners may contact MBUSA customer service at 1-800-367-6372.

Vehicles

MAKE	MODEL	YEAR
MERCEDES-BENZ	AMG EQS53	2022
MERCEDES-BENZ	EQS450	2022
MERCEDES-BENZ	EQS580	2022
MERCEDES-BENZ	MAYBACH S580	2021
MERCEDES-BENZ	S500	2021
MERCEDES-BENZ	S580	2021

Inoperative TPMS Sensor/FMVSS 138

NHTSA Campaign Number: 22V504000

Manufacturer Chrysler (FCA US, LLC)

Components TIRES

Potential Number of Units Affected 52,340

Summary

Chrysler (FCA US LLC) is recalling certain 2022 Dodge Challenger, Dodge Charger, and Chrysler 300 vehicles. The Tire Pressure Monitoring System (TPMS) sensor battery may fail prematurely and cause the sensor to become inoperative. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 138, "Tire Pressure Monitoring Systems."

Remedy

Dealers will inspect and replace the TPMS sensors, as necessary, free of charge. Owner notification letters are expected to be mailed September 2, 2022. Owners may contact FCA US, LLC at 1-800-853-1403. FCA US, LLC's number for this recall is Z68.

Vehicles

MAKE	MODEL	YEAR
CHRYSLER	300	2022
DODGE	CHALLENGER	2022
DODGE	CHARGER	2022

Passenger Seat Recline Mechanism Failure/FMVSS 210

NHTSA Campaign Number: 22V496000

Manufacturer Prevost Car (US) Inc.

Components SEATS

Potential Number of Units Affected 168

Summary

Prevost Car (US) Inc. (Prevost) is recalling certain 2021-2023 X3-45 commuter buses. The retention pin securing the passenger seat recline mechanism could fail, causing the mechanism to collapse, and result in a loose backrest. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 210, "Seat Belt Assembly Anchorages."

Remedy

Dealers will inspect and replace the retention pins and c-clips, if necessary, free of charge. Owner notification letters are expected to be mailed on August 22, 2022. Owners may contact Prevost's customer service at 1-866-870-2046.

Vehicle

MAKE	MODEL	YEAR
-------------	--------------	-------------

PREVOST	X3-45 COMMUTER	2021-2023
---------	----------------	-----------

Passenger Seat Frames May Crack

NHTSA Campaign Number: 22V510000

Manufacturer Daimler Trucks North America, LLC

Components SEATS

Potential Number of Units Affected 4,344

Summary

Daimler Trucks North America, LLC (DTNA) is recalling certain 2014-22 Thomas Built Buses HDX and EFX school buses equipped with 39-inch S3C seat frames and 3-point flex seatbelts. The passenger seat frames may crack and rotate from fatigue.

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed September 16, 2022. Owners may contact DTNA's customer service at 1-800-547-0712. DTNA's number for this recall is FL946.

Vehicles

MAKE	MODEL	YEAR
THOMAS BUILT BUSES	SAF-T-LINER EFX	2014-2022
THOMAS BUILT BUSES	SAF-T-LINER HDX	2014-2022

Parking Pawl Missing on Transmission

NHTSA Campaign Number: 22V497000

Manufacturer Isuzu Motors Limited

Components POWER TRAIN

Potential Number of Units Affected 4

Summary

Isuzu Motors Limited (Isuzu) is recalling certain 2022 FTR vehicles equipped with Allison 2500RDS (FVR) transmissions. The transmission is missing the parking pawl.

Remedy

Dealers will replace the 2500RDS (FVR) transmission with a 2550RDS (FTR) transmission, free of charge. Owner notification letters are expected to be mailed on August 12, 2022. Owners may contact Isuzu's customer service at 1-866-441-9638. Isuzu's number for this recall is V2203.

Vehicle

MAKE MODEL YEAR

ISUZU FTR 2022