

NHTSA Recalls of Interest August 15, 2022

Side Curtain Air Bag Malfunction/FMVSS 226

NHTSA Campaign Number: 22V594000

Manufacturer Ford Motor Company

Components AIR BAGS

Potential Number of Units Affected 64,974

Summary

Ford Motor Company (Ford) is recalling certain 2022 Maverick vehicles. The side-curtain air bags may not deploy properly. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 226, "Ejection Mitigation."

Remedy

Dealers will replace the left and right side-curtain air bag modules with a new design, free of charge. Owner notification letters are expected to be mailed September 22, 2022. Owners may contact Ford customer service at 1-866-436-7332. Ford's number for this recall is 22C20.

Vehicle

MAKE MODEL YEAR

FORD MAVERICK 2022

Battery Pack May Short and Cause Fire

NHTSA Campaign Number: 22V548000

Manufacturer Gillig, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 184

Summary

Gillig, LLC (Gillig) is recalling certain 2019-2022 Low Floor vehicles equipped with Cummins BP74E battery packs. The battery packs may develop a coolant leak internally, causing the battery pack to short circuit.

Remedy

Gillig will tighten the coolant fittings and replace the coolant, free of charge. Owner notification letters are expected to be mailed on September 27, 2022. A second letter will be mailed once a remedy is established. Owners may contact Gillig's customer service at 1-510-264-5073 or 1-800-735-1500.

Vehicle

MAKE MODEL YEAR

GILLIG LOW FLOOR 2019-2022

Loss of Power Brake Assist/FMVSS 135

NHTSA Campaign Number: 22V549000

Manufacturer Nissan North America, Inc.

Components SERVICE BRAKES, HYDRAULIC

Potential Number of Units Affected 5,904

Summary

Nissan North America, Inc. (Nissan) is recalling certain 2017-2019 Rogue Hybrid vehicles. The hydraulic brake booster assembly may overheat internally, resulting in a loss of power brake assist. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 135, "Light Vehicle Brake Systems."

Remedy

The remedy is under development. Owner notification letters are expected to be mailed September 22, 2022. Owners may contact Nissan's customer service at 1-800-867-7669. Nissan's number for this recall is R22A6.

Vehicle

MAKE MODEL YEAR

NISSAN ROGUE HYBRID 2017-2019

Missing Audio Safety Features

NHTSA Campaign Number: 22V580000

Manufacturer Jaguar Land Rover North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 18

Summary

Jaguar Land Rover North America, LLC (Jaguar) is recalling certain 2022 F-Pace vehicles. The vehicles were manufactured without an Audio Amplifier Module (AAM), and therefore will not provide audio safety features, such as seat belt reminders, turn signal sounds, and Advanced Driver Assistance System (ADAS) warnings.

Remedy

Dealers will install the missing AAM, free of charge. Owner notification letters are expected to be mailed September 30, 2022. Owners may contact Jaguar's customer service at 1-800-452-4827. Jaguar's number for this recall is H415.

Vehicle

MAKE MODEL YEAR

JAGUAR F-PACE 2022

Missing Audio Safety Features

NHTSA Campaign Number: 22V581000

Manufacturer Jaguar Land Rover North America, LLC

Components ELECTRICAL SYSTEM

Potential Number of Units Affected 52

Summary

Jaguar Land Rover North America, LLC (Land Rover) is recalling certain 2022 Land Rover Range Rover Velar vehicles. The vehicles were manufactured without an Audio Amplifier Module (AAM), and therefore will not provide audio safety features, such as seat belt reminders, turn signal sounds, and Advanced Driver Assistance System (ADAS) warnings.

Remedy

Dealers will install the missing AAM, free of charge. Owner notification letters are expected to be mailed September 30, 2022. Owners may contact Land Rover's customer service at 1-800-637-6837. Land Rover's number for this recall is N725.

Vehicle

MAKE MODEL YEAR

LAND ROVER RANGE ROVER VELAR 2022

Headliner Plate Detachment

NHTSA Campaign Number: 22V560000

Manufacturer Kia Motors America

Components STRUCTURE

Potential Number of Units Affected 257,998

Summary

Kia America, Inc. (Kia) is recalling certain 2012-2013 Optima vehicles. The right and left headliner plates may not be secured properly, which can result in the plates detaching in the event of a side curtain air bag deployment.

Remedy

Dealers will secure the headliner plates, free of charge. Owner notification letters are expected to be mailed September 26, 2022. Owners may contact Kia customer service at 1-800-333-4542. Kia's number for this recall is SC245.

Vehicle

MAKE MODEL YEAR

KIA OPTIMA 2012-2013

Engine Stall From Control Unit Software Error

NHTSA Campaign Number: 22V563000

Manufacturer Mitsubishi Motors North America, Inc.

Components POWER TRAIN

Potential Number of Units Affected 76,508

Summary

Mitsubishi Motors North America, Inc. (MMNA) is recalling certain 2019-2022 Outlander Sport vehicles equipped with continuously variable transmissions and mechanical key ignition systems. A software error in the transmission control unit (CVT-ECU) may incorrectly reduce the transmission gear ratio at high speeds, which can result in an engine stall.

Remedy

Dealers will update the CVT-ECU software, free of charge. Owner notification letters are expected to be mailed August 24, 2022. Owners may contact MMNA customer service at 1-888-648-7820. MMNA's number for this recall is SR-22-004.

Vehicle

MAKE MODEL YEAR

MITSUBISHI OUTLANDER SPORT 2019-2022

Electrical Short Circuit May Cause Engine Stall

NHTSA Campaign Number: 22V609000

Manufacturer Navistar, Inc.

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 283

Summary

Navistar, Inc. (Navistar) is recalling certain 2023 International LT, International Lonestar, International MV, International HX, and IC Bus TC Commercial buses. The engine control module (ECM) may experience an internal electrical short-circuit, causing the engine to stall.

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed September 26, 2022. Owners may contact Navistar customer service at 1-800-448-7825.

Vehicles

MAKE	MODE	EL YEAR
IC BUS	TC	2023
INTERNATIO	NAL HV	2023

Electrical Short Circuit May Cause Engine Stall

NHTSA Campaign Number: 22V605000

Manufacturer Volvo Trucks North America

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 12

Summary

Volvo Trucks North America (Volvo Trucks) is recalling certain 2023 Volvo VN vehicles. The engine control module (ECM) may experience an internal electrical short-circuit, causing the engine to stall.

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed September 29, 2022. Owners may contact Volvo Trucks' customer service at 1-800-528-6586. Volvo Trucks' number for this recall is RVXX2203.

Vehicle

MAKE MODEL YEAR

VOLVO VN 2023

Electrical Short Circuit May Cause Engine Stall

NHTSA Campaign Number: 22V610000

Manufacturer Navistar, Inc.

Components ENGINE AND ENGINE COOLING

Potential Number of Units Affected 33

Summary

Navistar, Inc. (Navistar) is recalling certain 2023 IC CE School Buses. The engine control module (ECM) may experience an internal electrical short-circuit, causing the engine to stall.

Remedy

The remedy is currently under development. Owner notification letters are expected to be mailed September 26, 2022. Owners may contact Navistar's customer service at 1-800-448-7825.

Vehicle

MAKE MODEL YEAR

IC BUS CE 2023

Cracks in Tire Tread Grooves/FMVSS 119

NHTSA Campaign Number: 22V588000

Manufacturer KTM North America, Inc.

Components TIRES

Potential Number of Units Affected 27,399

Summary

KTM North America, Inc. (KTM) is recalling certain 2019-2023 Husqvarna and KTM motorcycles with equipped with TKC80 tires. Please refer to KTM's recall report for specific model details. Cracks longer than 3/16 inch may develop in the tread grooves. As such, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard number 119, "New Pneumatic Tires-Other Than Passenger Cars."

Remedy

Dealers will replace the affected tires, free of charge. Owner notification letters are expected to be mailed September 19, 2022. Owners may contact KTM's customer service at 1-888-985-6090. KTM's numbers for this recall are KTB2208 and HTB2207.

Vehicles

MAKE	MODEL	YEAR
HUSQVARNA 701 ENDURO		2019-2021
HUSQVARNA 701 ENDURO LR		2020
HUSQVARNA FE 250		2019

MAKE	MODEL	YEAR
HUSQVARNA	FE 350	2019
HUSQVARNA	FE 350S	2020-2023
HUSQVARNA	FE 450	2019
HUSQVARNA	FE 501	2019
HUSQVARNA	FE 501S	2020-2023
KTM	1090 ADVENTURE R	2019
KTM	1290 SUPER ADVENTURE R	2019-2020
KTM	250 EXC-F	2019
KTM	350 EXC-F	2019-2023
KTM	450 EXC-F	2019
KTM	500 EXC-F	2019-2023
KTM	690 ENDURO R	2019-2022
KTM	890 ADVENTURE R	2021-2022
KTM	890 ADVENTURE R RALLY	2021

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V590000

Manufacturer Pierce Manufacturing

Components STEERING

Potential Number of Units Affected 529

Summary

Pierce Manufacturing (Pierce) is recalling certain 2021-2022 Velocity, Impel, Enforcer, Arrow XT, Quantum, and Dash CF trucks. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed September 30, 2022. Owners may contact Pierce's customer service at 1-888-974-3723. Pierce's number for this recall is 74B321.

Vehicles

MAKE MODEL YEAR

PIERCE ARROW XT2021-2022PIERCE DASH CF2021-2022PIERCE ENFORCER2021-2022

MAKE MODEL YEAR

PIERCE IMPEL2021-2022PIERCE QUANTUM2021-2022PIERCE VELOCITY2021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V592000

Manufacturer Orange EV

Components STEERING

Potential Number of Units Affected 3

Summary

Orange EV is recalling certain 2021-2022 T-Series Pure Electric Terminal Truck and e-Triever vehicles. The steering gears may have been incorrectly assembled, which can cause the gears to fracture.

Remedy

Orange EV will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed in August 2022. Owners may contact Orange's customer service at 1-785-214-1072. Orange's number for this recall is 22E047.

Vehicle

MAKE MODEL YEAR

ORANGE EV T-SERIES ELECTRIC TRUCK 2021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V570000

Manufacturer Ferrara Fire Apparatus, Inc.

Components STEERING

Potential Number of Units Affected 108

Summary

Ferrara Fire Apparatus, Inc. (Ferrara) is recalling certain 2021-2022 Inferno, Igniter, and Cinder fire trucks. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed September 05, 2022. Owners may contact Ferrara's customer service at 1-800-443-9006.

Vehicles

MAKE MODEL YEAR

FERRARA CINDER2021-2022FERRARA IGNITER2021-2022FERRARA INFERNO2021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V566000

Manufacturer Kalmar Solutions, LLC

Components STEERING

Potential Number of Units Affected 110

Summary

Kalmar Solutions, LLC (Kalmar) is recalling certain 2021-2022 Ottawa T2 terminal tractors. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed August 17, 2022. Owners may contact Kalmar customer service at 1-785-229-6327.

Vehicle

MAKE MODEL YEAR

KALMAR OTTAWA 2021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V561000

Manufacturer E-One Incorporated

Components STEERING

Potential Number of Units Affected 7

Summary

E-One Incorporated (E-One) is recalling certain 2021-2022 Cyclone N and Typhoon N vehicles. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed August 29, 2022. Owners may contact E-One customer service at 1-352-237-1122.

Vehicles

MAKE MODEL YEAR

E-ONE CYCLONE N 2021-2022 E-ONE TYPHOON N 2021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V531000

Manufacturer Shyft Group

Components STEERING

Potential Number of Units Affected 100

Summary

Shyft Group is recalling certain 2022-2023 Spartan RV Chassis K1, K2, K3, and K4 vehicles. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owner notification letters are expected to be mailed August 12, 2022. Owners may contact Spartan RV Chassis' customer service at 855.589.9836. Shyft Group's number for this recall is 22-04.

Vehicles

MAKE MODEL YEAR

SPARTAN K1	2022-2023
SPARTAN K2	2022-2023
SPARTAN K3	2022-2023
SPARTAN K4	2022-2023

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V537000

Manufacturer Capacity of Texas

Components STEERING

Potential Number of Units Affected 58

Summary

Capacity of Texas (Capacity of Texas) is recalling certain 2021-2022 TJ 5000, 6500, and 9000 vehicles. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. The manufacturer has not yet provided a schedule for recall notification. Owners may contact Capacity of Texas customer service at 1-800-323-0135.

Vehicles

MAKE MODEL YEAR

CAPACITY TJ 50002021-2022CAPACITY TJ 65002021-2022CAPACITY TJ 90002021-2022

Steering Gear Assembled Incorrectly

NHTSA Campaign Number: 22V551000

Manufacturer Eldorado National- California, Inc.

Components STEERING

Potential Number of Units Affected 14

Summary

Eldorado National-California, Inc. (Eldorado National-California) is recalling certain 2021-2022 ENC Axess vehicles. The steering gears may have been assembled incorrectly, which can cause the gears to fracture.

Remedy

Dealers will inspect and replace the steering gears, as necessary, free of charge. Owners may contact Eldorado National-California customer service at 1-951-684-6868.

Vehicle

MAKE MODEL YEAR

ELDORADO AXESS 2021-2022